


TYPE 3
SURVEY, ASSESSMENT AND REGISTER OF
ASBESTOS CONTAINING MATERIALS
AT
CANE HILL, COULSDON
SURREY, CR5 3ES

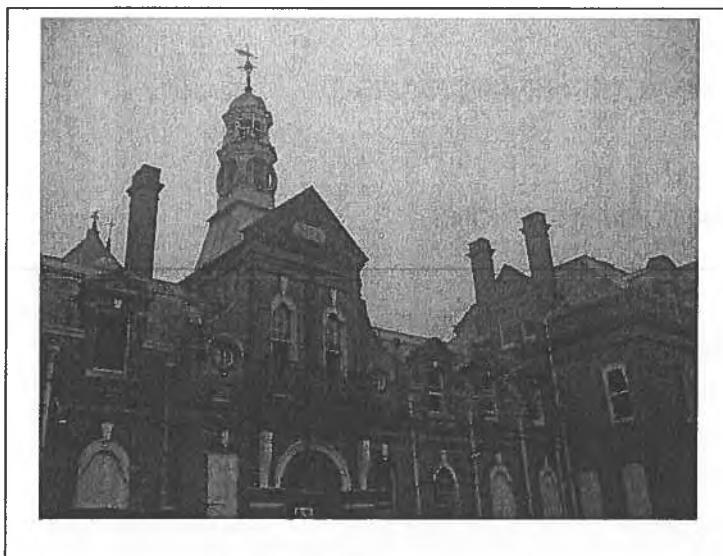

Report No. 06/B/8026

September 2006

**Strategic Risk Management
P.O. Box 167, Sandbach
Cheshire, CW11 3WG**

CONTENTS

1. EXECUTIVE SUMMARY
2. INTRODUCTION
3. SURVEY BRIEF AND CAVEAT
4. RECOMMENDATIONS
5. SURVEY INFORMATION SHEETS
6. APPENDICES

APPENDIX 1 - BULK ANALYSIS SHEETS

APPENDIX 2 - SURVEY PLANS

1. EXECUTIVE SUMMARY

1.1 The following asbestos containing materials (A.C.M.) were found in the building.

Location	Material type	Asbestos type	Level of Identification
Reception Block (SAS Building)			
Reception Block, (SAS Building) Male side W.C, Shires Lynx type Cistern (x5)	Plastic	Amosite (Brown)	Identified
Reception Block,(SAS Building), Male Side, Basement, Flash Pad	Rope	Chrysotile (White)	Identified
Reception Building Second Floor Front Office Panel beneath heater	Board	Amosite (Brown) Chrysotile (White)	Identified
Reception Building Second Floor Rear Office Panel beneath heater	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed
Reception Building First Floor Fireplace Panel & debris	Cement	Chrysotile (White)	Identified
Reception Building Ground Floor Office adjacent stairs to basement Panel behind radiator	Cement	Chrysotile (White)	Identified
Reception Building, Female side, Basement Fireplace panel	Cement	Chrysotile (White)	Identified
Reception Building, Female side, Basement Electrics Rope Seal	Rope	Chrysotile (White)	Identified
Reception Building Female Side, Ground Floor Front Office Shelf Panel above Radiator	Board	Amosite (Brown) Chrysotile (White)	Identified
Reception Building Female Side, First Floor WC Boxing	Cement	Chrysotile (White)	Strongly Presumed
Reception Building Female Side, First Floor Front Office, Partition Panels	Board	Amosite (Brown) Chrysotile (White)	Identified
Reception Building First Floor Lobby, Electrics Fuse Carriers & Shelf	Paper	Chrysotile (White)	Identified
Reception Building Ground Floor Rear Office Panel beneath shelf	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed
Reception Building Female Side, Loft Redundant Panel	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed

1. EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
Reception Block (SAS Building) continued			
Reception Building Corridor adjacent Reception Beige Floor Tile & Bitumen	Vinyl & Bitumen	Chrysotile (White)	Identified
Reception Building Corridor adjacent Reception Red Floor Tile & Bitumen	Vinyl & Bitumen	Chrysotile (White)	Identified
Reception Building Main Corridor skylight (X2) Rope seals	Rope	Chrysotile (White)	Identified
Reception Building W.C adjacent corridor External Flue Pipe	Cement	Chrysotile (White)	Strongly Presumed
Reception Building WC adjacent corridor Bunny Boiler flue pipe	Cement	Chrysotile (White)	Strongly Presumed
Reception Building WC Cistern (X3)	Plastic	Amosite (Brown)	Strongly Presumed
Hall/Chapel Area (and Surrounding Corridors)			
Hall/Chapel Area Corridor Left, Adjacent Hall/Chapel, Foil Pipe Lagging In Wall Void	Lagging	Chrysotile (White)	Identified
Hall/Chapel Area Fibre Board Paper Lining In Small Room Between Chapel And LHS Adj Corridor (debris throughout on floor)	Paper	Chrysotile (White)	Identified
Hall/Chapel Area, Fibre Board Ceiling Paper Lining In X – Ray room LHS Adj Corridor and debris	Paper	Chrysotile (White)	Strongly Presumed
Hall/Chapel Area X-Ray LHS Adjacent Corridor Rope seals to skylights	Rope	Chrysotile (White)	Strongly Presumed
Hall/Chapel Area, 2 nd Room, Cement Sheet In Floor Duct With Solid Floor Adj Left Hand Side Of Corridor (Lending Library)	Cement	Chrysotile (White)	Identified
Hall/Chapel Area, 2 nd Room next to Hall, Shires lynx WC cistern (X1) Adjacent Left Hand Side Of Corridor (Lending Library)	Plastic	Amosite (Brown)	Strongly Presumed
Hall/Chapel Area, 2 nd room Lending library, Fibre Board Ceiling	Paper on fibreboard	Chrysotile (White)	Identified
Hall/Chapel Area Corridor To The Back Of Chapel, Grey Floor Tiles	Bitumen only	Chrysotile (White)	Identified
Hall/Chapel Area, Corridor To The Back Of Chapel, Red Floor Tile	Bitumen only	Chrysotile (White)	Identified
Hall/Chapel Area Corridor To The Back Of Chapel, Access link, Rope to switchboards	Rope	Chrysotile (White)	Strongly Presumed
Hall/Chapel Area, Corridors adjacent Chapel Rope seals to skylights	Rope	Chrysotile (White)	Strongly Presumed

1.

EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
Hall/Chapel Area (and Surrounding Corridors) continued...			
Hall/Chapel Area Lightwell adjacent chapel RH rear, Corrugated cement sheets	Cement	Chrysotile (White)	Identified
Hall/Chapel Area, Dispensary, Radiator panels (X2)	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed
Hall/Chapel Area Dispensary Room, Sink Pad (x3)	Bitumen	Chrysotile (White)	Identified
Hall/Chapel Area, Vestry, Rope Cable To Ceiling Lights	Rope	Chrysotile (White)	Identified
Hall/Chapel Area, Vestry, Rope seals to skylights	Rope	Chrysotile (White)	Strongly Presumed
Hall/Chapel Area, Pipe Lagging, Covered Light Well, Next To Vestry	Lagging	Crocidolite (Blue) Amosite (Brown)	Identified
Hall/Chapel Area, Reception/Accounts Rope seals to skylights (3 sets)	Rope	Chrysotile (White)	Strongly Presumed
Hall/Chapel Area Chapel, Small Red Floor Tiles	Vinyl & Bitumen	Chrysotile (White) Chrysotile (White)	Identified
Hall/Chapel Area Chapel, Small Black Floor Tiles	Vinyl & Bitumen	Chrysotile (White) Chrysotile (White)	Identified
Olave/Queens Ward (Female Ward)			
Olave/Queens Ward, Undercroft, Foil Lagging	Lagging	Chrysotile (White)	Identified
Olave/Queens Ward Ground floor Toilet off 1 st ward – Shires Lynx WC cistern (X1)	Plastic	Amosite (Brown)	Strongly Presumed
Olave/Queens Ward Ground floor 1 st ward Flashpads in electrical box	Rope	Chrysotile (White)	Strongly Presumed
Olave/Queens Ward Sectional Lagging To Undercroft Pipework Debris	Lagging	Chrysotile (White) Amosite (Brown)	Identified
Olave/Queens Ward Undercroft Sectional Pipe Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Identified
Olave/Queens Ward Green Floor Tile In Second Room	Backing only	Chrysotile (White)	Identified
Olave/Queens Ward Undercroft – Sectional Pipe Lagging Strongly presumed throughout undercroft footprint	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Olave/Queens Ward Rawl plugs to metal rising pipe sheaths and metal grid heater covers in segregation rooms (Throughout Ward and presumed throughout site)	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed

1. EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
Olave/Queens Ward (Female Ward) continued...			
Olave/Queens Ward Sun Room/Verandah Rope to skylight	Rope	Chrysotile (White)	Strongly Presumed
Olave/Queens Ward W.C. Cistern	Plastic	Amosite (Brown)	Strongly Presumed
Olave/Queens Ward, Ground Floor, Kitchen adjacent corridor Rope to pipework	Rope	Chrysotile (White)	Identified
Olave/Queens Ward Ground Floor Kitchen adjacent corridor Rope Cloth wrap lagging to upper pipe	Rope Lagging	Chrysotile (White)	Identified
Olave/Queens Ward Corridor adjacent stairs Low level foil corrugated paper pipe lagging	Paper	Chrysotile (White)	Strongly Presumed
Olave/Queens Ward Corridor adjacent stairs Wall electrics	Rope	Chrysotile (White)	Strongly Presumed
Olave/Queens Ward WC adjacent ward Bunny Boiler Flue pipe (& internal panels)	Cement	Chrysotile (White)	Strongly Presumed
Olave/Queens Ward Rawl Plugs to pipe protection (presumed throughout)	Board	Chrysotile (White) Amosite (Brown)	Identified
Olave/Queens Ward Undercroft Stores Sink pads	Bitumen	Chrysotile (White)	Strongly Presumed
Olave/Queens Ward Undercroft Stores Cisterns (X18)	Plastic	Amosite (Brown)	Strongly Presumed
Olave/Queens Ward Undercroft Stores Redundant panels	Board	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Olave/Queens Ward Undercroft Stores Lagging debris	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Olave/Queens Ward External flue pipe	Cement	Chrysotile (White)	Strongly Presumed
Browning/Blake Ward			
Browning/Blake Ward External flue & cowl	Cement	Chrysotile (White)	Strongly Presumed
Browning/Blake Ward Sun Room Rope to skylights	Rope	Chrysotile (White)	Strongly Presumed
Browning/Blake Ward W.C. Cistern (X12)	Plastic	Amosite (Brown)	Strongly Presumed

1. EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
Browning/Blake Ward continued...			
Browning/Blake Ward Room adjacent sun room Flue pipe	Cement	Chrysotile (White)	Strongly Presumed
Browning/Blake Ward Female Ward Undercroft Pipe Lagging Debris (presumed throughout)	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Browning/Blake Ward End Ward Undercroft Pipe Lagging Debris (presumed throughout)	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Browning/Blake Ward Room adjacent end ward Panel behind radiator (X2)	Board	Chrysotile (White)	Identified
Browning/Blake Ward Office adjacent ward Ironing Board Pad	Cement	Chrysotile (White)	Strongly Presumed
Browning/Blake Ward Kitchen adjacent corridor Rope to pipe work within wood boxed riser	Rope	Chrysotile (White)	Strongly Presumed
Browning/Blake Ward First Floor Grey Floor Tile & Bitumen	Vinyl & Bitumen	Chrysotile (White)	Identified
Browning/Blake Ward First Floor Kitchen Sink Pad	Bitumen	Chrysotile (White)	Identified
Browning/Blake Ward First floor WC adjacent corridor from stairs, Flue pipe	Cement	Chrysotile (White)	Strongly Presumed
Browning/Blake Ward External Store Corrugated Roof sheet & Side Panels	Cement	Chrysotile (White)	Strongly Presumed
Plant Room adjacent Reception Building			
Calorifier Room adjacent Reception Building Blue Pipe Lagging	Lagging	Amosite (Brown)	Identified
Calorifier Room adjacent Reception Building Large Tanks (2)	Lagging	Amosite (Brown)	Identified
Calorifier Room adjacent Reception Building Floor Debris (presumed throughout)	Lagging	Amosite (Brown)	Identified
Calorifier Room adjacent Reception Building (presumed throughout) Gaskets & Crane Valves	Gaskets	Chrysotile (White)	Identified
Calorifier Room adjacent Reception Building Gaiter (X2)	Rope	Chrysotile (White) Amosite (Brown)	Identified

1. EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
Plant Room adjacent Reception Building continued...			
Calorifier Room adjacent Reception Building Red Pipe Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Identified
Calorifier Room adjacent Reception Building Small Blue Tank Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Identified
Corridors			
Corridor adjacent Olive Queens Ward running parallel to Chapel WC Cistern	Plastic	Amosite (Brown)	Strongly Presumed
Corridor adjacent Olive Queens Ward running parallel to Chapel Skylight Rope Seals	Rope	Chrysotile (White)	Strongly Presumed
Hall/Chapel Corridor Door adjacent corridor to Olive Queens Ward, Internal Panel	Cement	Chrysotile (White)	Identified
Hall/Chapel Corridor Offices adjacent corridor to Olive Queens Skylight Rope Seals	Rope	Chrysotile (White)	Strongly Presumed
Hall/Chapel Corridor End Office adjacent Pugin Paxton Office Riser Panel	Board	Amosite (Brown)	Identified
Hall/Chapel Corridor End Office adj Pugin Paxton Electrics Rope Seal	Rope	Chrysotile (White)	Strongly Presumed
Hall/Chapel Corridor Lobby to corridor to Olive Queens Ward Undercroft Pipe lagging	Paper	Chrysotile (White)	Identified
Hall/Chapel Corridor Office Electrics Rope seal	Rope	Chrysotile (White)	Strongly Presumed
Hall/Chapel Corridor Lobby Electrics to corridor to Browning Blake Ward Rope seal	Rope	Chrysotile (White)	Strongly Presumed
Hall/Chapel Corridor Lobby Electrics to corridor to Browning Blake Ward Flashguards	Rope	Chrysotile (White)	Strongly Presumed
Hall/Chapel Corridor Kitchen adjacent Andrewes Alleyn Ward, Sink Paint	Bitument	Chrysotile (White)	Strongly Presumed
Hall/Chapel Corridor Lobby adjacent Andrewes Alleyn Ward Wall electrics	Rope	Chrysotile (White)	Strongly Presumed
Corridor adjacent Main Hall Room under corridor adjacent to Derelict Main Hall Sectional lagging	Lagging	Chrysotile (White) Amosite (Brown)	Identified
Andrewes/Alleyn Ward			
Store room adjacent Andrewes/Alleyn Ward, Ironing Board Pad	Cement	Chrysotile (White)	Strongly Presumed

1.

EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
Andrewes/Allyn Ward continued...			
Andrewes/Allyn Ward Medication room Sink Paint	Bitumen	Chrysotile (White)	Strongly Presumed
Andrewes/Allyn Ward Sun Room Rope to skylight	Rope	Chrysotile (White)	Strongly Presumed
Andrewes/Allyn Ward Rawl plugs to metal protection to wall pipes (presumed throughout)	Board	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Andrewes/Allyn Ward First Floor kitchen Sink Paint	Bitumen	Chrysotile (White)	Strongly Presumed
Rear corridor adjacent Andrewes/Allyn Ward Room adjacent locker room Radiator shelf panel	Board	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Pugin/Paxton Ward			
Corridor Room Adjacent Pugin/Paxton, Cupboard Adjacent Fireplace, Radiator Panel	Board	Chrysotile (White)	Identified
Pugin/Paxton Ward, Rawl plugs to metal rising pipe sheaths and metal grid heater covers in segregation rooms(presumed throughout)	Rope	Chrysotile (White)	Identified
Pugin/Paxton Ward, Rope to switchboards	Rope	Chrysotile (White)	Strongly Presumed
Pugin/ Paxton Ward, Shires Lynx WC's cisterns throughout	Plastic	Amosite (Brown)	Strongly Presumed
Pugin/Paxton Ward Redundant ironing board panel	Cement	Chrysotile (White)	Strongly Presumed
Pugin/Paxton Ward First & Second Floor Kitchen Sink and Drainers, Sink Paint	Bitumen	Chrysotile (White)	Strongly Presumed
Pugin/Paxton Ward First Floor Kitchen, Pipe Cloth Wrap	Rope	Chrysotile (White)	Identified
Pugin/Paxton Ward, First Floor Kitchen, Pipe Cloth Wrap debris on floor	Rope	Chrysotile (White)	Strongly Presumed
Pugin/Paxton Ward, 2nd Floor Kitchen, Pipe Cloth Wrap (strongly presumed within riser between floors to each kitchen and pipe work in each kitchen Under MMMF lagging)	Rope	Chrysotile (White)	Strongly Presumed
Corridor Adjacent /Rear Pugin/Paxton Ward Light grey Floor Tile	Vinyl & Bitumen	Chrysotile (White) Chrysotile (White)	Identified
Corridor Adjacent Pugin/Paxton Ward Dark grey Floor Tile	Vinyl & Bitumen	Chrysotile (White) Chrysotile (White)	Identified
Corridor Adjacent Pugin/Paxton Ward Red Floor Tile	Vinyl & Bitumen	Chrysotile (White) Chrysotile (White)	Identified

1. EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
Ruskin/Rossetti Ward			
Ruskin/Rossetti Ward Lobby electrics Rope seal	Rope	Chrysotile (White)	Strongly Presumed
Ruskin/Rossetti Ward Kitchen Riser panel	Board	Chrysotile (White)	Identified
Ruskin/Rossetti Ward Ground Floor Kitchen Sink Paint	Bitumen	Chrysotile (White)	Strongly Presumed
Ruskin/Rossetti Ward WC, Cistern (X8)	Plastic	Amosite (Brown)	Strongly Presumed
Ruskin/Rossetti Ward First floor kitchen Sink Paint	Bitumen	Chrysotile (White)	Strongly Presumed
Ruskin/Rossetti Ward First floor kitchen Rope to Pipe	Rope	Chrysotile (White)	Strongly Presumed
Ruskin/Rossetti Ward First floor corridor wall electrics (rope, fuse carrier & shelf)	Rope & Cement	Chrysotile (White)	Strongly Presumed
Ruskin/Rossetti Ward Loft, AIB debris adjacent tank	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed
Ruskin/Rossetti Ward, Loft, AIB debris (throughout)	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed
Ruskin/Rossetti Ward Loft, AIB panel to eaves	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed
Shaftesbury/Salter Ward			
Corridor Adjacent Shaftesbury/Salter Cream Floor Tile	Vinyl & Bitumen	Chrysotile (White) Chrysotile (White)	Identified
Corridor Adjacent Shaftesbury/Salter Light Grey Floor Tile	Vinyl & Bitumen	Chrysotile (White) Chrysotile (White)	Identified
Corridor Adjacent Shaftesbury/Salter Black Floor Tile	Vinyl & Bitumen	Chrysotile (White) Chrysotile (White)	Identified
Corridor Adjacent Shaftesbury/Salter Red Floor Tile	Vinyl & Bitumen	Chrysotile (White) Chrysotile (White)	Identified
Shaftesbury/Salter Ward, Undercroft Sectional lagging debris under Main Ward Room	Debris	Amosite (Brown) Chrysotile (White)	Identified
Shaftesbury/Salter Ward, Ground W.C Lobby Wall Panel	Cement	Chrysotile (White)	Identified
Shaftesbury/Salter Ward Metal Riser Rawl Plugs (Throughout ward)	Rope	Chrysotile (White)	Strongly Presumed
Shaftesbury/Salter Ward Sink paint (All kitchen sinks on each floor.)	Bitumen	Chrysotile (White)	Strongly Presumed
Shaftesbury/Salter Ward Rope to switchboards (all floors)	Rope	Chrysotile (White)	Strongly Presumed

1. EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
Shaftesbury/Salter Ward continued...			
Shaftesbury/Salter Ward, Ground Floor Kitchen, Pipe Cloth Wrap debris on floor (also to 2 nd and 3 rd floors)	Rope	Chrysotile (White)	Strongly Presumed
Shaftesbury/Salter Ward, Shires lynx WC cisterns (approx 4 on all floors)	Plastic	Amosite (Brown)	Strongly Presumed
Shaftesbury/Salter Ward, Ground Floor Office Wall Panel behind wood	Board	Amosite (Brown)	Identified
Shaftesbury/Salter Ward, Fuse Box Shelf On 2 nd and 3 rd floors	Cement	Chrysotile (White)	Identified
Turner Ward			
Turner Ward First Floor Flue Pipe	Cement	Chrysotile (White)	Identified
Turner Ward W.C. Cistern	Plastic	Amosite (Brown)	Strongly Presumed
Turner Ward First Floor Bunny Boiler Internal Panel	Cement	Chrysotile (White)	Strongly Presumed
Turner Ward Rawl Plugs (Presumed throughout)	Board	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Turner Ward Kitchen Rope to pipe	Rope	Chrysotile (White)	Strongly Presumed
Turner Ward Kitchen Sink Paint	Bitumen	Chrysotile (White)	Strongly Presumed
Vanburgh/Vincent Ward (seriously fire damaged / unsafe)			
Vanburgh/ Vincent Ward Ground W.C Link Wall Panel	Board	Amosite (Brown) Chrysotile (White)	Identified
Vanburgh / Vincent Ward, Rawl plugs to metal rising pipe sheaths and metal grid heater covers in segregation room (Throughout ward and presumed throughout site)	Rope	Chrysotile (White)	Strongly Presumed
Vanburgh / Vincent Ward Lobby electrics (on each floor) Rope seal	Rope	Chrysotile (White)	Strongly Presumed
Vanburgh/Vincent Ward, Lift shaft lining Wall Panels (all floors / whole shaft and ceiling)	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed
Vanburgh / Vincent Ward Shires lynx WC cisterns (Ground X5 and presume on all floors)	Plastic	Amosite (Brown)	Strongly Presumed
Vanburgh / Vincent Ward Kitchens all floors Undersink and drainer paint	Bitumen	Chrysotile (White)	Strongly Presumed
Vanburgh / Vincent Ward, Ground Floor Kitchen, Pipe Cloth Wrap debris on floor (presume to 1 st , 2 nd and 3 rd floors)	Rope	Chrysotile (White)	Strongly Presumed

1. EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
World War II Underground Bunker			
WWII Underground Bunker Center Longitudinal Tunnel Fuse Box Flashguard	Rope	Chrysotile (White)	Identified
WWII Underground Bunker South Longitudinal Tunnel Redundant AIB Sheet	Board	Amosite (Brown)	Identified
WWII Underground Bunker South Longitudinal Tunnel Redundant Sheets (millboard)	Board	Chrysotile (White)	Identified
WWII Underground Bunker South Longitudinal Tunnel Redundant Sheets	Cement	Chrysotile (White)	Identified
WWII Underground Bunker South Longitudinal Tunnel Thin Sheets and floor debris (spread through out this area)	Cement	Chrysotile (White)	Strongly Presumed
WWII Underground Bunker South Longitudinal Tunnel Redundant Sheets leant against wall and floor debris	Cement	Chrysotile (White)	Strongly Presumed
WWII Underground Bunker Center Longitudinal Tunnel Fuse Box rope seal on floor	Rope	Chrysotile (White)	Strongly Presumed
Wren/Wesley Ward			
Wren/Wesley Ward Lift Panels	Board	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Wren/Wesley Ward Sink paint	Paper	Chrysotile (White)	Strongly Presumed
Wren/Wesley Ward Kitchen rope to pipe	Rope	Chrysotile (White)	Strongly Presumed
Wren/Wesley Ward Rope debris in door to bathroom adjacent cells	Rope	Chrysotile (White)	Strongly Presumed
Wren/Wesley Ward Rope debris adjacent door to middle ward	Rope	Chrysotile (White)	Strongly Presumed
Wren/Wesley Ward Undercroft Debris (presumed throughout)	Paper	Crocidolite (Blue) Amosite (Brown) Chrysotile (White)	Identified
Wren/Wesley Ward W.C Cistern (X12)	Plastic	Amosite (Brown)	Strongly Presumed
Zachary/Unwin, Zachary/York Wards & Workhouse			
Zachary/Unwin Ward Lobby electrics (rope seal, fuse carrier & shelf)	Rope & Cement	Chrysotile (White)	Strongly Presumed
Zachary/Unwin Ward Sink paint	Bitument	Chrysotile (White)	Strongly Presumed
Zachary/Unwin Ward Electrics Rope seal	Rope	Chrysotile (White)	Strongly Presumed

1.

EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
Zachary/Unwin,Zachary/York Wards & Workhouse continued...			
Zachary/York Ward W.C. Cistern (X2)	Plastic	Amosite (Brown)	Strongly Presumed
Zachary/York Ward Ground floor bathroom Floor Tile & Bitumen	Vinyl & Bitumen	Chrysotile (White)	Identified
Zachary/York Ward Corridor electrics (X2) Rope seal	Rope	Chrysotile (White)	Strongly Presumed
Workhouse Rope to skylights	Rope	Chrysotile (White)	Strongly Presumed
Workhouse Ground Floor Pipe lagging	Paper	Chrysotile (White)	Strongly Presumed
Workhouse First Floor Workshop Pipe Lagging	Paper	Chrysotile (White)	Strongly Presumed
Workhouse First Floor Bench Cement Pads to brackets (X3)	Cement	Chrysotile (White)	Strongly Presumed
Workhouse First Floor Workshop Panel to stairs	Cement	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Workhouse First Floor Roof sheet	Cement	Chrysotile (White)	Identified
Workhouse First Floor Rope to skylight	Rope	Chrysotile (White)	Strongly Presumed
Workhouse First Floor Roof Upstand panels	Cement	Chrysotile (White)	Strongly Presumed
Workhouse Accommodation Electrics rope seal	Rope	Chrysotile (White)	Strongly Presumed
Workshop Accommodation Dauntless Dolphin W.C. Cistern	Plastic	Amosite (Brown)	Identified
Workshop Garages External corrugated roof sheet	Cement	Chrysotile (White)	Strongly Presumed
Workshop Garages Internal cladding panels	Cement	Chrysotile (White)	Identified
Maintenance workshop External corrugated roof sheet	Cement	Chrysotile (White)	Strongly Presumed
Barn Roof End Gable Upstand panels	Cement	Chrysotile (White)	Strongly Presumed
External Bin Stores adjacent Zachary/York Ward, Corrugated Roof sheet	Cement	Chrysotile (White)	Strongly Presumed
External Bin Stores adjacent Zachary/York Ward, Gaskets	Gasket	Chrysotile (White)	Strongly Presumed

1. EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
Nightingale Ward			
Nightingale Ward Room adjacent corridor/lobby Rope to low level pipes	Rope	Chrysotile (White)	Strongly Presumed
Nightingale Ward Kitchen Rope to pipework	Rope	Chrysotile (White)	Strongly Presumed
Nightingale Ward Kitchen Sink paint	Bitumen	Chrysotile (White)	Strongly Presumed
Nightingale Ward First floor window infill panels	Board	Chrysotile (White) Amosite (Brown)	Identified
Nightingale Ward Cistern W.C (X6)	Plastic	Amosite (Brown)	Strongly Presumed
Nightingale Ward Undercroft Debris (presumed throughout)	Lagging	Crocidolite (Blue) Amosite (Brown) Chrysotile (White))	Identified
Hall adjacent Nightingale Ward Skylight rope seal	Rope	Chrysotile (White)	Strongly Presumed
Workshops			
Workshop stores adjacent Hall Pipe Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Identified
Workshop stores adjacent Hall Cement workbench (X2) adjacent sink	Cement	Chrysotile (White)	Strongly Presumed
Workshop stores adjacent Hall Low level boxing	Cement	Chrysotile (White)	Strongly Presumed
Workshop stores adjacent Hall Pipe Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Identified
Derelict Corridor adjacent stores Electrics	Rope	Chrysotile (White)	Strongly Presumed
Derelict Corridor adjacent workshop WC Cistern	Plastic	Amosite (Brown)	Strongly Presumed
Donne/Dickens Ward			
Donne/Dickens Ward Electrics Flashguards	Rope	Chrysotile (White)	Strongly Presumed
Donne/Dickens Ward Kitchen sink	Bitumen	Chrysotile (White)	Strongly Presumed
Donne/Dickens Ward Ground Floor WC Cistern (X2)	Plastic	Amosite (Brown)	Strongly Presumed
Donne/Dickens Ward Ground Floor Kitchen Sink paint	Bitumen	Chrysotile (White)	Strongly Presumed
Donne/Dickens Ward First floor Kitchen Rope to pipe	Rope	Chrysotile (White)	Strongly Presumed
Donne/Dickens Ward First Floor WC Cistern (X2)	Plastic	Amosite (Brown)	Strongly Presumed

1. EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
Donne/Dickens Ward continued...			
Donne/Dickens Ward First Floor Kitchen Sink paint	Bitumen	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Donne/Dickens Ward Electrics (X2) rope seal	Rope	Chrysotile (White)	Strongly Presumed
Faraday Ward & Plant Room adjacent Faraday Ward			
Calorifier Room adjacent Faraday Ward Large Tanks Pipe Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Identified
Calorifier Room adjacent Faraday Ward Floor Pipe Lagging Debris	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Calorifier Room adjacent Faraday Ward Small Tank & Pipe Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Calorifier Room adjacent Faraday Ward Red Pipe Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Calorifier Room adjacent Faraday Ward Blue Pipe Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Calorifier Room adjacent Faraday Ward Gaiter (X2)	Rope	Chrysotile (White)	Strongly Presumed
Calorifier Room adjacent Faraday Ward External Roof Soffit	Cement	Chrysotile (White)	Identified
Corridor adjacent Faraday Ward Skylight rope seal	Rope	Chrysotile (White)	Strongly Presumed
Faraday Ward Lobby Wall electrics Rope Seals	Rope	Chrysotile (White)	Strongly Presumed
Faraday Ward Ground Floor Kitchen Rope to pipework	Rope	Chrysotile (White)	Strongly Presumed
Faraday Ward Ground Floor W.C. Cistern (X20)	Plastic	Amosite (Brown)	Strongly Presumed
Faraday Ward Riser rawl plugs (presumed throughout)	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed
Faraday Ward Ground Floor Nurses Station stud walls Internal Sandwich Boards	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed
Faraday Ward Skylight Rope seal	Rope	Chrysotile (White)	Strongly Presumed
Faraday Ward First Floor, Main Ward Fireplace panels & debris	Cement	Chrysotile (White)	Strongly Presumed
Faraday Ward End Office Fireplace panels & debris	Cement	Chrysotile (White)	Strongly Presumed
Faraday Ward Office Fireplace panels & debris	Cement	Chrysotile (White)	Strongly Presumed

1. EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
Faraday Ward and Plant Room adjacent Faraday Ward continued...			
Faraday Ward Room adjacent Ward Wall electrics	Rope	Chrysotile (White)	Strongly Presumed
Faraday Ward Office adjacent stairs Fireplace panels	Cement	Chrysotile (White)	Strongly Presumed
Faraday Ward Second Floor Sink Pad	Bitumen	Chrysotile (White)	Strongly Presumed
Faraday Ward Stair Lobby Electrics	Rope	Chrysotile (White)	Strongly Presumed
Guy Ward First Floor Kitchen Rope to pipework	Rope	Chrysotile (White)	Strongly Presumed
Guy Ward First Floor Kitchen Sink Paint	Bitumen	Chrysotile (White)	Strongly Presumed
Guy Ward Undercroft Lagging debris	Lagging	Amosite (Brown)	Identified
Outhouse adjacent to Guy ward Soffit board	Board	Amosite (Brown) Chrysotile (White)	Identified
Soffitt Board External Debris	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed
Harvard & King/Keats Wards			
Harvard Ward W.C. Cistern (X27)	Plastic	Amosite (Brown)	Strongly Presumed
Harvard Ward Link corridor to W.C Block Wall mounted iron pad	Cement	Chrysotile (White)	Strongly Presumed
Harvard Ward Lobby Wall electrics Rope Seals	Rope	Chrysotile (White)	Strongly Presumed
Harvard Ward Ground Floor Kitchen Rope to pipework	Rope	Chrysotile (White)	Strongly Presumed
Harvard Ward Room opposite kitchen Sink Pad	Bitumen	Chrysotile (White)	Strongly Presumed
Harvard Ward First Floor Kitchen Rope to pipe work	Rope	Chrysotile (White)	Strongly Presumed
Harvard ward Lift motor room Panel to hatch	Board	Amosite (Brown) Chrysotile (White)	Identified
Rooms adjacent link corridor & Harvard Ward W.C. Cistern	Plastic	Amosite (Brown)	Strongly Presumed

1.

EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
Harvard & King/Keats Wards continued...			
Rooms adjacent link corridor & Harvard Ward Fireplace panel	Cement	Chrysotile (White)	Strongly Presumed
Rooms adjacent link corridor & Harvard Ward Sink Pad	Bitumen	Chrysotile (White)	Strongly Presumed
Kings/Keats Ward W.C. Cistern (X20)	Plastic	Amosite (Brown)	Strongly Presumed
Kings/Keats Ward Kitchen Rope to pipework	Rope	Chrysotile (White)	Strongly Presumed
Kings/Keats Ward Sink Paint	Bitumen	Chrysotile (White)	Strongly Presumed
Kings/Keats Ward Wall Electrics Rope seals	Rope	Chrysotile (White)	Strongly Presumed
Kings/Keats Ward Sink Pad	Bitumen	Chrysotile (White)	Strongly Presumed
Johnson/Jenner Ward & Plant Room adjacent Johnson Ward			
Johnson/Jenner Ward Ground Floor Upstand to skylight roof in sun room	Cement	Chrysotile (White)	Identified
Johnson/Jenner Ward Sun Room Skylight Rope Seal	Rope	Chrysotile (White)	Strongly Presumed
Johnson/Jenner Ward Ceiling panels to sun room	Cement	Chrysotile (White)	Identified
Johnson/Jenner Ward Wall Electrics	Rope	Chrysotile (White)	Strongly Presumed
Johnson/Jenner Ward Kitchen Rope to pipe work	Rope	Chrysotile (White)	Strongly Presumed
Johnson/Jenner Ward First Floor Sink Paint	Bitumen	Chrysotile (White)	Strongly Presumed
Johnson/Jenner Ward First Floor Sun Room Skylight Rope Seal	Rope	Chrysotile (White)	Strongly Presumed
Johnson/Jenner Ward First Floor Sink Pad	Bitumen	Chrysotile (White)	Strongly Presumed
Johnson/Jenner Ward First Floor Kitchen Rope to pipe work	Rope	Chrysotile (White)	Strongly Presumed
Johnson/Jenner Ward First Floor Kitchen Sink Paint	Bitumen	Chrysotile (White)	Strongly Presumed
Boiler House adjacent to Johnson/Jenner Ward, Large Tank (X3) Lagging	Lagging	Amosite (Brown) Chrysotile (White)	Strongly Presumed

1. EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
Johnson/Jenner Ward & Plant Room adjacent Johnson Ward continued...			
Boiler House adjacent to Johnson/Jenner Ward, Small Tank Lagging	Lagging	Amosite (Brown) Chrysotile (White)	Strongly Presumed
Boiler House adjacent to Johnson/Jenner Ward, Lagging debris on floor	Lagging	Amosite (Brown) Chrysotile (White)	Identified
Boiler House adjacent to Johnson/Jenner Ward, Electrics	Rope & Cement	Chrysotile (White)	Strongly Presumed
Boiler block adjacent Johnson/Jenner Ward, Door Panel	Board	Amosite (Brown) Chrysotile (White)	Identified
Boiler Block adjacent Johnson/Jenner Ward, Red Pipe lagging	Lagging	Amosite (Brown)	Identified
Boiler Block adjacent Johnson/Jenner Ward, Pipes entering duct	Lagging	Amosite (Brown) Chrysotile (White)	Strongly Presumed
Nurses Staff Wing			
Nurses Block adjacent King/Keats Ward Panels in loft(x12)	Board	Amosite (Brown)	Identified
Nurse Block Staff Wing W.C. Cistern (X11)	Plastic	Amosite (Brown)	Strongly Presumed
Nurse Block Sink Pad (X6)	Bitumen	Chrysotile (White)	Strongly Presumed
Nurses Block adjacent King/Keats Ward Flue pipe & Cement sheet in bunny boiler, (to all floors X3)	Cement	Chrysotile (White)	Identified
Nurses Block External Flue pipe	Cement	Chrysotile (White)	Strongly Presumed
Kings/Keats Link Corridor Floor Tiles	Vinyl	Chrysotile (White)	Strongly Presumed
Nurses Wing Link Corridor Floor Tiles	Vinyl	Chrysotile (White)	Strongly Presumed
Lidgett Lettsom Ward			
Lidgett/Lettsom Ward Electrics	Rope	Chrysotile (White)	Strongly Presumed
Lidgett/Lettsom Ward Riser Rope lagging to pipe	Rope	Chrysotile (White)	Strongly Presumed
Lidgett/Lettsom Ward W.C. Cistern	Plastic	Amosite (Brown)	Strongly Presumed
Lidgett/Lettsom Ward Bathroom Floor Tile	Vinyl	Chrysotile (White)	Strongly Presumed
Lidgett/Lettsom Ward Kitchen rope debris	Rope	Chrysotile (White)	Strongly Presumed
Lidgett/Lettsom Ward Paper insert to pipe lagging, undercroft (presumed throughout)	Paper	Chrysotile (White)	Identified
Lidgett/Lettsom Ward Kitchen Sink Paint	Bitumen	Chrysotile (White)	Identified
Lidgett/Lettsom Ward Loft, Pipe lagging adjacent tank	Lagging	Chrysotile (White) Crocidolite (Blue)	Identified
Lidgett/Lettsom Ward, Loft, Pipe lagging	Lagging	Chrysotile (White) Crocidolite (Blue)	Strongly Presumed
Lidgett/Lettsom Ward Loft, Pipe lagging debris	Lagging	Chrysotile (White) Crocidolite (Blue)	Strongly Presumed

1. EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
Art Therapy, Canteen & Kitchens			
Art Therapy Flue pipe adjacent boxing	Cement	Chrysotile (White)	Strongly Presumed
Art Therapy WC adjacent Corridor Bunny Boiler & Flue pipe	Cement	Chrysotile (White)	Strongly Presumed
Art Therapy Skylight (X4) Rope seal	Rope	Chrysotile (White)	Strongly Presumed
Art Therapy Kitchen Rope to Pipe	Rope	Chrysotile (White)	Strongly Presumed
Art Therapy External flue pipe	Cement	Chrysotile (White)	Strongly Presumed
Art Therapy W.C. Cistern (X3)	Paper	Chrysotile (White)	Strongly Presumed
Art Therapy First Floor end of Corridor Bathroom Bunny Boiler & Flue pipe	Cement	Chrysotile (White)	Strongly Presumed
Art Therapy Kitchen Cement panel under sideboard	Cement	Chrysotile (White)	Identified
Canteen Undercroft Foil paper lagging	Paper	Chrysotile (White)	Identified
Canteen Undercroft Foil paper lagging debris	Paper	Chrysotile (White)	Strongly Presumed
Canteen Electrics	Rope	Chrysotile (White)	Strongly Presumed
Canteen Wall electrics	Rope	Chrysotile (White)	Strongly Presumed
Hall adjacent Canteen Skylight rope seal	Rope	Chrysotile (White)	Strongly Presumed
Canteen, Catering Hall Radiator panel (X6)	Board	Chrysotile (White)	Identified
Kitchen adjacent Catering Hall Sink paint	Bitumen	Chrysotile (White)	Strongly Presumed
Catering department W.C. Cistern	Plastic	Amosite (Brown)	Strongly Presumed
Catering Hall Skylight rope seal	Rope	Chrysotile (White)	Strongly Presumed
Under stairs WC adjacent Main Hall W.C. Cistern	Plastic	Amosite (Brown)	Strongly Presumed
Understairs WC adjacent Main Hall Bunny Boiler & Flue pipe	Cement	Chrysotile (White)	Strongly Presumed
Kitchen Skylight Rope Seals	Rope	Chrysotile (White)	Strongly Presumed
Kitchen Electrics	Rope	Chrysotile (White)	Strongly Presumed
Kitchen Cement to fridge wall	Cement	Chrysotile (White)	Identified
Kitchen Hall Roof guttering	Cement	Chrysotile (White)	Identified

1. EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
Art, Therapy, Canteen & Kitchens continued...			
Kitchen Electrics	Rope	Chrysotile (White)	Strongly Presumed
Kitchen W.C Cistern	Board	Amosite (Brown)	Strongly Presumed
Kitchen Electrics in wood boxing	Rope	Chrysotile (White)	Strongly Presumed
Laundry & Workshops			
Laundry Office Wall Panel	Cement	Chrysotile (White)	Identified
Laundry office Panel partition to store	Cement	Chrysotile (White)	Strongly Presumed
Laundry Skylight rope seals	Rope	Chrysotile (White)	Strongly Presumed
Laundry Electrics	Rope	Chrysotile (White)	Strongly Presumed
Laundry Small Office in Main Room Foil paper lagging	Paper	Chrysotile (White)	Identified
Laundry, Toilets Paper under MMMF lagging (presumed throughout)	Paper	Chrysotile (White)	Identified
Laundry, Toilets Bunny boiler & Flue pipe	Cement	Chrysotile (White)	Strongly Presumed
Laundry, Toilets Window infill panel above boiler	Board	Amosite (Brown)	Identified
Laundry, Main Room Red pipe lagging	Lagging	Amosite (Brown) Chrysotile (White)	Identified
Laundry, Main Room Wall debris	Debris	Chrysotile (White)	Identified
Laundry, Main Room Pipe debris	Debris	Chrysotile (White)	Identified
Laundry Rope to laundry equipment	Rope	Chrysotile (White)	Strongly Presumed
Laundry Red Pipe Lagging	Lagging	Amosite (Brown)	Strongly Presumed
Laundry Electrics	Rope	Chrysotile (White)	Strongly Presumed
Laundry Rope gasket to dryer	Rope	Chrysotile (White)	Identified
Lightwell adjacent Laundry Cement roof sheet	Cement	Chrysotile (White)	Strongly Presumed
Lightwell adjacent Laundry Cement roof sheet debris	Cement	Chrysotile (White)	Strongly Presumed
Laundry Caged area, Tank insulation	Lagging	Chrysotile (White) Crocidolite (Blue)	Identified
Laundry, High level pipe Pipe lagging debris behind pipe	Lagging	Chrysotile (White) Amosite (brown)	Identified
Door panel to door between Laundry & Laundry Store	Cement	Chrysotile (White)	Identified

1. EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
Laundry & Workshops continued...			
Laundry Foil corrugated paper pipe lagging	Paper	Chrysotile (White)	Strongly Presumed
WC adjacent Laundry Cistern	Plastic	Amosite (Brown)	Strongly Presumed
External Workshop Electrics within cage	Rope	Chrysotile (White)	Strongly Presumed
External Workshop Electrics	Rope	Chrysotile (White)	Strongly Presumed
External Workshop cement debris (throughout)	Cement	Chrysotile (White)	Strongly Presumed
Roof sheet in lean-to adjacent Laundry Store & Incinerator	Cement	Chrysotile (White)	Strongly Presumed
Pipe lagging in lean-to adjacent Laundry Store & Incinerator	Lagging	Chrysotile (White) Crocidolite (Blue)	Identified
Lagging debris in lean-to adjacent Laundry Store & Incinerator	Lagging	Chrysotile (White) Crocidolite (Blue)	Strongly Presumed
Incinerator Rope seal	Rope	Chrysotile (White)	Strongly Presumed
Store adjacent Incinerator Roof sheet	Cement	Chrysotile (White)	Strongly Presumed
Laundry Store Wall debris	Debris	Chrysotile (White)	Identified
External Store adjacent Laundry Office Partition panel	Cement	Chrysotile (White)	Strongly Presumed
Workshop adjacent Laundry Electrics	Rope	Chrysotile (White)	Strongly Presumed
Store adjacent Generator Cable wrap	Rope	Chrysotile (White)	Strongly Presumed
Store adjacent Generator Redundant fuses	Rope	Chrysotile (White)	Strongly Presumed
Derelict building adjacent Workshop Rope to pipework	Rope	Chrysotile (White)	Strongly Presumed
Workshop External debris	Cement	Chrysotile (White)	Strongly Presumed
Workshop roof void Redundant Sink Pad	Plastic	Amosite (Brown)	Strongly Presumed
Mortuary House, Kitchen, Partition board to low level breakfast bar	Board	Amosite (Brown)	Identified
Mortuary House Kitchen, Skylight rope seal	Rope	Chrysotile (White)	Strongly Presumed
Mortuary House Kitchen, Sink Pad	Bitumen	Chrysotile (White)	Strongly Presumed
Mortuary Fridge panels	Cement	Chrysotile (White)	Strongly Presumed
Mortuary W.C. Cistern	Plastic	Amosite (Brown)	Strongly Presumed
Workshop adjacent Water Tank Tower Roof sheet	Cement	Chrysotile (White)	Strongly Presumed
Workshop adjacent Water Tank Tower Undercroft Pipe Lagging (presumed throughout)	Lagging	Chrysotile (White)	Strongly Presumed

1. EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
Laundry & Workshops continued...			
Remote store to rear of Water Tank Tower Roof Sheet	Cement	Chrysotile (White)	Strongly Presumed
Remote store to rear of Water Tank Tower Gasket debris	Gasket	Chrysotile (White)	Strongly Presumed
Water Tower, Corrugated lagging Outtake Pipes,	Paper	Chrysotile (White)	Identified
Water Tower Lagging Debris to outtake pipes	Lagging	Chrysotile (White)	Identified
Water Tower Courtyard, Foreman's Office Textured coating to ceiling	Textured Coating	Chrysotile (White)	Identified
Water Tower Courtyard, Workshops Wall Gasket material	Gasket	Chrysotile (White)	Identified
Water Tower Courtyard, Workshops Gasket material	Gasket	Chrysotile (White)	Strongly Presumed
Water Tower Courtyard, Workshops Gasket material (noted throughout)	Gasket	Chrysotile (White)	Strongly Presumed
Water Tower Courtyard, Workshops, Electrics	Rope	Chrysotile (White)	Strongly Presumed
Water Tower Courtyard Board debris outside workshops	Board	Amosite (Brown)	Identified
Water Tower Courtyard ECB Roof Upstand	Cement	Chrysotile (White)	Strongly Presumed
Water Tank Tower Electrics	Rope	Chrysotile (White)	Strongly Presumed
Water Tank Tower Office Ceiling	Board	Amosite (Brown)	Identified
Water Tank Tower Pipe Lagging (presumed throughout)	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Water Tank Tower Undercroft, Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Bricked Up Garage adjacent Water Tower Debris to Floor (noted throughout area)	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed
Bricked Up Garage adjacent Water Tower Redundant Insulation Board Sheets (noted throughout area)	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed
Bricked Up Garage adjacent Water Tower Redundant Flue Pipes (noted throughout area)	Cement	Chrysotile (White)	Strongly Presumed
Bricked Up Garage adjacent Water Tower Store Room High Level Pipe Lagging	Lagging	Amosite (Brown) Chrysotile (White)	Strongly Presumed

1.

EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
Bricked Up Garage adjacent Water Tower Store Room Redundant Sheets (noted throughout area)	Cement	Chrysotile (White)	Strongly Presumed
Bricked Up Garage adjacent Water Tower Store Room adjacent corridor High Level Pipe Lagging	Lagging	Amosite (Brown) Chrysotile (White)	Strongly Presumed
Bricked Up Garage adjacent Water Tower Ceiling to Cupboard adjacent Door to Corridor	Cement	Chrysotile (White)	Strongly Presumed
Boiler House			
Boiler House Profiled Roof Sheet	Cement	Chrysotile (White)	Strongly Presumed
Boiler House Store, Redundant Crane valve	Gasket	Chrysotile (White)	Identified
Boiler House Door panel,	Board	Amosite (Brown)	Identified
Boiler House Door panel debris	Board	Amosite (Brown)	Strongly Presumed
Boiler House Roof Debris	Cement	Chrysotile (White)	Identified
Boiler House Tank Room, Gaiter to tank (X4),	Rope	Chrysotile (White)	Identified
Boiler Room Tank Room Main Tank Lagging	Lagging	Chrysotile (White) Amosite (brown)	Identified
Boiler House Tank Room, Tank (X4) Lagging	Lagging	Chrysotile (White)	Identified
Boiler Room Pipe Lagging	Lagging	Chrysotile (White) Amosite (brown)	Identified
Boiler Room Tank Room Floor beneath tank Lagging debris (presumed throughout)	Lagging	Chrysotile (White) Amosite (brown)	Identified
Boiler Room Main Pipe Duct Pipe Lagging	Lagging	Chrysotile (White) Amosite (brown)	Strongly Presumed
Boiler Room Main Plant Room Gaskets to Boilers	Gasket	Chrysotile (White)	Strongly Presumed
Boiler Room Electrics	Rope	Chrysotile (White)	Strongly Presumed
Boiler House Redundant Gaskets	Gaskets	Chrysotile (White)	Strongly Presumed
Boiler Room W.C. Cistern	Plastic	Amosite (Brown)	Strongly Presumed
Boiler House Sink Pad	Bitumen	Chrysotile (White)	Strongly Presumed

1. EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
John Hutchinson Centre			
John Hutchinson Centre Cement under metal duct cover	Cement	Chrysotile (White)	Identified
John Hutchinson Centre W.C. Cistern	Plastic	Amosite (Brown)	Strongly Presumed
John Hutchinson Centre Office wall panel	Cement	Chrysotile (White)	Strongly Presumed
John Hutchinson Centre Bunny Boiler & Flue pipe	Cement	Chrysotile (White)	Strongly Presumed
John Hutchinson Centre Ceiling panel to flat roofed room	Board	Amosite (Brown) Chrysotile (White)	Identified
John Hutchinson Centre Cement wall panels	Cement	Chrysotile (White)	Identified
John Hutchinson Centre Store Room Ceiling Panel	Board	Amosite (Brown)	Strongly Presumed
John Hutchinson Centre Corridor wall panels (internal & external)	Cement	Chrysotile (White)	Strongly Presumed
John Hutchinson Centre Stair surround panels,	Cement	Chrysotile (White)	Strongly Presumed
John Hutchinson Centre Main Hall Skylight rope seal	Cement	Chrysotile (White)	Strongly Presumed
John Hutchinson Centre Wall Panels adjacent conveyor	Cement	Chrysotile (White)	Strongly Presumed
John Hutchinson Centre External wall panels	Cement	Chrysotile (White)	Strongly Presumed
John Hutchinson Centre External Garage Corrugated Roof sheet	Cement	Chrysotile (White)	Strongly Presumed
Nurse Accommodation Block			
Nurses Block, Middle Annex, First Floor Kitchen, Cement panel	Board	Amosite (Brown)	Identified
Nurses Block, Middle Annex First Floor Kitchen, Sink Pad	Bitumen	Chrysotile (White)	Strongly Presumed
Nurses Block, Middle Annex, W.C Cistern	Plastic	Amosite (Brown)	Strongly Presumed
Nurses Block, Middle Annex, Black stair nosing	Vinyl	Chrysotile (White)	Identified
Nurses Block, Middle Annex, Corridor wall electrics	Rope	Chrysotile (White)	Strongly Presumed
Nurses Block, Middle Annex, Electric Cupboard	Rope	Chrysotile (White)	Strongly Presumed
Nurses Block, Middle Annex, Ground Floor, Wall panel to electric cupboard	Board	Amosite (Brown)	Identified
Nurses Block, Middle Annex, W.C, Redundant flue pipe	Cement	Chrysotile (White)	Strongly Presumed
Nurses Block, Middle Annex, Ground floor cupboard, Wall Panel	Board	Amosite (Brown)	Strongly Presumed
Nurses Block, Middle Annex, Ground floor W.C. Redundant Flue pipe	Cement	Chrysotile (White)	Strongly Presumed
Nurses Block, Rear Annex, Electrics	Rope	Chrysotile (White)	Strongly Presumed
Nurses Block, Rear Annex, Electric cupboard, Wall panel	Board	Amosite (Brown)	Strongly Presumed

1. EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
Nurses Block, Rear Annex, W.C Bunny Boiler Flue and Internal Panels	Cement	Chrysotile (White)	Strongly Presumed
Nurses Block, Rear Annex, Cupboard Wall Panel	Board	Amosite (Brown)	Strongly Presumed
Nurses Block, Rear Annex, W.C Bunny Boiler	Cement	Chrysotile (White)	Strongly Presumed
Nurses Block, Rear Annex, Corridor Electrics	Rope	Chrysotile (White)	Strongly Presumed
Nurses Block, Rear Annex, Ironing Board Pad	Cement	Chrysotile (White)	Strongly Presumed
Main Nurses Block Third Floor, End Bedroom, Riser behind Sink, Pipe lagging, (presumed to all sink risers to all floors)	Lagging	Chrysotile (White) Amosite (brown)	Identified
Main Nurses Block, Third Floor, Bedrooms, Riser behind Sink, Pipe lagging (presumed to all floors to risers serving sinks)	Lagging	Chrysotile (White) Amosite (brown)	Strongly Presumed
Main Nurses Block, Domestic cupboards in Corridor (X2), Pipe lagging, (noted to all floors)	Lagging	Chrysotile (White) Crocidolite (Blue)	Identified
Main Nurses Block, Second Floor, Domestic Cupboards in Corridor (X2), Pipe lagging (noted to all floors)	Lagging	Chrysotile (White) Crocidolite (Blue)	Identified
Main Nurses Block Stairs (X2) Stair Nosing	Vinyl	Chrysotile (White)	Strongly Presumed
Main Nurses Block Bunny Boiler (X3)	Cement	Chrysotile (White)	Strongly Presumed
Main Nurses Block Ironing Board Panel	Cement	Chrysotile (White)	Strongly Presumed
Main Nurses Block Loft Lobby Pipe lagging	Lagging	Chrysotile (White) Crocidolite (Blue) Amosite (Brown)	Identified
Main Nurses Block Loft, Door Panels (X2)	Board	Amosite (Brown)	Strongly Presumed
Main Nurses Block (LHS) Loft Pipe lagging	Lagging	Chrysotile (White) Crocidolite (Blue) Amosite (Brown)	Strongly Presumed
Main Nurses Block (RHS) Loft Pipe lagging	Lagging	Chrysotile (White) Crocidolite (Blue) Amosite (Brown)	Strongly Presumed
Nurses Block Rear Annex, Loft Sectional lagging & Flue pipes	Cement	Chrysotile (White)	Strongly Presumed
Nurses Block, Rear Annex, Loft, Sectional lagging	Lagging	Chrysotile (White) Amosite (Brown)	Identified
Nurses Block, Rear Annex, Loft, Box of Sectional lagging	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Nurses Block, Middle Annex, Loft Cement flue pipes (X2)	Cement	Chrysotile (White)	Strongly Presumed

1. EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
Nurses Accommodation Block continued...			
Nurses Block, Rear Annex, External Roof Soffit panels	Cement	Chrysotile (White)	Identified
Main Nurses Block Basement boiler room, LHS Under floor duct (X6) Pipe lagging,	Lagging	Chrysotile (White)	Identified
Main Nurses Block Basement boiler room, Main floor duct Pipe lagging	Lagging	Chrysotile (White)	Strongly Presumed
Main Nurses Block Basement boiler room, Pipe lagging	Lagging	Chrysotile (White)	Strongly Presumed
Main Nurses Block Basement boiler room, Tank Pipe lagging	Lagging	Chrysotile (White)	Strongly Presumed
Main Nurses Block Store adjacent Basement boiler room, Pipe lagging,	Lagging	Chrysotile (White)	Strongly Presumed
Main Nurses Block Basement boiler room, Main duct adjacent entrance Pipe lagging,	Lagging	Chrysotile (White)	Strongly Presumed
Main Nurses Block Basement boiler room, RHS Under floor duct (X6) Pipe lagging,	Lagging	Chrysotile (White)	Strongly Presumed
Nurses Block, Middle Annex, Boiler room, Ceiling panels	Board	Amosite (Brown)	Strongly Presumed
Nurses Block, Middle Annex, Boiler Room, Tank lagging	Lagging	Chrysotile (White) Crocidolite (Blue)	Identified
Nurses Block, Middle Annex, Boiler room ,Pipe lagging	Lagging	Chrysotile (White) Crocidolite (Blue)	Strongly Presumed
Nurses Block, Middle Annex, Boiler Room, Pipe lagging debris	Lagging	Chrysotile (White) Crocidolite (Blue)	Strongly Presumed
Shed adjacent Main Nurses Block Roof tiles	Cement	Chrysotile (White)	Identified
Shed adjacent Main Nurses Block Redundant roof sheet	Cement	Chrysotile (White)	Strongly Presumed
Shed adjacent Main Nurses Block, AIB debris on ground by (throughout area)	Board	Amosite (Brown)	Identified
Shed adjacent Main Nurses Block, Roof tiles	Cement	Chrysotile (White)	Strongly Presumed
Shed adjacent Main Nurses Block Partition Panels	Board	Amosite (Brown)	Strongly Presumed
Garden Stores (X4) Roof	Cement	Chrysotile (White)	Strongly Presumed
Garden Store Redundant panel behind tank	Board	Amosite (Brown)	Strongly Presumed
Garden Outbuildings Corrugated Roof Sheet	Cement	Chrysotile (White)	Strongly Presumed
Gardeners Cottage Fireplace board	Board	Amosite (Brown)	Strongly Presumed

1.

EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
Nurses Accommodation Block continued...			
Gardeners Cottage Electrics	Rope	Chrysotile (White)	Strongly Presumed
Gardeners Cottage Under stairs Electrics	Rope	Chrysotile (White)	Strongly Presumed
Gardeners Cottage W.C. Cistern	Plastic	Amosite (Brown)	Strongly Presumed
Gardeners Cottage, Plant Room, Pipe lagging	Lagging	Chrysotile (White) Amosite (Brown)	Identified
Gardeners Cottage, Plant Room, Tank lagging	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed
North Lodge			
North Lodge External porch panels	Cement	Chrysotile (White)	Strongly Presumed
North Lodge External Flue pipes (X3)	Cement	Chrysotile (White)	Strongly Presumed
North Lodge W.C. Cistern	Plastic	Amosite (Brown)	Strongly Presumed
North Lodge Ground Floor, Kitchen Boiler Flue pipe	Cement	Chrysotile (White)	Strongly Presumed
North Lodge First Floor Kitchen Boiler Flue pipe	Cement	Chrysotile (White)	Strongly Presumed
North Lodge First Floor Kitchen electrics	Rope	Chrysotile (White)	Strongly Presumed
North Lodge Loft, Redundant panels	Board	Amosite (Brown)	Strongly Presumed
North Lodge Loft flue pipe	Cement	Chrysotile (White)	Strongly Presumed
North Lodge External Redundant flue pipe	Cement	Chrysotile (White)	Strongly Presumed
Swimming Pool Block Changing Room Pink cement roof tiles	Cement	Chrysotile (White)	Identified
Swimming Pool Changing Room W.C. Cistern	Plastic	Amosite (Brown)	Strongly Presumed
Nurses Block Remote Plant Room Tank Lagging	Lagging	Chrysotile (White)	Strongly Presumed
Nurses Block Remote Plant Room Pipe Lagging	Lagging	Chrysotile (White)	Strongly Presumed
Underground Ducts			
Underground duct Main Pipe Room beneath Store adjacent Water Tank Tower, Pipe Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Underground Duct under Generator Room adjacent to Main Pipe Room Pipe Lagging debris	Lagging	Chrysotile (White) Amosite (Brown)	Identified
Underground duct Duct under Generator Room Pipe lagging	Lagging	Chrysotile (White) Amosite (Brown)	Identified
Underground duct Sectional Pipe lagging, Duct under generator room leading towards Kitchens	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Underground duct Hard set Pipe lagging in Duct adjacent Generator Room	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed

1. EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
Underground Ducts continued...			
Underground duct Pipe residue in corridor duct adjacent to Zachery Unwin Ward	Lagging	Chrysotile (White)	Identified
Underground duct Pipe debris in corridor duct adjacent Vanburgh Vincent Ward	Lagging	Chrysotile (White)	Identified
Underground duct beneath Corridor adjacent Turner Floor Cement Debris	Cement	Chrysotile (White)	Strongly Presumed
Underground duct beneath Corridor adjacent Turner Sectional Pipe Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Underground duct beneath Corridor adjacent Shaftesbury/Salter Sectional Lagging & Redundant sectional lagging	Lagging	Chrysotile (White) Amosite (Brown)	Identified
Underground duct Plant Room, adjacent Nightingale Ward Pipe lagging,	Lagging	Chrysotile (White) Amosite (Brown)	Identified
Underground duct beneath Corridor adjacent Nightingale Pipe lagging	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Underground duct beneath Corridor adjacent Nightingale-Wren Pipe Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Underground duct beneath Corridor adjacent Turner Hard set lagging adjacent MMMF lagging	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Underground duct beneath Corridor adjacent Stores Pipe Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Underground duct beneath east side corridor adjacent Kitchen Corrugated Foil paper lagging	Paper	Chrysotile (White)	Identified
Underground duct beneath east side corridor adjacent Kitchen, Sectional Lagging adjacent MMMF lagging	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Underground Corridor Duct Sectional Pipe lagging (presumed throughout)	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Underground duct beneath Corridor adjacent to Dentist Sectional lagging,	Lagging	Crocidolite (Blue)	Identified
Underground duct beneath Corridor adjacent to Dentist Sectional lagging debris,	Lagging	Chrysotile (White) Amosite (Brown)	Identified
Underground duct Corridor Duct adjacent Ellis Asbestos Bags in partially bricked up void	Lagging	Chrysotile (White) Crocidolite (Blue) Amosite (Brown)	Strongly Presumed
Underground duct leading to boiler block adjacent Faraday Sectional lagging,	Lagging	Amosite (Brown)	Identified
Underground duct beneath Corridor adjacent Guy Ward, Asbestos Bags in partially bricked up void	Lagging	Chrysotile (White) Crocidolite (Blue) Amosite (Brown)	Strongly Presumed

1.

EXECUTIVE SUMMARY

Location	Material type	Asbestos type	Level of identification
Underground Ducts continued...			
Underground duct beneath link corridor adjacent King Keats ward Sectional lagging	Lagging	Chrysotile (White)	Identified
Underground duct Adjacent Staff Wing Sectional pipe lagging	Lagging	Chrysotile (White)	Strongly Presumed
Underground duct Adjacent Liggett/Lettsom Ward Sectional pipe lagging	Lagging	Chrysotile (White)	Strongly Presumed
Underground duct adjacent Liggett/Lettsom Ward Floor debris	Lagging	Chrysotile (White)	Strongly Presumed
Underground duct Void adjacent Water Tower Lagging to pipe work	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Underground duct adjacent Water Tower Corrugated Foil lagging	Paper	Chrysotile (White)	Strongly Presumed
Underground duct under water tower Corrugated Foil lagging debris	Paper	Chrysotile (White)	Strongly Presumed
Underground duct Void adjacent Water Tower Asbestos Waste Bags in void	Lagging	Chrysotile (White) Crocidolite (Blue) Amosite (Brown)	Strongly Presumed
Underground duct Plant Room adjacent Nightingale Ward Asbestos Waste bags	Lagging	Chrysotile (White) Crocidolite (Blue) Amosite (Brown)	Strongly Presumed
Underground duct Plant Room adjacent Nightingale Ward Floor Lagging debris	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed
Underground duct beneath Corridor adjacent Kitchen Sectional Lagging	Lagging	Amosite (Brown)	Identified

- 1.2 No further asbestos inclusions could be reasonably located within the confines of a type 3 survey as described by the U.K. Health and Safety Executive (HSE) document Methods of Determination of Hazardous Substances 100: "Surveying, Sampling and Assessment of Asbestos-Containing Materials" (MDHS 100).
- 1.3 Attention is drawn to the survey brief and the caveat for areas not included within the survey and for areas that could not be accessed for survey purposes.

2. INTRODUCTION

- 2.1 English Partnerships has commissioned Strategic Risk Management Ltd to undertake an asbestos survey of Cane Hill Hospital, Coulsdon, Surrey.
- 2.2 The survey was conducted by T. Johnson, A. Alderson & B. Stockwell during April-July 2006. The survey was carried out by a laboratory accredited by UKAS (Normandie Analytical Services Ltd on behalf of Strategic Risk Management Ltd) for surveying in accordance with the requirements of the HSE document Methods for the Determination of Hazardous Substances 100, "Surveying, sampling and assessment of asbestos – containing material" (MDHS 100). Surveyors employed by NAS are by virtue of their qualifications, training and experience, competent to undertake Asbestos surveys and to give expert opinion on matters pertaining to this. Normandie Analytical Services are accredited by U.K.A.S. to undertake Bulk Sampling and Analysis, Air Sampling, Fibre Counting and Asbestos Surveying.
- 2.3 This report gives a description of where the located asbestos inclusions are to be found. No written method statements are included with this report. The survey undertaken was a type 3 survey. This survey is recommended where the client requires a Sampling Survey to confirm or refute the presence of the material for the purpose of major refurbishment or demolition.
- 2.4 Certain areas of the building are still unsurveyed to type 3 standards as detailed in section 3.10.
- 2.5 Details of all the inclusions located are marked on plans made available to the surveyor. The plans record detail of where each sample was taken for cross reference purposes. No plans apart from a site schematic was available for the site – it was agreed with the client that where this is the case a site plan will be present in the report with a listing of asbestos types to particular materials (ie rope to skylights) as a notation against each ward or identifiable building block. It is the client's responsibility to provide any information such as previous asbestos surveys or plans if they are available.

Name: [REDACTED] Signed: [REDACTED]

Date: 12th September 2006

Name: [REDACTED] Signed: [REDACTED]

Date: 12th September 2006

Name of Countersigner: [REDACTED] Signed: [REDACTED]

Date: 19th September 2006

3. SURVEY BRIEF AND CAVEAT

- 3.1 The survey was carried out in order that the client can comply with its duties under The Health & Safety at Work Act 1974 whereby it has a duty to protect the health and Safety of its staff and that of other who may be affected by its undertaking. Furthermore by virtue of The Management of Health and Safety at Work Regulations 1992, Regulation 3 states "every employer shall make a suitable and sufficient assessment of the risks to health and safety of his employees to which they are exposed whilst they are at work and the risks to health and safety of persons not in his employment arising out of or in connection with the conduct by him of his undertaking." Furthermore Regulation 4 of the same indicates that the Employer must adequately record these risk assessments and have arrangements in place for carrying out the recommendations. In addition to the above the Employer has duties under the Control of Asbestos at Work Regulations to assess the risks associated with working with asbestos and has a duty to prevent the spread of Asbestos.
- 3.2 The purpose of this survey was to locate and assess all practically accessible asbestos containing materials in the building, to assist the client in costing the removal of the asbestos prior to demolition and to comply with CDM regulations.
- 3.3 A dedicated sampling protocol for the surveying of buildings for asbestos-containing materials is used. This is contained in the Laboratory Quality Manual.
- 3.4 The method used consists of a visual inspection of all areas by a trained and competent Asbestos Surveyor, and sampling of areas at the frequency stated in the sampling protocol, or at the Asbestos Surveyors' discretion.
- 3.5 All accessible areas were inspected except those listed in section 3.10 Photographs were taken of the sample points and can be found in the Survey Information Sheet section.
- 3.6 During the course of the survey, all reasonable efforts were made to identify the physical presence of asbestos-containing materials within the accessible areas of the building. Historically, asbestos-containing materials were frequently concealed within the fabric of buildings or within sealed building voids. Therefore, it is not possible to regard the findings of any asbestos survey as being definitive. There always remains a possibility that asbestos-containing materials may be found during refurbishment or demolition activities

3. SURVEY BRIEF AND CAVEAT

- 3.7 It is advised that some material was often used repetitively, such as fire protection in pipe penetrations and as gasket material on air conditioning ducting. Not all of these asbestos inclusions have been specifically identified in this survey. Caution must be used and asbestos must be suspected as present in every case.
- 3.8 Whilst every effort was made to locate the ceiling panels, wall partitions and other panels, which may have been constructed from asbestos boarding, none other than those detailed were found. Only by sampling each panel would the composition of all the materials be known. This was clearly not practical in terms of cost or time.
- 3.9 Where similar items exist in the building, only one or two samples have been taken to ascertain the material content. It was assumed that similar products were of the same material.
- 3.10 Access could not be gained to several areas of the site.
- Areas behind identified asbestos containing materials. Eg: Room of Corridor adjacent Olave Queens behind asbestos door
 - Areas where access is limited due to stored items Eg: Room next to Reception Lobby & Office adjacent Basement stairs
 - Electrical equipment which was live when the survey was undertaken including light fittings and switches, heaters, fuse panels.
 - Inside boilers throughout site
 - Under floor drainage and sewerage services throughout site
 - To high level roofs and lofts where the structural and load bearing ability is in question. Eg, Zachary York, Turner, Ellis, Mapother, Nightingale Wards & Water Tower.
 - To suspended flooring where the structural and load bearing ability is in question Eg: First Floor Reception Block (Male Side) bomb damaged, Room next to corridor hoarding board adjacent Reception Building, Room next to female WC adjacent Reception Building Corridor, Reception Counter & Offices, Room next to Dentist, Store to rear of Chapel, Shaftesbury/Salter Ward second floor, Turner Ward first floor, Vincent/Vanburgh Ward first, second and part of ground floor, Zachary Unwin & Zachary York Ward first floor, Zachary York small rooms at rear, Wren/Wesley ground & first floor corridor
 - To areas classified as confined spaces. Eg: Olave Queens Undercroft, Browning Blake Undercroft, Partial inspection of undercrofts & ducts
 - To areas where pigeon infestation limited access Eg: Loft above first floor dispensary, Unwin, Vanburgh, Wren Wesley & Guy Wards

3. SURVEY BRIEF AND CAVEAT

- To buildings fire damaged and structurally unsafe eg. End Gargare adjacent Water Tower, Cruden Chaucer Ward Building, Vanburgh Vincent Ward Loft, Main Hall, S&L Landing, Stores adjacent Tower & Stores adjacent Kitchen
 - To buildings not identified on any site plan or pointed out as being present to the survey teams and which may be underground / overground, sumps, underground reservoirs, bunkers / shelters etc, which may be covered by undergrowth and shrubberies.
- 3.11 It should be noted that the buildings have been unoccupied for a number of years and as a consequence building or structural maintenance is unlikely to have been carried out. Where it has become apparent to the surveyors during the course of the survey that ceilings and floors may have lost structural integrity and /or there is a risk to the health and safety of the surveying teams in the lead surveyors opinion, these areas will not be accessed for health and safety reasons. This will be noted as no access in paragraph 3.10 and a presumption will be made that asbestos has to be presumed unless proven otherwise. To prove otherwise will require the areas to be made safe however that may be required and re-accessed at further survey cost at any later date as required. This may mean that the area is accessed by licensed asbestos contractors who can make the area safe. It should also be noted that these areas may in fact not contain asbestos however this cannot be presumed under current legislation.
- 3.12 It is recommended that samples be taken of suspect materials which may be uncovered within the listed inaccessible areas or within the areas of the site which were not included in this survey.
- 3.13 For reasons set out in this report, the results cannot give an assurance that all asbestos-containing materials have been found and must not be thought to do so. This was a type 3 survey as described by MDHS 100
- 3.14 From the evidence of the inspections, and the sampling and analysis undertaken, it is clear that asbestos-containing materials are present in the areas detailed in this report.

3. SURVEY BRIEF AND CAVEAT

- 3.15 The term **strongly presumed** or **presumed** may appear in the report. These terms are used by experienced surveyors where visual inspection of the material has concluded it contains asbestos but laboratory identification has not been performed.
MHDS 100, section 11, defines these two levels of presumption as follows:
i) It is **strongly presumed** that the material does contain asbestos but laboratory identification has not been undertaken to confirm this. For example: one gasket in a boiler room has been analyzed to contain asbestos, thus it can be strongly presumed that all the gaskets contain asbestos.
ii) Material must be **presumed** to contain asbestos because there is insufficient evidence to suggest it is not ACM. For example: an area that is not assessable must be presumed to contain asbestos as there is no evidence to prove that no asbestos is present.
- 3.16 No risk assessments were undertaken as this was a type 3 survey
- 3.17 Air monitoring was not undertaken during this survey and appropriate care was taken not to cause disturbance of fibre or contamination of clean surfaces.
- 3.18 Any person undertaking work within the buildings should be informed of the presence of asbestos. This briefing also applies to any other person associated with the site, including staff, sub-contractors and others.
- 3.19 This report has been written with reference to the various Guidance Notes issued and current at the date of this report and describes circumstances at the site on the date of the survey.

4. RECOMMENDATIONS

4.1 Asbestos-containing materials (ACM's) were found within areas surveyed as follows

Location	Material type	Asbestos type	Level of Identification	Recommendations
Reception Block (SAS Building)				
Reception Block, (SAS Building) Male side W.C, Shires Lynx type Cistern (x5)	Plastic	Amosite (Brown)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Reception Block,(SAS) Building, Male Side, Basement, Flash Pad	Rope	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Reception Building Second Floor Front Office Panel beneath heater	Board	Amosite (Brown) Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Reception Building Second Floor Rear Office Panel beneath heater	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Reception Building First Floor Fireplace Panel & debris	Cement	Chrysotile (White)	Identified	Debris to be removed at next available opportunity. Re-Inspect Annually if accessible, until remediation.
Reception Building Ground Floor Office adjacent stairs to basement Panel behind radiator	Cement	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Reception Building, Female Side, Basement Fireplace panel	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Reception Building Female Side, Basement Electrics Rope Seal	Rope	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Reception Building Female Side, Ground Floor Front Office Shelf Panel above Radiator	Board	Amosite (Brown) Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Reception Building Female Side, First Floor WC Boxing	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Reception Building Female Side, First Floor Front Office, Partition Panels	Board	Amosite (Brown) Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Reception Building First Floor Lobby, Electrics Fuse Carriers & Shelf	Paper	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.

4.

RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Reception Block continued...				
Reception Building Ground Floor Rear Office Panel beneath shelf	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Reception Building Female Side, Loft Redundant Panel	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed	Remove at next available opportunity. Re-Inspect Annually if accessible, until remediation.
Reception Building Corridor adjacent Reception Beige Floor Tile & Bitumen	Vinyl & Bitumen	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Reception Building Corridor adjacent Reception Red Floor Tile & Bitumen	Vinyl & Bitumen	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Reception Building Main Corridor skylight (X2) Rope seals	Rope	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Reception Building W.C adjacent corridor External Flue Pipe	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Reception Building WC adjacent corridor Bunny Boiler flue pipe	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Reception Building WC Cistern (X3)	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall / Chapel Area (and surrounding corridors)				
Hall/Chapel Area Corridor Left, Adjacent Hall/Chapel, Foil Pipe Lagging In Wall Void	Lagging	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Area Fibre Board Paper Lining In Small Room Between Chapel And LHS Adj Corridor (debris throughout on floor)	Paper	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Area, Fibre Board Ceiling Paper Lining In X-Ray room LHS Adj Corridor and debris	Paper	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Area X-Ray LHS Adjacent Corridor Rope seals to skylights	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.

4. RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Hall/Chapel Area (and surrounding corridors)				
Hall/Chapel Area, 2 nd Room, Cement Sheet In Floor Duct With Solid Floor Adj Left Hand Side Of Corridor (Lending Library)	Cement	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Area, 2 nd Room next to Hall, Shires lynx WC cistern (X1) Adjacent Left Hand Side Of Corridor (Lending Library)	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Area, 2 nd room Lending library, Fibre Board Ceiling	Paper on fibreboard	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Area Corridor To The Back Of Chapel, Grey Floor Tiles	Bitumen only	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Area, Corridor To The Back Of Chapel, Red Floor Tile	Bitumen only	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Area Corridor To The Back Of Chapel, Access link, Rope to switchboards	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Area, Corridors adjacent Chapel Rope seals to skylights	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Area Lightwell adjacent chapel RH rear, Corrugated cement sheets	Cement	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Area, Dispensary, Radiator panels (X2)	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Area Dispensary Room, Sink Pad (x3)	Bitumen	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Area, Vestry, Rope Cable To Ceiling Lights	Rope	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Area, Vestry, Rope seals to skylights	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Area, Pipe Lagging, Covered Light Well, Next To Vestry	Lagging	Crocidolite (Blue) Amosite (Brown)	Identified	Isolate area pending removal/decontamination work. No Access to unprotected personnel

4.

RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Hall/Chapel Area (and surrounding corridors)				
Hall/Chapel Area, Reception/Accounts Rope seals to skylights (3 sets)	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Area Chapel, Small Red Floor Tiles	Vinyl & Bitumen	Chrysotile (White) Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Area Chapel, Small Black Floor Tiles	Vinyl & Bitumen	Chrysotile (White) Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Olave Queens Ward (female ward)				
Olave Queens Ward, Undercroft, Foil Lagging	Lagging	Chrysotile (White)	Identified	Isolate area pending removal/decontamination work. No Access to unprotected personnel
Olave Queens Ward Ground floor Toilet off 1 st ward – Shires Lynx WC cistern (X1)	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Olave Queens Ward Ground floor 1 st ward Flashpads in electrical box	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Olave Queens Ward Sectional Lagging To Undercroft Pipework Debris	Lagging	Chrysotile (White) Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Olave Queens Ward Undercroft Sectional Pipe Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Olave Queens Ward Green Floor Tile In Second Room	Vinyl & Backing	None Detected Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Olave Queens Ward Undercroft – Sectional Pipe Lagging Strongly presumed throughout undercroft footprint	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Olave/Queens Ward Rawl plugs to metal rising pipe sheaths and metal grid heater covers in segregation rooms (Throughout Ward and presumed throughout site)	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Olave Queens Ward Sun Room/Verandah Rope to skylight	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.

4.

RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Olave Queens Ward (female ward) continued....				
Olave Queens Ward W.C. Cistern	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Olave Queens Ward, Ground Floor, Kitchen adjacent corridor Rope to pipework	Rope	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Olave Queens Ward Ground Floor Kitchen adjacent corridor Rope cloth wrap lagging	Lagging	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Olave Queens Ward Corridor adjacent stairs Low level foil pipe lagging	Paper	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Olave Queens Ward Corridor adjacent stairs Wall electrics	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Olave Queens Ward WC adjacent ward Bunny Boiler Flue pipe (& internal panels)	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Olave Queens Ward Rawl Plugs to pipe protection (presumed throughout)	Board	Chrysotile (White) Amosite (Brown)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Olave Queens Ward Undercroft Stores Sink pads	Bitumen	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Olave Queens Ward Undercroft Stores Cisterns (X18)	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Olave Queens Ward Undercroft Stores Redundant panels	Board	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Olave Queens Ward Undercroft Stores Lagging debris	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Olave Queens Ward External flue pipe	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Browning Blake Ward				
Browning Blake Ward External flue & cowl	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Browning Blake Ward Sun Room Rope to skylights	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.

4. RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Browning Black continued....				
Browning Blake Ward W.C. Cistern (X12)	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Browning Blake Ward Room adjacent sun room Flue pipe	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Browning Blake Ward Female Ward Undercroft Pipe Lagging Debris (presumed throughout)	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Browning Blake Ward End Ward Undercroft Pipe Lagging Debris (presumed throughout)	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Browning Blake Ward Room adjacent end ward Panel behind radiator (X2)	Board	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Browning Blake Ward Office adjacent ward Ironing Board Pad	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Browning Blake Ward Kitchen adjacent corridor Rope to pipe work within wood boxed riser	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Browning Blake Ward First Floor Grey Floor Tile & Bitumen	Vinyl & Bitumen	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Browning Blake Ward First Floor Kitchen Sink Pad	Bitumen	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Browning Blake Ward First floor WC adjacent corridor from stairs, Flue pipe	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Browning Blake Ward External Store Corrugated Roof sheet & Side Panels	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.

4. RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Plant Room adjacent Reception				
Calorifier Room adjacent Reception Building Blue Pipe Lagging	Lagging	Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Calorifier Room adjacent Reception Building Large Tanks (2)	Lagging	Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Calorifier Room adjacent Reception Building Floor Debris (presumed throughout)	Lagging	Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Calorifier Room adjacent Reception Building (presumed throughout) Gaskets & Crane Valves	Gaskets	Chrysotile (White)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Calorifier Room adjacent Reception Building Gaiter (X2)	Rope	Chrysotile (White) Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Calorifier Room adjacent Reception Building Red Pipe Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Calorifier Room adjacent Reception Building Small Blue Tank Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Corridors				
Corridor adjacent Olive Queens Ward running parallel to Chapel WC Cistern	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Corridor adjacent Olive Queens Ward running parallel to Chapel Skylight Rope Seals	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Corridor Door adjacent corridor to Olive Queens Ward, Internal Panel	Cement	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.

4. RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Corridors continued....				
Hall/Chapel Corridor Offices adjacent corridor to Olive Queens Skylight Rope Seals	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Corridor End Office adj Pugin/Paxton, Office Riser Panel	Board	Amosite (Brown)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Corridor End Office adj Pugin Paxton Electrics, Rope Seal	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Corridor Lobby to corridor to Olive Queens Ward Undercroft Pipe lagging	Paper	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Corridor Office Electrics Rope seal	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Corridor Lobby Electrics to corridor to Browning Blake Ward Rope seal	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Corridor Lobby Electrics to corridor to Browning Blake Ward Flashguards	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Corridor Kitchen adjacent Andrewes Alleyn Ward, Sink Paint	Bitument	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Hall/Chapel Corridor Lobby adjacent Andrewes Alleyn Ward Wall electrics	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Corridor adjacent Main Hall Room under corridor adjacent to Derelict Main Hall Sectional lagging	Lagging	Chrysotile (White) Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Andrewes Alleyn Ward				
Store room adjacent Andrewes/Alleyn Ward, Ironing Board Pad	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Andrewes/Alleyn Ward Medication room Sink Paint	Bitumen	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Andrewes/Alleyn Ward Sun Room Rope to skylight	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.

4. RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Andrewes/Alleyn Ward continued....				
Andrewes/Alleyn Ward Rawl plugs to metal protection to wall pipes (presumed throughout)	Board	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Andrewes/Alleyn Ward First Floor kitchen Sink Paint	Bitumen	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Rear corridor adjacent Andrewes/Alleyn Ward Room adjacent locker room Radiator shelf panel	Board	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Pugin/Paxton Ward				
Corridor Room Adjacent Pugin/Paxton Ward, Cupboard Adjacent Fireplace, Rdt Panel	Board	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re -inspect Annually.
Pugin/Paxton Ward, Rawl plugs to metal rising pipe sheaths and metal grid heater covers in segregation rooms(presumed throughout)	Rope	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re -inspect Annually.
Pugin/Paxton Ward Rope to switchboards	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re -inspect Annually.
Pugin/ Paxton Ward Shires Lynx WC's cisterns throughout	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re -inspect Annually.
Pugin/Paxton Ward, Redundant ironing board panel	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re -inspect Annually.
Pugin/Paxton Ward First & Second Floor Kitchen Sink and Drainers, Sink Paint	Bitumen	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Pugin/Paxton, First Floor Kitchen, Pipe Cloth Wrap	Rope	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re -inspect Annually.
Pugin/Paxton, First Floor Kitchen, Pipe Cloth Wrap debris on floor	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re -inspect Annually.
Pugin/Paxton, 2nd Floor Kitchen, Pipe Cloth Wrap (strongly presumed within riser between floors to each kitchen Under MMMF lagging)	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re -inspect Annually.

4.

RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Pugin/Paxton continued....				
Corridor Adjacent Pugin/Paxton Light Grey Floor Tile	Vinyl & Bitumen	Chrysotile (White) Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Corridor Adjacent Pugin/Paxton Dark Grey Floor Tile	Vinyl & Bitumen	Chrysotile (White) Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Corridor Adjacent Pugin/Paxton Red Floor Tile	Vinyl & Bitumen	Chrysotile (White) Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Ruskin/Rosseti Ward				
Ruskin/Rosseti Ward Lobby electrics Rope seal	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Ruskin/Rosseti Ward Kitchen Riser panel	Board	Chrysotile (White) Amosite (Brown)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Ruskin/Rosseti Ward Ground Floor Kitchen Sink Paint	Bitumen	Chrysotile (White)	Strongly Presumed	Ruskin/Rosseti Ward Ground Floor Kitchen Sink Paint
Ruskin/Rosseti Ward WC, Cistern (X8)	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Ruskin/Rosseti Ward First floor kitchen Sink Paint	Bitumen	Chrysotile (White)	Strongly Presumed	Ruskin/Rosseti Ward First floor kitchen Sink Paint
Ruskin/Rosseti Ward First floor kitchen Rope to Pipe	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Ruskin/Rosseti Ward First floor corridor wall electrics (rope, fuse carrier & shelf)	Rope & Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Ruskin/Rosseti Ward Loft, AIB debris adjacent tank	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.

4. RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Roskin/Rossetti continued....				
Ruskin/Rossetti Ward, Loft, AIB debris (throughout)	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Ruskin/Rossetti Ward Loft, AIB panel to eaves	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Shaftesbury / Salter Ward				
Corridor Adjacent Shaftesbury/Salter Cream Floor Tile	Vinyl & Bitumen	Chrysotile (White) Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Corridor Adjacent Shaftesbury/Salter Light Grey Floor Tile	Vinyl & Bitumen	Chrysotile (White) Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Corridor Adjacent Shaftesbury/Salter Black Floor Tile	Vinyl & Bitumen	Chrysotile (White) Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Corridor Adjacent Shaftesbury/Salter Red Floor Tile	Vinyl & Bitumen	Chrysotile (White) Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Shaftesbury/Salter Undercroft Sectional lagging debris under Main Ward Room	Debris	Amosite (Brown) Chrysotile (White)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Shaftesbury/Salter Ground W.C Lobby Wall Panel	Cement	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Shaftesbury/Salter Ward Metal Riser Rawl Plugs (Throughout ward)	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Shaftesbury/Salter Sink paint (All kitchen sinks on each floor.)	Bitumen	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Shaftesbury/Salter Rope to switchboards (all floors)	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.

4. RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Shaftesbury/Salter Ward continued...				
Shaftesbury/Salter Ward, Ground Floor Kitchen, Pipe Cloth Wrap debris on floor (also to 2 nd and 3 rd floors)	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Shaftesbury/Salter Ward, Shires lynx WC cisterns (approx 4 on all floors)	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Shaftesbury/Salter Ward, Ground Floor Office Wall Panel behind wood	Board	Amosite (Brown)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Shaftesbury/Salter Ward, Fuse Box Shelf On 2 nd and 3 rd floors	Cement	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually.
Turner Ward				
Turner Ward First Floor Flue Pipe	Cement	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Turner Ward W.C. Cistern	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Turner Ward First Floor Bunny Boiler Internal Panel	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Turner Ward Rawl Plugs (Presumed throughout)	Board	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Turner Ward Kitchen Rope to pipe	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Turner Ward Kitchen Sink Paint	Bitumen	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Vanburgh / Vincent (seriously fire damaged / unsafe)				
Vanburgh/ Vincent Ward Ground W.C Link Wall Panel	Board	Amosite (Brown) Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Vanburgh / Vincent Ward, Rawl plugs to metal rising pipe sheaths and metal grid heater covers in segregation room (Throughout ward and presumed throughout site)	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually

4.

RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Vanburgh / Vincent (seriously fire damaged / unsafe)				
Vanburgh / Vincent Ward Lobby electrics (on each floor) Rope seal	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually.
Vanburgh/Vincent Ward, Lift shaft lining Wall Panels (all floors / whole shaft and ceiling)	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Vanburgh / Vincent Ward Shires lynx WC cisterns (Ground X5 and presume on all floors)	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Vanburgh / Vincent Ward Kitchens all floors Undersink and drainer paint	Bitumen	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Vanburgh / Vincent Ward, Ground Floor Kitchen, Pipe Cloth Wrap debris on floor (presume to 1 st , 2 nd and 3 rd floors)	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
World War II Underground Bunker				
WWII Underground Bunker Center Longitudinal Tunnel Fuse Box Flashguard	Rope	Chrysotile (White)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
WWII Underground Bunker South Longitudinal Tunnel Redundant AIB Sheet	Board	Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
WWII Underground Bunker South Longitudinal Tunnel Redundant Sheets (millboard)	Board	Chrysotile (White)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
WWII Underground Bunker South Longitudinal Tunnel Redundant Sheets	Cement	Chrysotile (White)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
WWII Underground Bunker South Longitudinal Tunnel Thin Sheets and floor debris (spread through out this area)	Cement	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
WWII Underground Bunker South Longitudinal Tunnel Redundant Sheets leant against wall and floor debris	Cement	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
WWII Underground Bunker Center Longitudinal Tunnel Fuse Box rope seal on floor	Rope	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel

4. RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Nightingale Ward				
Nightingale Ward Room adjacent corridor/lobby Rope to low level pipes	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Nightingale Ward Kitchen Rope to pipework	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Nightingale Ward Kitchen Sink paint	Bitumen	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Nightingale Ward First floor window infill panels	Board	Chrysotile (White) Amosite (Brown)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Nightingale Ward Cistern W.C (X6)	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Nightingale Ward Undercroft Debris (presumed throughout)	Lagging	Crocidolite (Blue) Amosite (Brown) Chrysotile (White))	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Hall adjacent Nightingale Ward Skylight rope seal	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Workshops				
Workshop stores adjacent Hall Pipe Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Workshop stores adjacent Hall Cement workbench (X2) adjacent sink	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Workshop stores adjacent Hall Low level boxing	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Workshop stores adjacent Hall Pipe Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Derelict Corridor adjacent stores Electrics	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Derelict Corridor adjacent workshop WC Cistern	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually

4.

RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Donne Dickens Ward				
Donne/Dickens Ward Kitchen sink	Bitumen	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Donne/Dickens Ward Ground Floor WC Cistern (X2)	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Donne/Dickens Ward Ground Floor Kitchen Sink paint	Bitumen	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Donne/Dickens Ward First floor Kitchen Rope to pipe	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Donne/Dickens Ward First Floor WC Cistern (X2)	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Donne/Dickens Ward First Floor Kitchen Sink paint	Bitumen	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Donne/Dickens Ward Electrics (X2) rope seal	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Faraday Ward & Plant Room adjacent Faraday Ward				
Calorifier Room adjacent Faraday Ward Large Tanks Pipe Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Calorifier Room adjacent Faraday Ward Floor Pipe Lagging Debris	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Calorifier Room adjacent Faraday Ward Small Tank & Pipe Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Calorifier Room adjacent Faraday Ward Red Pipe Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Calorifier Room adjacent Faraday Ward Blue Pipe Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Calorifier Room adjacent Faraday Ward Gaiter (X2)	Rope	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Calorifier Room adjacent Faraday Ward External Roof Soffit	Cement	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Corridor adjacent Faraday Ward Skylight rope seal	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually

4.

RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Faraday Ward & Plant Room adjacent Faraday Ward				
Faraday Ward Lobby Wall electrics Rope Seals	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Faraday Ward Ground Floor Kitchen Rope to pipework	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Faraday Ward Ground Floor W.C. Cistern (X20)	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Faraday Ward Riser rawl plugs (presumed throughout)	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Faraday Ward Ground Floor Nurses Station stud walls Internal Sandwich Boards	Board	Amosite (Brown) Chrysotile	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Faraday Ward Skylight Rope seal	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Faraday Ward First Floor, Main Ward Fireplace panels & debris	Cement	Chrysotile (White)	Strongly Presumed	Debris to be removed at next available opportunity. Re-Inspect Annually if accessible, until remediation.
Faraday Ward End Office Fireplace panels & debris	Cement	Chrysotile (White)	Strongly Presumed	Debris to be removed at next available opportunity. Re-Inspect Annually if accessible, until remediation.
Faraday Ward Office Fireplace panels & debris	Cement	Chrysotile (White)	Strongly Presumed	Debris to be removed at next available opportunity. Re-Inspect Annually if accessible, until remediation.
Faraday Ward Room adjacent Ward Wall electrics	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Faraday Ward Office adjacent stairs Fireplace panels	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Faraday Ward Second Floor Sink Pad	Bitumen	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Faraday Ward Stair Lobby Electrics	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Guy Ward First Floor Kitchen Rope to pipework	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Guy Ward First Floor Kitchen Sink Paint	Bitumen	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually

4. RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Faraday Ward and Plant Room adjacent Faraday Ward continued.....				
Guy Ward Undercroft Lagging debris	Lagging	Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Outhouse adjacent to Guy ward Soffit board	Board	Amosite (Brown) Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Soffitt Board External Debris	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed	Debris to be removed at next available opportunity. Re-Inspect Annually if accessible, until remediation.
Harvard & King Keats Wards				
Harvard Ward W.C. Cistern (X27)	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Harvard Ward Link corridor to W.C Block Wall mounted iron pad	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Harvard Ward Lobby Wall electrics Rope Seals	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Harvard Ward Ground Floor Kitchen Rope to pipework	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Harvard Ward Room opposite kitchen Sink Pad	Bitumen	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Harvard Ward First Floor Kitchen Rope to pipe work	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Harvard ward Lift motor room Panel to hatch	Board	Amosite (Brown) Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Rooms adjacent link corridor & Harvard Ward W.C. Cistern	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Rooms adjacent link corridor & Harvard Ward Fireplace panel	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Rooms adjacent link corridor & Harvard Ward Sink Pad	Bitumen	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Kings Keats Ward W.C. Cistern (X20)	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Kings Keats Ward Kitchen Rope to pipework	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually

4. RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Harvard & King Keat Wards continued.....				
Kings Keats Ward Sink Paint	Bitumen	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Kings Keats Ward Wall Electrics Rope seals	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Kings Keats Ward Sink Pad	Bitumen	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Johnson Ward & Plant Room adjacent Johnson Ward				
Johnson/Jenner Ward Ground Floor Upstand to skylight roof in sun room	Cement	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Johnson/Jenner Ward Sun Room Skylight Rope Seal	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Johnson/Jenner Ward Ceiling panels to sun room	Cement	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Johnson/Jenner Ward Wall Electrics	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Johnson/Jenner Ward Kitchen Rope to pipe work	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Johnson/Jenner Ward First Floor Sink Paint	Bitumen	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Johnson/Jenner Ward First Floor Sun Room Skylight Rope Seal	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Johnson/Jenner Ward First Floor Sink Pad	Bitumen	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Johnson/Jenner Ward First Floor Kitchen Rope to pipe work	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Johnson/Jenner Ward First Floor Kitchen Sink Paint	Bitumen	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Boiler House adjacent to Johnson/Jenner Ward, Large Tank (X3) Lagging	Lagging	Amosite (Brown) Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Boiler House adjacent to Johnson/Jenner Ward, Small Tank Lagging	Lagging	Amosite (Brown) Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel

4. RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Johnson Ward and Plant Room adjacent Johnson Ward continued.....				
Boiler House adjacent to Johnson /Jenner Ward, Electrics	Rope	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Boiler block adjacent Johnson/Jenner Ward, Door Panel	Board	Amosite (Brown) Chrysotile (White)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Boiler Block adjacent Johnson/Jenner Ward, Red Pipe lagging	Lagging	Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Boiler Block adjacent Johnson/Jenner Ward, Pipes entering duct	Lagging	Amosite (Brown) Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Nurses Staff Wing				
Nurses Block adjacent King/Keats Ward Panels in loft(x12)	Board	Amosite (Brown)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Nurse Block Staff Wing W.C. Cistern (X11)	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Nurse Block Sink Pad (X6)	Bitumen	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Nurses Block adjacent King/Keats Ward Flue pipe & Cement sheet in bunny boiler, (to all floors X3)	Cement	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Nurses Block External Flue pipe	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Kings/Keats Link Corridor Floor Tiles	Vinyl	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Nurses Wing Link Corridor Floor Tiles	Vinyl	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Lidgett Lettsom Ward				
Lidgett/Lettsom Ward Electrics	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Lidgett/Lettsom Ward Riser Rope lagging to pipe	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Lidgett/Lettsom Ward W.C. Cistern	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually

4. RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Lidgett Lettsom Ward continued.....				
Lidgett/Lettsom Ward Bathroom Floor Tile	Vinyl	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Lidgett/Lettsom Ward Kitchen rope debris	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Lidgett/Lettsom Ward Paper insert to pipe lagging, undercroft (presumed throughout)	Paper	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Lidgett/Lettsom Ward Kitchen Sink Paint	Bitumen	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Lidgett/Lettsom Ward Loft, Pipe lagging adjacent tank	Lagging	Chrysotile (White) Crocidolite (Blue)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Lidgett/Lettsom Ward, Loft, Pipe lagging	Lagging	Chrysotile (White) Crocidolite (Blue)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Lidgett/Lettsom Ward Loft, Pipe lagging debris	Lagging	Chrysotile (White) Crocidolite (Blue)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Art Therapy, Canteen & Kitchens				
Art Therapy Flue pipe adjacent boxing	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Art Therapy WC adjacent Corridor Bunny Boiler & Flue pipe	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Art Therapy Skylight (X4) Rope seal	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Art Therapy Kitchen Rope to Pipe	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Art Therapy External flue pipe	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Art Therapy W.C. Cistern (X3)	Paper	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Art Therapy First Floor end of Corridor Bathroom Bunny Boiler & Flue pipe	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Art Therapy Kitchen Cement panel under sideboard	Cement	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually

4. RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Art Therapy Canteen & Kitchen continued.....				
Canteen Undercroft Foil paper lagging	Paper	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Canteen Undercroft Foil paper lagging debris	Paper	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Canteen Electrics	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Canteen Wall electrics	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Hall adjacent Canteen Skylight rope seal	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Canteen, Catering Hall Radiator panel (X6)	Board	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Kitchen adjacent Catering Hall Sink paint	Bitumen	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Catering department W.C. Cistern	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Catering Hall Skylight rope seal	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Under stairs WC adjacent Main Hall W.C. Cistern	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Understairs WC adjacent Main Hall Bunny Boiler & Flue pipe	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Kitchen Skylight Rope Seals	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Kitchen Electrics	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Kitchen Cement to fridge wall	Cement	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Kitchen Hall Roof guttering	Cement	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Kitchen Electrics	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually

4.

RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Art Therapy Canteen & Kitchen continued.....				
Kitchen W.C Cistern	Board	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Kitchen Electrics in wood boxing	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Laundry & Workshops				
Laundry Office Wall Panel	Cement	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Laundry office Panel partition to store	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Laundry Skylight rope seals	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Laundry Electrics	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Laundry Small Office in Main Room Foil paper lagging	Paper	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Laundry, Toilets Paper under MMMF lagging (presumed throughout)	Paper	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Laundry, Toilets Bunny boiler & Flue pipe	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Laundry, Toilets Window infill panel above boiler	Board	Amosite (Brown)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Laundry, Main Room Red pipe lagging	Lagging	Amosite (Brown) Chrysotile (White)	Identified	Debris to be removed at next available opportunity. Re-Inspect Annually if accessible, until remediation.
Laundry, Main Room Wall debris	Debris	Chrysotile (White)	Identified	Debris to be removed at next available opportunity. Re-Inspect Annually if accessible, until remediation.
Laundry, Main Room Pipe debris	Debris	Chrysotile (White)	Identified	Debris to be removed at next available opportunity. Re-Inspect Annually if accessible, until remediation.
Laundry Rope to laundry equipment	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Laundry Red Pipe Lagging	Lagging	Amosite (Brown)	Strongly Presumed	Debris to be removed at next available opportunity. Re-Inspect Annually if accessible, until remediation.

4. RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Laundry & Workshops continued.....				
Laundry Rope gasket to dryer	Rope	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Lightwell adjacent Laundry Cement roof sheet	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Lightwell adjacent Laundry Cement roof sheet debris	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Laundry Caged area, Tank insulation	Lagging	Chrysotile (White) Crocidolite (Blue)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Laundry, High level pipe Pipe lagging debris behind pipe	Lagging	Chrysotile (White) Amosite (brown)	Identified	Debris to be removed at next available opportunity. Re-Inspect Annually if accessible, until remediation.
Door panel to door between Laundry & Laundry Store	Cement	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Laundry Foil corrugated paper pipe lagging	Paper	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
WC adjacent Laundry Cistern	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
External Workshop electrics within cage	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
External Workshop electrics	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
External Workshop cement debris (throughout)	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Roof sheet in lean-to adjacent Laundry Store & Incinerator	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Pipe lagging in lean-to adjacent Laundry Store & Incinerator	Lagging	Chrysotile (White) Crocidolite (Blue)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Lagging debris in lean-to adjacent Laundry Store & Incinerator	Lagging	Chrysotile (White) Crocidolite (Blue)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel

4. RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Laundry & Workshops continued.....				
Incinerator Rope seal	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Store adjacent Incinerator Roof sheet	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Laundry Store Wall debris	Debris	Chrysotile (White)	Identified	Debris to be removed at next available opportunity. Re-Inspect Annually if accessible, until remediation.
External Store adjacent Laundry Office Partition panel	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Workshop adjacent Laundry Electrics	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Store adjacent Generator Cable wrap	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Store adjacent Generator Redundant fuses	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Derelict building adjacent Workshop Rope to pipework	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Workshop External debris	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Workshop roof void Redundant Sink Pad	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Mortuary House, Kitchen, Partition board to low level breakfast bar	Board	Amosite (Brown)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Mortuary House Kitchen, Skylight rope seal	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Mortuary House Kitchen, Sink Pad	Bitumen	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Mortuary Fridge panels	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Mortuary W.C. Cistern	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Workshop adjacent Water Tank Tower Roof sheet	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually

4. RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Laundry & Workshops continued.....				
Workshop adjacent Water Tank Tower Undercroft Pipe Lagging (presumed throughout)	Lagging	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Remote store to rear of Water Tank Tower Roof Sheet	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Remote store to rear of Water Tank Tower Gasket debris	Gasket	Chrysotile (White)	Strongly Presumed	Debris to be removed at next available opportunity. Re-Inspect Annually if accessible, until remediation.
Water Tower, Corrugated lagging to outtake pipes,	Paper	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Water Tower Lagging Debris to outtake pipes	Lagging	Chrysotile (White)	Identified	Debris to be removed at next available opportunity. Re-Inspect Annually if accessible, until remediation.
Water Tower Courtyard, Foreman's Office Textured coating to ceiling	Textured Coating	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Water Tower Courtyard, Workshops Wall Gasket material	Gasket	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Water Tower Courtyard, Workshops Gasket material	Gasket	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Water Tower Courtyard, Workshops Gasket material (noted throughout)	Gasket	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Water Tower Courtyard, Workshops, Electrics	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Water Tower Courtyard Board debris outside workshops	Board	Amosite (Brown)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Water Tower Courtyard ECB Roof Upstand	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Water Tank Tower Electrics	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Water Tank Tower Office Ceiling	Board	Amosite (Brown)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Water Tank Tower Pipe Lagging (presumed throughout)	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually

4. RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Laundry & Workshops continued.....				
Bricked Up Garage adjacent Water Tower Debris to Floor (noted throughout area)	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Bricked Up Garage adjacent Water Tower Redundant Insulation Board Sheets (noted throughout area)	Board	Amosite (Brown) Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Bricked Up Garage adjacent Water Tower Redundant Flue Pipes (noted throughout area)	Cement	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Bricked Up Garage adjacent Water Tower Store Room High Level Pipe Lagging	Lagging	Amosite (Brown) Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Bricked Up Garage adjacent Water Tower Store Room Redundant Sheets (noted throughout area)	Cement	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Bricked Up Garage adjacent Water Tower Store Room adjacent corridor High Level Pipe Lagging	Lagging	Amosite (Brown) Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Bricked Up Garage adjacent Water Tower Ceiling to Cupboard adjacent Door to Corridor	Cement	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Boiler Room				
Boiler House Profiled Roof Sheet	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Boiler House Store, Redundant Crane valve	Gasket	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Boiler House Door panel,	Board	Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Boiler House Door panel debris	Board	Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Boiler House Roof Debris	Cement	Chrysotile (White)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Boiler House Tank Room, Gaiter to tank (X4),	Rope	Chrysotile (White)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel

4. RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Laundry & Workshops continued.....				
Boiler Room Tank Room Main Tank Lagging	Lagging	Chrysotile (White) Amosite (brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Boiler House Tank Room, Tank (X4) Lagging	Lagging	Chrysotile (White)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Boiler Room Pipe Lagging	Lagging	Chrysotile (White) Amosite (brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Boiler Room Tank Room Floor beneath tank Lagging debris (presumed throughout)	Lagging	Chrysotile (White) Amosite (brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Boiler Room Main Pipe Duct Pipe Lagging	Lagging	Chrysotile (White) Amosite (brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Boiler Room Main Plant Room Gaskets to Boilers	Gasket	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Boiler Room Electrics	Rope	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Boiler House Redundant Gaskets	Gaskets	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Boiler Room W.C. Cistern	Plastic	Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Boiler House Sink Pad	Bitumen	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel

4.

RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
John Hutchinson Centre				
John Hutchinson Centre Cement under metal duct cover	Cement	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
John Hutchinson Centre W.C. Cistern	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
John Hutchinson Centre Office wall panel	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
John Hutchinson Centre Bunny Boiler & Flue pipe	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
John Hutchinson Centre Ceiling panel to flat roofed room	Board	Amosite (Brown) Chrysotile (White)	Identified	Debris to be removed at next available opportunity. Re-Inspect Annually if accessible, until remediation.
John Hutchinson Centre Cement wall panels	Cement	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
John Hutchinson Centre Store Room Ceiling Panel	Board	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
John Hutchinson Centre Corridor wall panels (internal & external)	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
John Hutchinson Centre Stair surround panels,	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
John Hutchinson Centre Main Hall Skylight rope seal	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
John Hutchinson Centre Wall Panels adjacent conveyor	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
John Hutchinson Centre External wall panels	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually

4. RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
John Hutchinson Centre continued.....				
John Hutchinson Centre External Garage Corrugated Roof sheet	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Nurse Accommodation Block				
Nurses Block, Middle Annex, First Floor Kitchen, Cement panel	Board	Amosite (Brown)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Nurses Block, Middle Annex First Floor Kitchen, Sink Pad	Bitumen	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Nurses Block, Middle Annex, W.C Cistern	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Nurses Block, Middle Annex, Black stair nosing	Vinyl	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Nurses Block, Middle Annex, Corridor wall electrics	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Nurses Block, Middle Annex, Electric Cupboard	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Nurses Block, Middle Annex, Ground Floor, Wall panel to electric cupboard	Board	Amosite (Brown)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Nurses Block, Middle Annex, W.C, Redundant flue pipe	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Nurses Block, Middle Annex, Ground floor cupboard, Wall Panel	Board	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Nurses Block, Middle Annex, Ground floor W.C. Redundant Flue pipe	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Nurses Block, Rear Annex, Electrics	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Nurses Block, Rear Annex, Electric cupboard, Wall panel	Board	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Nurses Block, Rear Annex, W.C Bunny Boiler Flue and Internal Panels	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Nurses Block, Rear Annex, Cupboard Wall Panel	Board	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Nurses Block, Rear Annex, W.C Bunny Boiler	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually

4. RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Nurses Accommodation Block continued.....				
Nurses Block, Rear Annex, Corridor Electrics	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Nurses Block, Rear Annex, Ironing Board Pad	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Main Nurses Block Third Floor, End Bedroom, Riser behind Sink, Pipe lagging, (presumed to all sink risers to all floors)	Lagging	Chrysotile (White) Amosite (brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Main Nurses Block, Third Floor, Bedrooms, Riser behind Sink, Pipe lagging (presumed to all floors to risers serving sinks)	Lagging	Chrysotile (White) Amosite (brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Main Nurses Block, Domestic cupboards in Corridor (X2), Pipe lagging, (noted to all floors)	Lagging	Chrysotile (White) Crocidolite (Blue)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Main Nurses Block, Second Floor, Domestic Cupboards in Corridor (X2), Pipe lagging (noted to all floors)	Lagging	Chrysotile (White) Crocidolite (Blue)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Main Nurses Block Stairs (X2) Stair Nosing	Vinyl	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Main Nurses Block Bunny Boiler (X3)	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Main Nurses Block Ironing Board Panel	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Main Nurses Block Loft Lobby Pipe lagging	Lagging	Chrysotile (White) Crocidolite (Blue) Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Main Nurses Block Loft, Door Panels (X2)	Board	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Main Nurses Block (LHS) Loft Pipe lagging	Lagging	Chrysotile (White) Crocidolite (Blue) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel

4. RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Nurses Accommodation Block continued.....				
Main Nurses Block (RHS) Loft Pipe lagging	Lagging	Chrysotile (White) Crocidolite (Blue) Amosite	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Nurses Block Rear Annex, Loft Sectional lagging & Flue pipes	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Nurses Block, Rear Annex, Loft, Sectional lagging	Lagging	Chrysotile (White) Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Nurses Block, Rear Annex, Loft, Box of Sectional lagging	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Nurses Block, Middle Annex, Loft Cement flue pipes (X2)	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Nurses Block, Rear Annex, External Roof Soffit panels	Cement	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Main Nurses Block Basement boiler room, LHS Under floor duct (X6) Pipe lagging,	Lagging	Chrysotile (White)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Main Nurses Block Basement boiler room, Main floor duct Pipe lagging	Lagging	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Main Nurses Block Basement boiler room, Pipe lagging	Lagging	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Main Nurses Block Basement boiler room, Tank Pipe lagging	Lagging	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Main Nurses Block Store adjacent Basement boiler room, Pipe lagging,	Lagging	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Main Nurses Block Basement boiler room, Main duct adjacent entrance Pipe lagging,	Lagging	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel

4. RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Nurses Accommodation Block continued.....				
Main Nurses Block Basement boiler room, RHS Under floor duct (X6) Pipe lagging,	Lagging	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Nurses Block, Middle Annex, Boiler room, Ceiling panels	Board	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Nurses Block, Middle Annex, Boiler Room, Tank lagging	Lagging	Chrysotile (White) Crocidolite (Blue)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Nurses Block, Middle Annex, Boiler room ,Pipe lagging	Lagging	Chrysotile (White) Crocidolite (Blue)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Nurses Block, Middle Annex, Boiler Room, Pipe lagging debris	Lagging	Chrysotile (White) Crocidolite (Blue)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Shed adjacent Main Nurses Block Roof tiles	Cement	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Shed adjacent Main Nurses Block Redundant roof sheet	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Shed adjacent Main Nurses Block, AIB debris on ground by (throughout area)	Board	Amosite (Brown)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Shed adjacent Main Nurses Block, Roof tiles	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Shed adjacent Main Nurses Block Partition Panels	Board	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Garden Stores (X4) Roof	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Garden Store Redundant panel behind tank	Board	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Garden Outbuildings Corrugated Roof Sheet	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Gardeners Cottage Fireplace board	Board	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Gardeners Cottage Electrics	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually

4.

RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Nurses Accommodation Block continued.....				
Gardeners Cottage Under stairs Electrics	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Gardeners Cottage W.C. Cistern	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Gardeners Cottage, Plant Room, Pipe lagging	Lagging	Chrysotile (White) Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Gardeners Cottage, Plant Room, Tank lagging	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
North Lodge				
North Lodge External porch panels	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
North Lodge External Flue pipes (X3)	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
North Lodge W.C. Cistern	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
North Lodge Ground Floor, Kitchen Boiler Flue pipe	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
North Lodge First Floor Kitchen Boiler Flue pipe	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
North Lodge First Floor Kitchen electrics	Rope	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
North Lodge Loft, Redundant panels	Board	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
North Lodge Loft flue pipe	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
North Lodge External Redundant flue pipe	Cement	Chrysotile (White)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually
Swimming Pool Block Changing Room Pink cement roof tiles	Cement	Chrysotile (White)	Identified	Label & Manage in place. Remove before any works. Re-inspect Annually
Swimming Pool Changing Room W.C. Cistern	Plastic	Amosite (Brown)	Strongly Presumed	Label & Manage in place. Remove before any works. Re-inspect Annually

4.

RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Nurses Accommodation Block continued.....				
Nurses Block Remote Plant Room Tank Lagging	Lagging	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Nurses Block Remote Plant Room Pipe Lagging	Lagging	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground Ducts				
Underground duct Main Pipe Room beneath store adjacent Water Tank Tower Pipe Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground Duct under generator room adjacent to Main Pipe Room Pipe Lagging debris	Lagging	Chrysotile (White) Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct Duct under Generator Room Pipe lagging	Lagging	Chrysotile (White) Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct Sectional Pipe lagging, Duct under generator room leading towards Kitchens	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct Hard set Pipe lagging in Duct adjacent Generator Room	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct Pipe residue in corridor duct adjacent to Zachery Unwin Ward	Lagging	Chrysotile (White)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct Pipe debris in corridor duct adjacent Vanburgh Vincent Ward	Lagging	Chrysotile (White)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct beneath Corridor adjacent Turner Floor Cement Debris	Cement	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel

4. RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Underground Duct s continued.....				
Underground duct beneath Corridor adjacent Turner Sectional Pipe Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct beneath Corridor adjacent Shaftesbury/Salter Sectional Lagging & Redundant sectional lagging	Lagging	Chrysotile (White) Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct Plant Room, adjacent Nightingale Ward Pipe lagging,	Lagging	Chrysotile (White) Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct beneath Corridor adjacent Nightingale Pipe lagging	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct beneath Corridor adjacent Nightingale-Wren Pipe Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct beneath Corridor adjacent Turner Hard set lagging adjacent MMMF lagging	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct beneath Corridor adjacent Stores Pipe Lagging	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct beneath east side corridor adjacent Kitchen Corrugated Foil paper lagging	Paper	Chrysotile (White)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct beneath east side corridor adjacent Kitchen, Sectional Lagging adjacent MMMF lagging	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground Corridor Duct Sectional Pipe lagging (presumed throughout)	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct beneath Corridor adjacent to Dentist Sectional lagging,	Lagging	Crocidolite (Blue)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct beneath Corridor adjacent to Dentist Sectional lagging debris,	Lagging	Chrysotile (White) Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel

4.

RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Underground Duct s continued.....				
Underground duct Corridor Duct adjacent Ellis Asbestos Bags in partially bricked up void	Lagging	Chrysotile (White) Crocidolite (Blue) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct leading to boiler block adjacent Faraday Sectional lagging,	Lagging	Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct beneath Corridor adjacent Guy Ward, Asbestos Bags in partially bricked up void	Lagging	Chrysotile (White) Crocidolite (Blue) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct beneath link corridor adjacent King Keats ward Sectional lagging	Lagging	Chrysotile (White)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct Adjacent Staff Wing Sectional pipe lagging	Lagging	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct Adjacent Liggett/Lettsom Ward Sectional pipe lagging	Lagging	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct adjacent Liggett/Lettsom Ward Floor debris	Lagging	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct Void adjacent Water Tower Lagging to pipe work	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct adjacent Water Tower Corrugated Foil lagging	Paper	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct under water tower Corrugated Foil lagging debris	Paper	Chrysotile (White)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct Void adjacent Water Tower Asbestos Waste Bags in void	Lagging	Chrysotile (White) Crocidolite (Blue) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel

4. RECOMMENDATIONS

Location	Material type	Asbestos type	Level of Identification	Recommendations
Underground Duct s continued.....				
Underground duct Plant Room adjacent Nightingale Ward Asbestos Waste bags	Lagging	Chrysotile (White) Crocidolite (Blue) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct Plant Room adjacent Nightingale Ward Floor Lagging debris	Lagging	Chrysotile (White) Amosite (Brown)	Strongly Presumed	Isolate area pending removal / decontamination work. No Access to unprotected personnel
Underground duct beneath Corridor adjacent Kitchen Sectional Lagging	Lagging	Amosite (Brown)	Identified	Isolate area pending removal / decontamination work. No Access to unprotected personnel

- 4.2 Normandie recommends that all asbestos containing materials be removed prior to the demolition of the building
- 4.3 No other asbestos inclusions could be reasonably located within the confines of a type 3 survey. Attention is drawn to the survey brief and the caveat for areas not included within the survey and for areas that could not be accessed for survey purposes.

5. SURVEY INFORMATION SHEETS

SURVEY INFORMATION SHEET

Reception Building (SAS Building)

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Reception Block, 1 st Room, Male Side, Lathe And Plaster To Walls		Asbestos	No Asbestos Detected
Material Type Textured coating		Quantity 180m ²		Type	N/A
				Sample No	06/B/8026/1
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Reception Block, 1 st Room, Male Side, Bitumen Felt Under Wood Floor		Asbestos	No Asbestos Detected
Material Type Bitumen		Quantity 50m ²		Type	N/A
				Sample No	06/B/8026/2
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Reception Block, 1 st Room, Ground Floor, Male Side, Fire Heating Element	Asbestos Type	No Asbestos Detected N/A
Material Type	Board	Quantity	0.5m ²	Sample No 06/B/8026/3 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo 1 st Room , Male Side, Through To Reception Entrance, Panel Above Door	Asbestos Type	No Asbestos Detected N/A
Material Type	Board	Quantity 1m ²	Sample No	06/B/8026/4
			Survey Date	24.04 - 29.06.06
			Date of Report	18.08.06
			Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulson, Surrey, CR5 3ES		Position of Sample/Photo Reception Block, Male side W.C, Shires Lynx type Cistern (x5)	Asbestos Yes Type Amosite (Brown)
Material Type Plastic	Quantity 1m ² (x2 on Grd) (x1 on Basement, 1 st & 2 nd floors)	Sample No 06/B/8026/5 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Reception Block, W.C Seat (x3)		Asbestos	No Asbestos Detected
Material Type Plastic		Quantity <1m ² Each unit		Type	N/A
				Sample No	06/B/8026/6
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Reception Block, Stairs, Grey Vinyl Floor Sheet		Asbestos Type	No Asbestos Detected N/A
Material Type Vinyl		Quantity 10m ²		Sample No	06/B/8026/7
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	


Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Reception Block, Stairs, Red Stair Nosing (18 steps)	Asbestos No Asbestos Detected Type N/A
Material Type Vinyl	Quantity 2m ²	Sample No 06/B/8026/8 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph

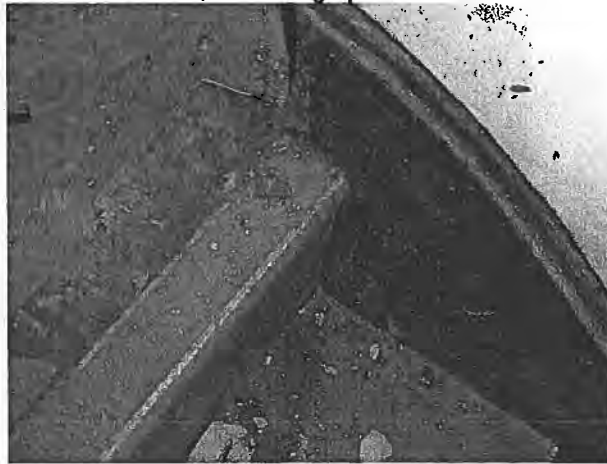

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Reception Block, Male Side, Basement, Flash Pad (Strongly Presumed throughout to all electrics)	Asbestos Yes Type Chrysotile (White)
Material Type Rope	Quantity <1m ²	Sample No 06/B/8026/9 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Reception Block, Basement, Vinyl Floor Sheet		Asbestos	No Asbestos Detected
				Type	N/A
Material Type	Vinyl & Bitumen	Quantity	16m ²	Sample No	06/B/8026/10
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Reception Block, Basement, Sash Window Rope Cord		Asbestos	No Asbestos Detected
Material Type Rope		Quantity 8l/m		Type	N/A
				Sample No	06/B/8026/11
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Reception Block, Basement, Green Vinyl Floor Sheet	Asbestos Type	No Asbestos Detected N/A
Material Type	Vinyl	Quantity	20m ²	Sample No 06/B/8026/12 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Reception Block, Basement, Red Vinyl Floor Sheet	Asbestos Type	No Asbestos Detected N/A
Material Type	Vinyl	Quantity	20m ²	Sample No 06/B/8026/13 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph




SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Reception Building Second Floor Front Office Panel beneath heater	Asbestos Yes Type Amosite (Brown) Chrysotile (White)
Material Type Board	Quantity 1m ²	Sample No 06/B/8026/14 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Reception Building Second Floor Rear Office Panel beneath heater		Asbestos Type	Yes, Strongly Presumed Amosite (Brown) Chrysotile (White)
Material Type	Board	Quantity	1m ²	Sample No	As 06/B/8026/14
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	


Photograph



SURVEY INFORMATION SHEET

Location of Survey		Position of Sample/Photo		Asbestos	No Asbestos Detected
Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Reception Building First Floor Room beneath clocktower Door Panel		Type	N/A
Material Type	Board	Quantity	1m ²	Sample No	06/B/8026/17
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph

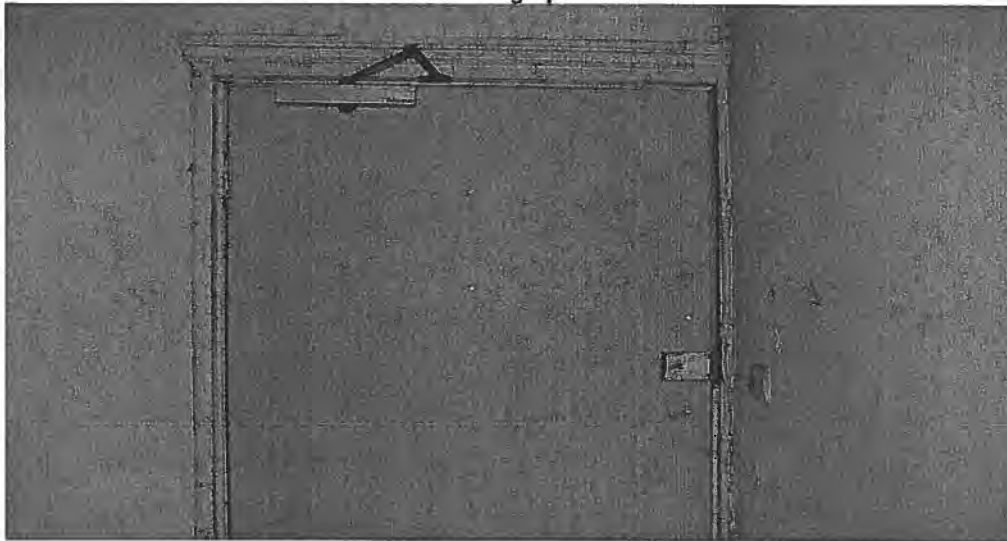

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Reception Building Entrance Lobby Ground Floor Redundant sink pad	Asbestos Type	No Asbestos Detected N/A
Material Type	Bitumen	Quantity	<1m ²	Sample No 06/B/8026/18 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET



Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES	Position of Sample/Photo Reception Building Ground Floor Office adjacent stairs to basement Panel behind radiator	Asbestos Yes Type Chrysotile (White)
Material Type Cement	Quantity 2m ²	Sample No 06/B/8026/19 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Reception Building, Female side, Basement Fireplace panel	Asbestos Yes Type Chrysotile (White)
Material Type Cement	Quantity 2m ²	Sample No 06/B/8026/20 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

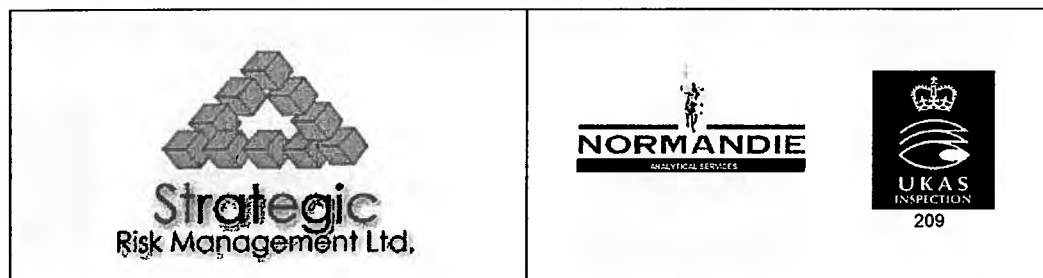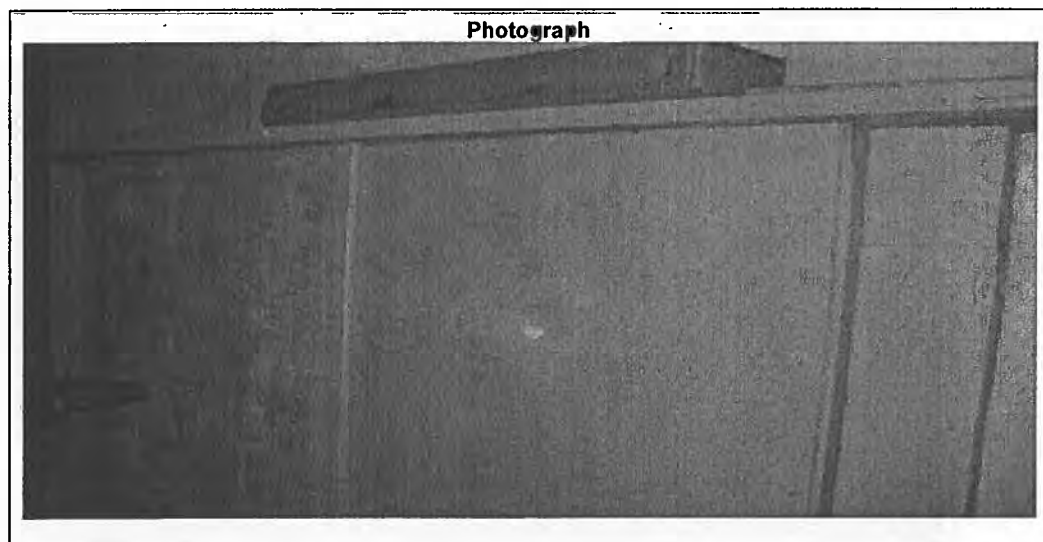

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Reception Building Basement Electrical intake cable		Asbestos	No Asbestos Detected
Material Type Bitumen Rope		Quantity 1m		Type	N/A
				Sample No	06/B/8026/21
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	


Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Reception Building, Female side, Basement Electrics Rope Seal	Asbestos Yes Type Chrysotile (White)
Material Type Rope	Quantity 1m	Sample No 06/B/8026/22 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]


Photograph

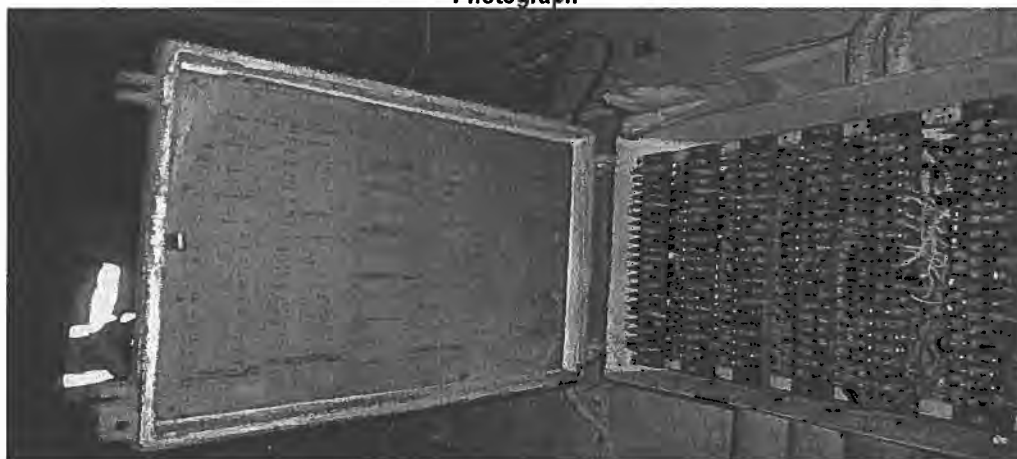

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Reception Building Female Side, First Floor WC Boxing	Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type Cement	Quantity 1m ²	Sample No As 06/B/8026/78 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]	


Photograph

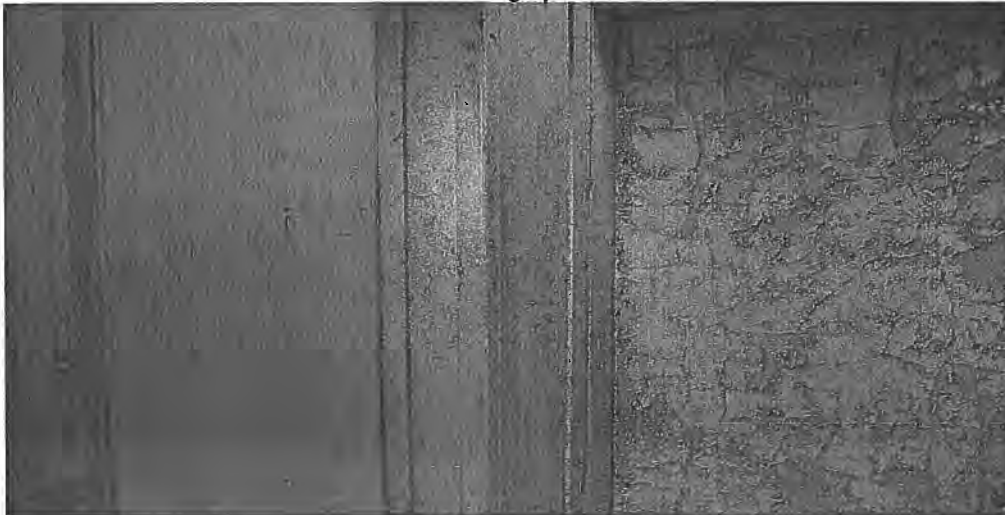

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Reception Building Female Side, Stair Vinyl Turquoise Floor Lino		Asbestos	No Asbestos Detected
Material Type Vinyl		Quantity 10m ²		Type	N/A
				Sample No	06/B/8026/25
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	


Photograph

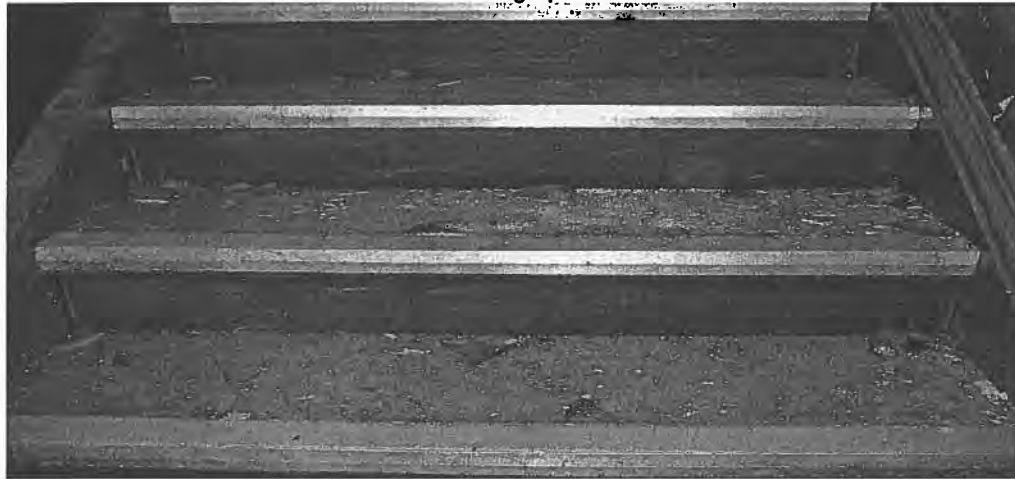

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Reception Building Female Side, White Stair Nosing		Asbestos	No Asbestos Detected
Material Type Vinyl		Quantity 24m		Type	N/A
				Sample No	06/B/8026/26
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph

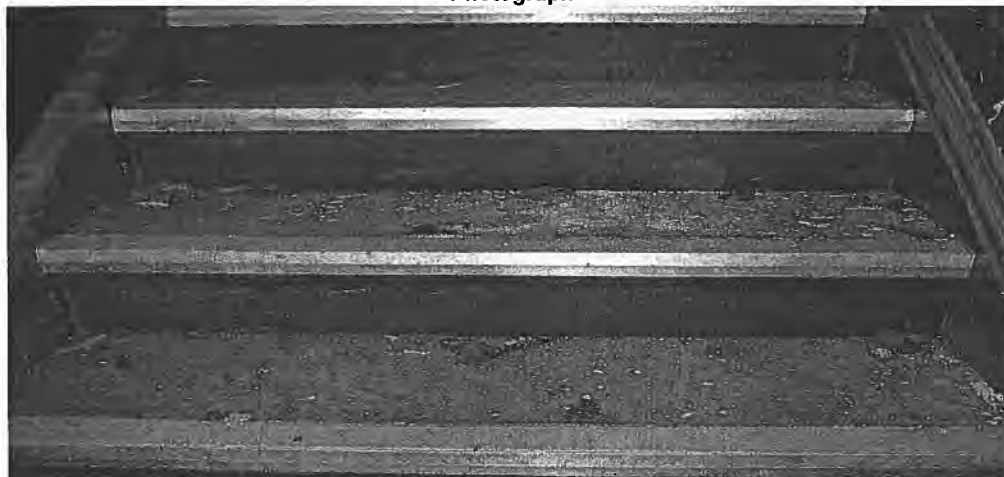

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Reception Building Female Side, First Floor Front Office, Partition Panels	Asbestos Yes Type Amosite (Brown) Chrysotile (White)	
Material Type Board	Quantity 20m ²	Sample No 06/B/8026/27 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]	

Photograph



SURVEY INFORMATION SHEET



Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Reception Building 1 st Floor Lobby, Electrics Fuse Carriers & Shelf	Asbestos Yes
Material Type Paper & Cement		Quantity <1m ²	Type Chrysotile (White)
			Sample No 06/B/8026/28
			Survey Date 24.04 - 29.06.06
			Date of Report 18.08.06
			Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Reception Building Ground Floor Rear Office Panel beneath shelf	Asbestos Yes, Strongly Presumed Type Amosite (Brown) Chrysotile (White)	
Material Type Board	Quantity 1m ²	Sample No As 06/B/8026/24 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) 	

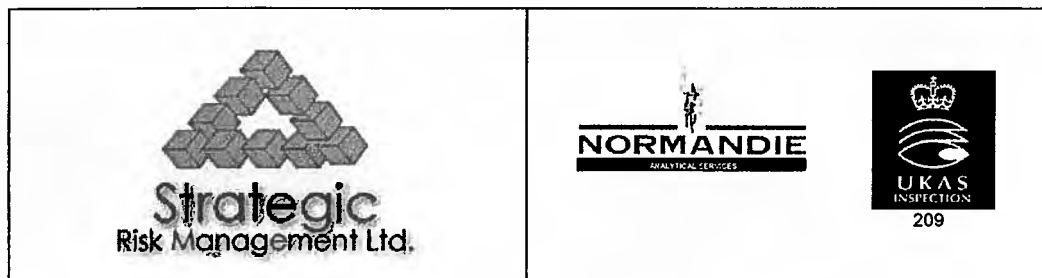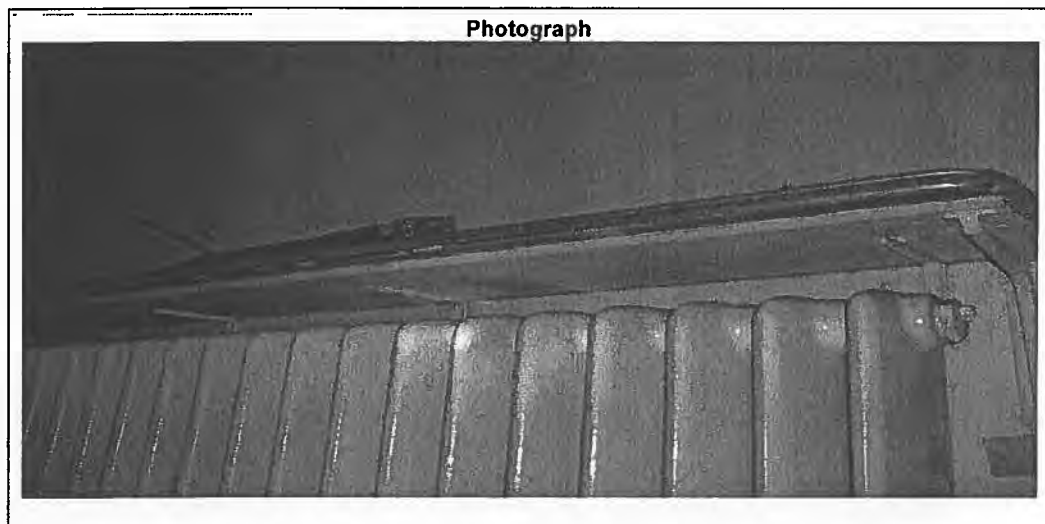

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Reception Building Female Side, Loft Redundant Panel	Asbestos Type	Yes, Strongly Presumed Amosite (Brown) Chrysotile (White)
Material Type Board	Quantity 1m ²	Sample No Survey Date Date of Report Surveyor(s)	As 06/B/8026/24 24.04 - 29.06.06 18.08.06

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Reception Building Corridor adjacent Reception Beige Floor Tile & Bitumen		Asbestos Yes	
Material Type Vinyl & Bitumen		Quantity 120m ²		Type Chrysotile (White)	
				Sample No 06/B/8026/29	
				Survey Date 24.04 - 29.06.06	
				Date of Report 18.08.06	
				Surveyor(s) [REDACTED]	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Reception Building Corridor adjacent Reception Red Floor Tile & Bitumen	Asbestos Yes Type Chrysotile (White)
Material Type Vinyl & Bitumen	Quantity 60 ²	Sample No 06/B/8026/30 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]


Photograph




SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Reception Building Main Corridor skylight (X2) Rope seals		Asbestos Type	Yes Chrysotile (White)
Material Type	Rope	Quantity	20m	Sample No	06/B/8026/31
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph

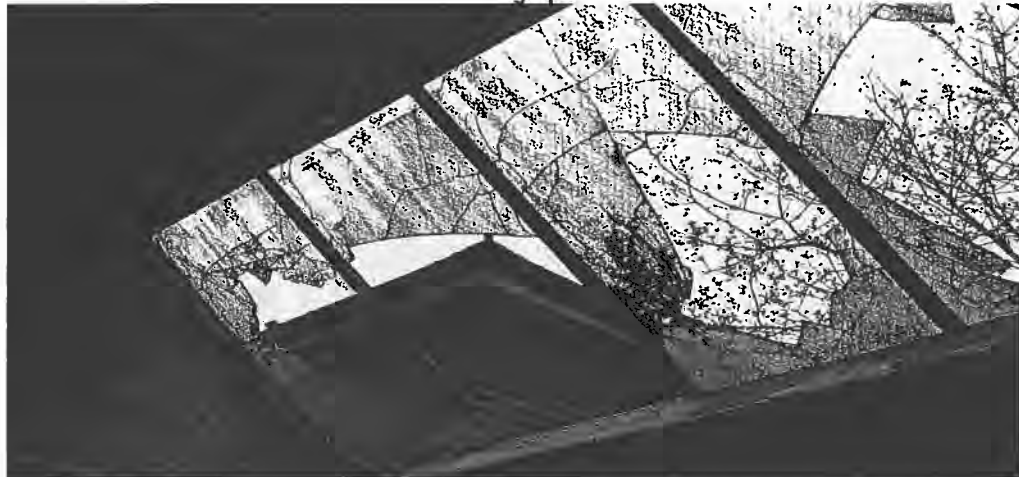

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulson, Surrey, CR5 3ES		Position of Sample/Photo Reception Building W.C adjacent corridor External Flue Pipe		Asbestos	Yes, Strongly Presumed
Material Type Cement		Quantity 4m		Type	Chrysotile (White)
				Sample No	As 06/B/8026/154
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	


Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Reception Building WC adjacent corridor Bunny Boiler flue pipe		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type	Cement	Quantity	4m	Sample No	As 06/B/8026/109
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph

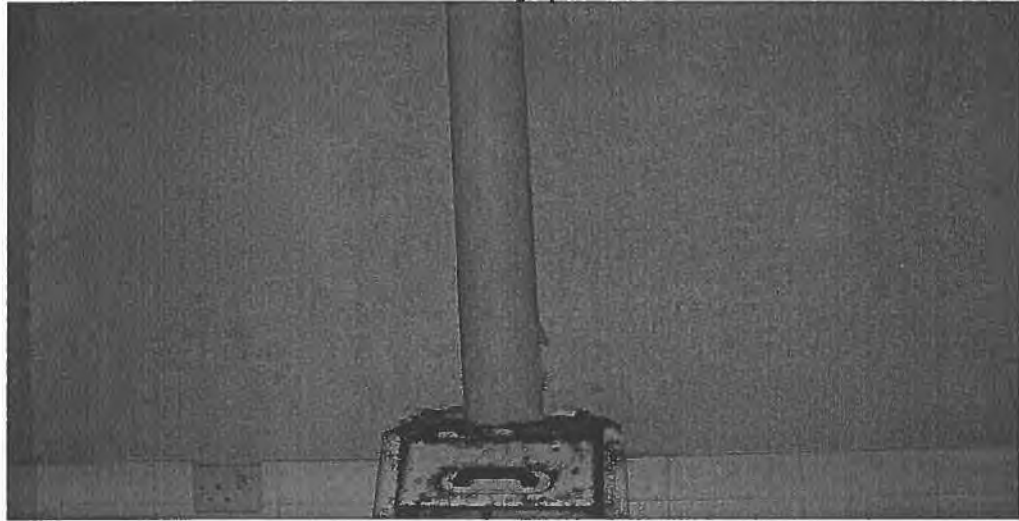

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Reception Building WC Cistern (X3)	Asbestos Type	Yes, Strongly Presumed Amosite (Brown)
Material Type	Plastic	Quantity	<1m ²	Sample No Survey Date Date of Report Surveyor(s)
				As 06/B/8026/5 24.04 – 29.06.06 18.08.06 [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Hall/Chapel Area (and surrounding Corridors)

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Hall/Chapel Area Corridor Left, Adj Hall/Chapel, Foil Pipe Lagging In Wall Void		Asbestos	Yes
Material Type		Quantity		Type	Chrysotile (White)
Lagging		1l/m ²		Sample No	06/B/8026/32
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph




SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Hall/Chapel Area Fibre Board Paper Lining In Small Room Between Chapel And LHS Adj Corridor (debris throughout on floor)	Asbestos Yes
Material Type Paper		Quantity 18m ²	Type Chrysotile (White)
		Sample No 06/B/8026/33	
		Survey Date 24.04 - 29.06.06	
		Date of Report 18.08.06	
		Surveyor(s)	

Photograph




SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Hall/Chapel Area, Fibre Board Ceiling Paper Lining In X-Ray room LHS Adj Corridor and debris		Asbestos Type	Yes, Strongly presumed Chrysotile (White)
Material Type	Paper	Quantity	18m ²	Sample No	As 06/B/8026/33
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	


Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Hall/Chapel Area X-Ray LHS Adj Corridor – Rope seals to skylights		Asbestos Type	Yes, Strongly presumed Chrysotile (White)
Material Type Rope		Quantity Approx 48 l/m		Sample No Survey Date Date of Report Surveyor(s)	As 06/B/8026/31 24.04 - 29.06.06 18.08.06 

Photograph

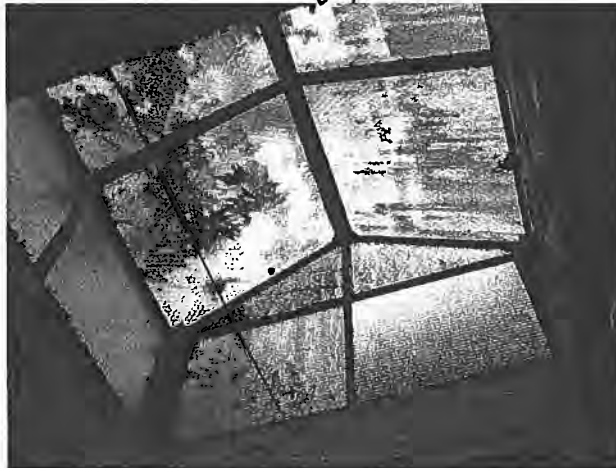

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Hall/Chapel Area, 2 nd Room, Cement Sheet In Floor Duct With Solid Floor Adj Left Hand Side Of Corridor (Lending Library)	Asbestos Yes Type Chrysotile (White)	
Material Type Cement	Quantity 15m ²	Sample No 06/B/8026/34 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]	

Photograph




SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Hall/Chapel Area, 2 nd Room next to Hall, Shires lynx WC cistern (X1) Adj Left Hand Side Of Corridor (Lending Library)	Asbestos Type	Yes, Strongly presumed Amosite (Brown)
Material Type	Plastic	Quantity 1m ²	Sample No Survey Date Date of Report Surveyor(s)	As 06/B/8026/5 24.04 - 29.06.06 18.08.06

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Hall/Chapel Area, 2 nd room Lending library, Fibre Board Ceiling		Asbestos Type	Yes Chrysotile (White)
Material Type	Paper	Quantity	30m ²	Sample No	06/B/8026/35
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Hall/Chapel Area, Floor Coating, Lopped Up Walls In Last Room Right Hand Side Of Left Hand Corridor		Asbestos	No Asbestos Detected
Material Type Ceramic		Quantity 16m ²		Type	N/A
				Sample No	06/B/8026/36
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Hall/Chapel Area Corridor To The Back Of Chapel, incl access links from main corridors Grey Floor Tiles	Asbestos Type	Yes, Bitumen only Chrysotile (White) Bitumen only
Material Type	Vinyl & Bitumen	Quantity	200m ²	Sample No 06/B/8026/37 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Hall/Chapel Area, Corridor To The Back Of Chapel, incl access links from main corridors Red Floor Tiles		Asbestos Yes Bitumen only
Material Type Vinyl & Bitumen		Quantity 200m ²	Sample No 06/B/8026/38	Type Chrysotile (White) Bitumen only
			Survey Date 24.04 - 29.06.06	
			Date of Report 18.08.06	
			Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Hall/Chapel Area Corner Room, Left Hand And Back Corridor, Floor Coating		Asbestos	No Asbestos Detected
Material Type Ceramic		Quantity 35m ²		Type	N/A
				Sample No	06/B/8026/39
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Hall/Chapel Area Back Room Of 2 nd Room, Back Corridor To Chapel, Sink Coating		Asbestos Type	No Asbestos Detected N/A
Material Type	Bitumen Paint	Quantity	1m ²	Sample No	06/B/8026/40
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	


Photograph




SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Hall/Chapel Area Corridor To The Back Of Chapel, Access link Rope to switchboards	Asbestos Type	Yes, Strongly presumed Chrysotile (White)
Material Type Rope	Quantity 2m ²	Sample No As 06/B/8026/22 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]	

Photograph

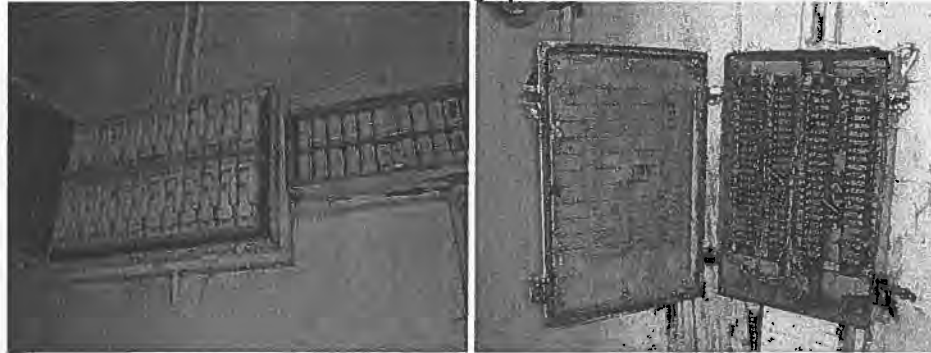

SURVEY INFORMATION SHEET



Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Hall/Chapel Area, Corridors adj Chapel Rope seals to skylights		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type Rope		Quantity 28 l/m each set of 4		Sample No Survey Date Date of Report Surveyor(s)	As 06/B/8026/31 24.04 - 29.06.06 18.08.06 

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Hall/Chapel Area Lightwell adj chapel RH rear, Corrugated cement sheets	Asbestos Yes, Strongly presumed	Type Chrysotile (White)
Material Type Cement	Quantity 4m ²	Sample No As 06/B/8026/126 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) 	

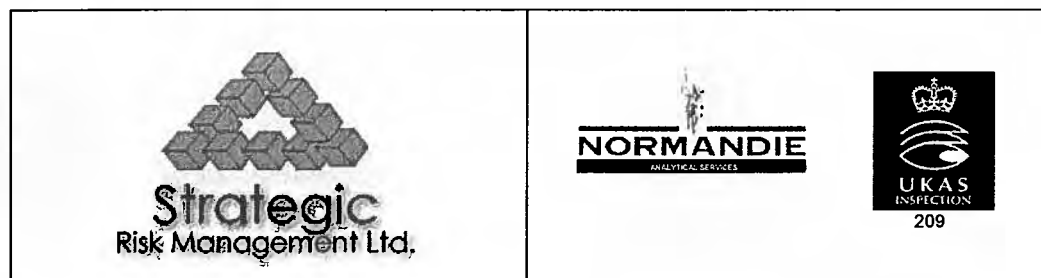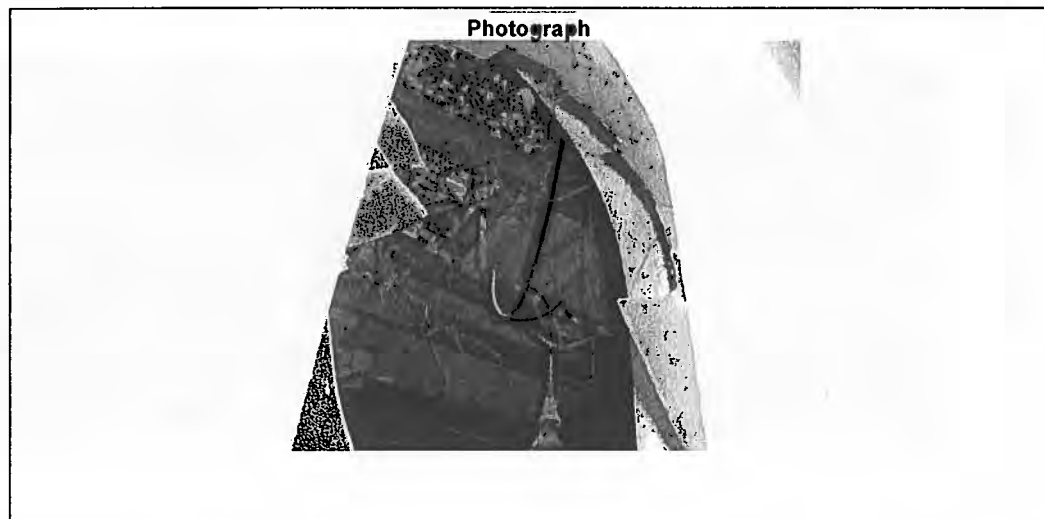

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Hall/Chapel Area, Dispensary, Radiator panels (X2)	Asbestos Type	Yes, Strongly presumed Chrysotile (White)
Material Board Type	Quantity 1m ² (X2)	Sample No As 06/B/8026/24 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]	

Photograph




SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Hall/Chapel Area Dispensary Room, Sink Pad (x3) (2 are to drainers)		Asbestos Yes
Material Type Bitumen		Quantity 0.5m ² Each Unit		Type Chrysotile (White) Sample No 06/B/8026/41 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph




SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Hall/Chapel Area Admin Office, Cementaceous Roof Coating Also noted throughout site		Asbestos Type	No Asbestos Detected N/A
Material Type Bitumen / Cement		Quantity 40m ²		Sample No Survey Date Date of Report Surveyor(s)	06/B/8026/42 24.04 - 29.06.06 18.08.06 

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Hall/Chapel Area, Vestry, Rope Cable To Ceiling Lights		Asbestos Yes
Material Type Rope		Quantity 30l/cm ² (x3)	Type Chrysotile (White)	
			Sample No 06/B/8026/43	
			Survey Date 24.04 - 29.06.06	
			Date of Report 18.08.06	
			Surveyor(s) 	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Hall/Chapel Area, Vestry, Rope seals to skylights		Asbestos Type	Yes, Strongly presumed Chrysotile (White)
Material Type Rope		Quantity 28 l/m		Sample No	As 06/B/8026/31
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Hall/Chapel Area, Pipe Lagging, Covered Light Well, Next To Vestry (note damaged)		Asbestos	Yes
Material Type Lagging		Quantity 5 l/m x 15cm dia		Type	Crocidolite (Blue) Amosite (Brown)
				Sample No	06/B/8026/44
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Hall/Chapel Area Chapel, Small Red Floor Tiles	Asbestos Yes
Material Type Vinyl & Bitumen		Quantity 15m ²	Type Chrysotile (White)
			Sample No 06/B/8026/45
			Survey Date 24.04 - 29.06.06
			Date of Report 18.08.06
			Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Hall/Chapel Area Chapel, Small Black Floor Tiles		Asbestos	Yes
				Type	Chrysotile (White)
Material Type	Vinyl & Bitumen	Quantity	8m ²	Sample No	06/B/8026/46
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	[REDACTED]

Photograph




SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Hall/Chapel Area Chapel, Bellow Material To Organ		Asbestos	No Asbestos Detected
Material Type Paper/Cloth		Quantity 1m ²		Type	N/A
				Sample No	06/B/8026/47
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph Corrupted



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Hall/Chapel Area Chapel, Pipe Lagging Residue In Undercroft	Asbestos Type	No Asbestos Detected N/A
Material Type Lagging	Quantity 1m ²	Sample No 06/B/8026/48 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Olave Queens Ward

Location of Survey		Position of Sample/Photo		Asbestos	Yes
Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Olave Queens Ward, Undercroft, Foil Lagging		Type	Chrysotile (White)
Material Type	Lagging	Quantity	70 l/m	Sample No	06/B/8026/50
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Olave Queens Ward Ground floor Toilet off 1 st ward – Shires Lynx WC cistern (X1)		Asbestos Type	Yes Strongly presumed Amosite (Brown)
Material Type	Plastic	Quantity	1m ²	Sample No	As 06/B/8026/5
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	


Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Olive Queens Ward, Ground floor 1 st ward, Flashpads in electrical box	Asbestos Yes, Strongly Presumed Type Chrysotile (White)
Material Type Lagging	Quantity 70 l/m	Sample No As 06/B/8026/9 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph

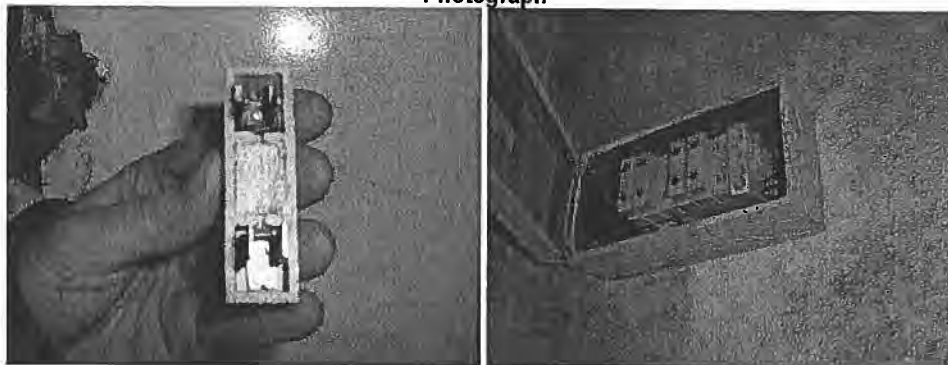

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Olave Queens Ward Undercroft Lagging		Asbestos	None Detected
Material Type		Quantity		Type	N/A)
Lagging		160 l/m		Sample No	06/B/8026/51
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Olave Queens Ward Sectional Lagging to undercroft pipework debris		Asbestos Yes
Material Type Lagging		Quantity Ward footprint approx 750m ²		Type Amosite (Brown) Chrysotile (White)
				Sample No 06/B/8026/52
				Survey Date 24.04 - 29.06.06
				Date of Report 18.08.06
				Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Olave Queens Ward – Undercroft – Sectional Pipe Lagging		Asbestos Type	Yes Amosite (Brown) Chrysotile (White)
Material Type	Lagging	Quantity	160 l/m	Sample No	06/B/8026/53
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph




SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Olave Queens Ward Green Floor Tile In Second Room	Asbestos	Yes, Backing only
			Type	Chrysotile (White) Backing only
Material Type Vinyl & Backing	Quantity 60m ²	Sample No		06/B/8026/54
		Survey Date		24.04 - 29.06.06
		Date of Report		18.08.06
		Surveyor(s)		[REDACTED]


Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Olave Queens Ward Crimson Floor Tile		Asbestos	No Asbestos Detected
Material Type Vinyl		Quantity 12m ²		Type	N/A
				Sample No	06/B/8026/55
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph

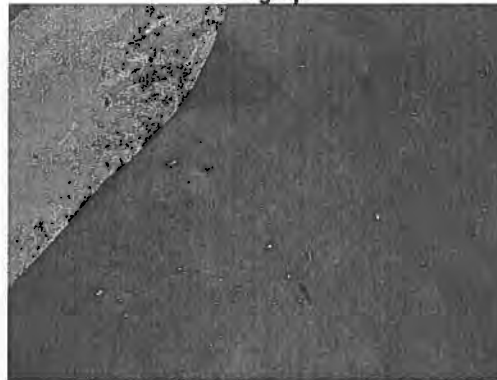

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Olave / Queens Ward central ward open area floor hatch to undercroft debris / pipes underneath -Strongly presumed throughout under footprint	Asbestos Yes, Strongly presumed Type Amosite (Brown) Chrysotile (White)
Material Type Lagging	Quantity 90l/m	Sample No As 06/B/8026/52 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulson, Surrey, CR5 3ES		Position of Sample/Photo Olave Queens Ward, Ground Floor Shires Toilet Cistern		Asbestos	No Asbestos Detected
Material Type Plastic		Quantity 1m ²		Type	N/A
				Sample No	06/B/8026/56
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Olave Queens Ward, Main Ward Room Light Brown Floor Tile		Asbestos	No Asbestos Detected
Material Type Vinyl		Quantity 120m ²		Type	N/A
				Sample No	06/B/8026/57
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Olave/Queens Ward Throughout Ward and presumed throughout site – Rawl plugs to metal rising pipe sheaths and metal grid heater covers in segregation rooms	Asbestos Type	Yes, Strongly presumed Chrysotile (White)
Material Type Rope	Quantity 2cm ² Each sheath approx 8 plugs	Sample No As 06/B/8026/85 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Olave Queens Ward Sun Room/Verandah Rope to skylight		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type	Rope	Quantity	300l/m	Sample No	As 06/B/8026/31
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Olave Queens Ward W.C Cistern (X12)	Asbestos Type	Yes, Strongly Presumed Amosite (Brown)
Material Type	Plastic	Quantity	<1m ²	Sample No As 06/B/8026/5 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Olave Queens Ward Ground Floor Kitchen adjacent corridor Rope to lower pipe		Asbestos Yes
Material Type Rope		Quantity 3m		Type Chrysotile (White)
				Sample No 06/B/8026/58
				Survey Date 24.04 - 29.06.06
				Date of Report 18.08.06
				Surveyor(s) [REDACTED]


Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Olave Queens Ward Ground Floor Kitchen adjacent corridor Rope Cloth to upper pipe		Asbestos Yes
Material Type Rope Lagging		Quantity 1m		Type Chrysotile (White)
				Sample No 06/B/8026/59
				Survey Date 24.04 - 29.06.06
				Date of Report 18.08.06
				Surveyor(s) [REDACTED]

Photograph

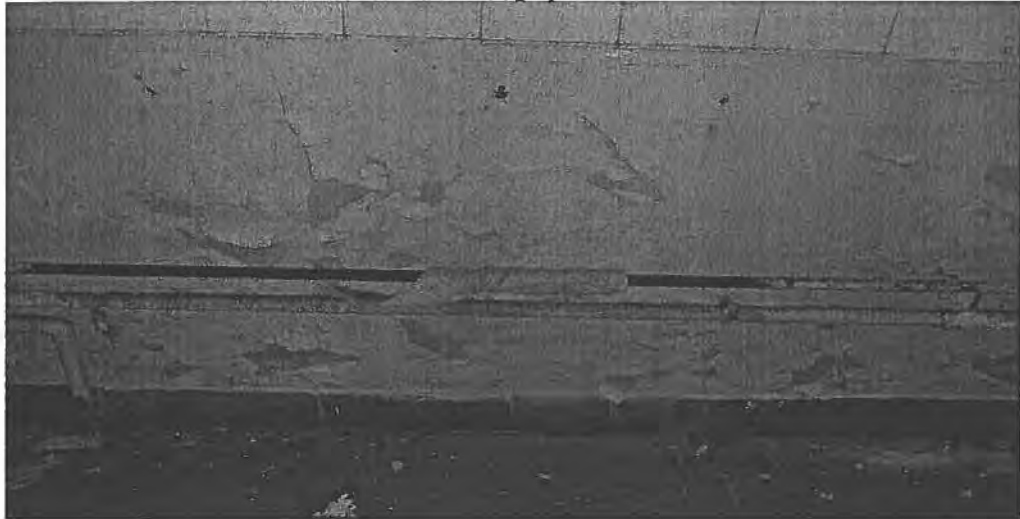

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Olave Queens Ward Corridor adjacent stairs Low level foil corrugated paper pipe lagging		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type	Paper	Quantity	1m ²	Sample No	As 06/B/8026/50
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	


Photograph




SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Olive Queens Ward Corridor adjacent stairs Wall electrics	Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type Rope	Quantity <1m ²	Sample No As 06/B/8026/22 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]	

Photograph

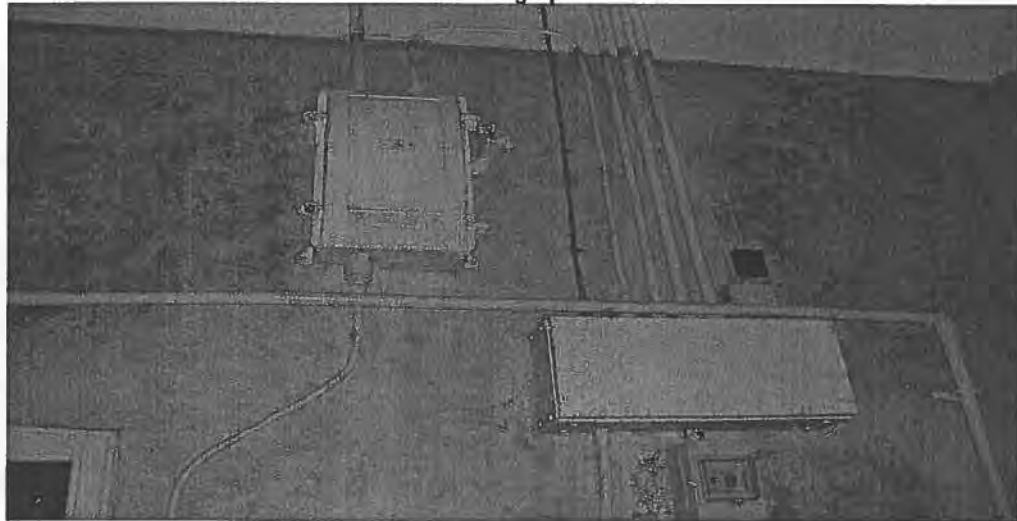

SURVEY INFORMATION SHEET

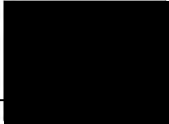Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Olave Queens Ward WC adjacent ward Bunny Boiler Flue pipe (& internal panels)	Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type	Cement	Quantity	1m ²	Sample No As 06/B/8026/109
				Survey Date 24.04 – 29.06.06
				Date of Report 18.08.06
				Surveyor(s) 

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Olave Queens Ward Rawl Plugs to pipe protection (presumed throughout)	Asbestos Yes Type Amosite (Brown) Chrysotile (White)
Material Type Board	Quantity <1m ²	Sample No 06/B/8026/65 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]	


Photograph




SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulson, Surrey, CR5 3ES		Position of Sample/Photo Olave Queens Ward Heater bitumen pad		Asbestos	No Asbestos Detected
Material Type Bitumen		Quantity <1m ²		Type	N/A
				Sample No	06/B/8026/68
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph

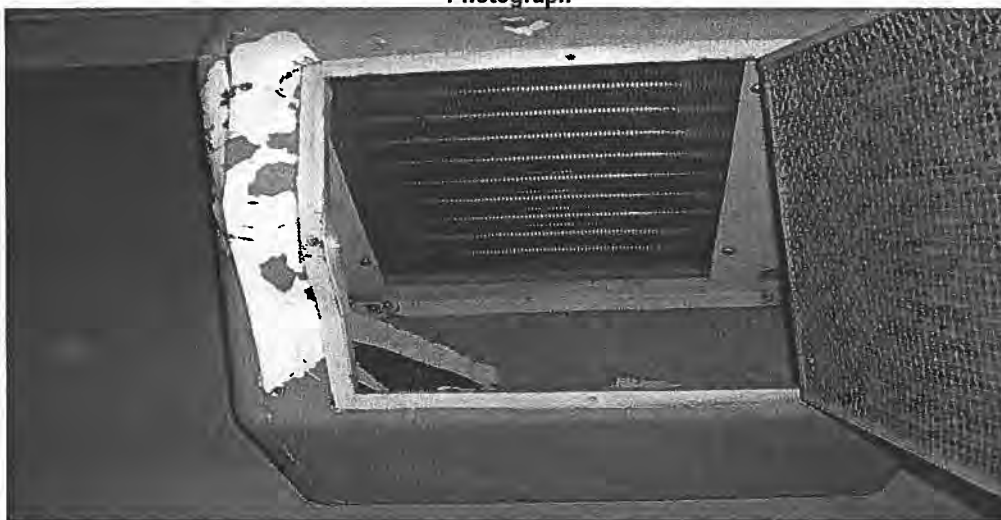

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Olave Queens Ward Undercroft Stores Sink pads		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type	Bitumen	Quantity	<1m ²	Sample No	As 06/B/8026/64
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Olave Queens Ward Undercroft Stores Cisterns (X18)	Asbestos Type	Yes, Strongly Presumed Amosite (Brown)
Material Type	Plastic	Quantity	1m ² each	Sample No Survey Date Date of Report Surveyor(s)
				As 06/B/8026/5 24.04 - 29.06.06 18.08.06 [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Olave Queens Ward Undercroft Stores Rope		Asbestos	No Asbestos Detected
Material Type Rope		Quantity 1m ²		Type	N/A
				Sample No	06/B/8026/66
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	


Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulson, Surrey, CR5 3ES		Position of Sample/Photo Olave Queens Ward Undercroft Stores Gaskets		Asbestos	No Asbestos Detected
Material Type Gasket		Quantity <1m each (20-100 gaskets some in boxes)		Type	N/A
				Sample No	06/B/8026/67
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph

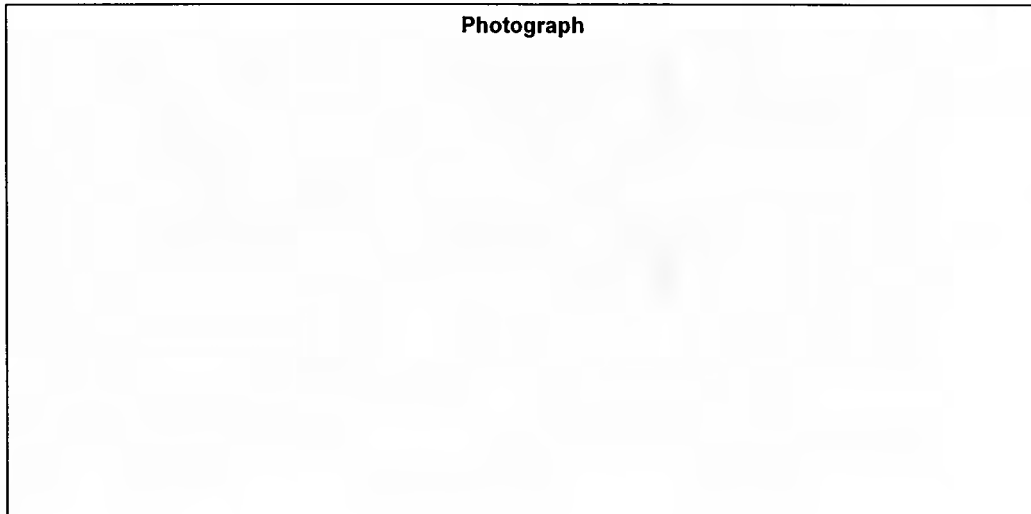

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Olive Queens Ward Undercroft Stores Redundant panels	Asbestos Yes, Strongly Presumed Type Chrysotile (White) Amosite (Brown)	
Material Type Board	Quantity 1m ²	Sample No As 06/B/8026/24 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]	

Photograph



SURVEY INFORMATION SHEET

Location of Survey		Position of Sample/Photo	Asbestos	Yes, Strongly Presumed
Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Olave Queens Ward Undercroft Stores Lagging debris (presumed throughout)	Type	Amosite (Brown) Chysotile (White)
Material Type	Lagging	Quantity <1m ²	Sample No	As 06/B/8026/52
			Survey Date	24.04 - 29.06.06
			Date of Report	18.08.06
			Surveyor(s)	

Photograph




SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Olave Queens Ward Undercroft Stores Lagging debris (presumed throughout)		Asbestos	Yes, Strongly Presumed
				Type	Amosite (Brown) Chrysotile (White)
Material Type	Lagging	Quantity	<1m ²	Sample No	As 06/B/8026/52
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	[REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Olave Queens Ward External flue pipe		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type Cement		Quantity 8m	Sample No As 06/B/8026/154		
			Survey Date 24.04 - 29.06.06		
			Date of Report 18.08.06		
			Surveyor(s) 		

Photograph



SURVEY INFORMATION SHEET

Browning Blake Ward

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Browning Blake Ward External flue & cowl		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type	Cement	Quantity	1m ²	Sample No	As 06/B/8026/154
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Browning Blake Ward Room adjacent sun room Flue pipe		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Cement Type		Quantity 3m		Sample No	As 06/B/8026/154
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey		Position of Sample/Photo		Asbestos	No Asbestos Detected
Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Browning Blake Ward Sun Room Pink Floor Tile		Type	N/A
Material Type	Vinyl	Quantity	20m ²	Sample No	06/B/8026/60
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulson, Surrey, CR5 3ES		Position of Sample/Photo Browning Blake Ward Female Ward Undercroft Pipe Lagging Debris (presumed throughout)		Asbestos Type	Yes, Strongly Presumed Chrysotile (White) Amosite (Brown)
Material Type Lagging		Quantity <1m ²		Sample No	As 06/B/8026/52
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Browning Blake Ward End Ward Undercroft Pipe Lagging Debris (presumed throughout)		Asbestos	Yes, Strongly Presumed
Material Type		Quantity		Type	Chrysotile (White) Amosite (Brown)
Lagging		<1m ²		Sample No	AS 06/B/8026/52
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Browning Blake Ward Room adjacent end ward Panel behind radiator (X2)		Asbestos Yes
Material Type Cement		Quantity 2m ²		Type Chrysotile (White)
				Sample No 06/B/8026/61
				Survey Date 24.04 - 29.06.06
				Date of Report 18.08.06
				Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Browning Blake Ward Office adjacent ward Ironing Board Pad		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type	Cement	Quantity	<1m ²	Sample No	As 06/B/8026/20
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Browning Blake Ward Kitchen adjacent corridor Sink Paint		Asbestos Type	None Detected N/A
Material Type Bitumen		Quantity 1m ²		Sample No	06/B/8026/62
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Browning Blake Ward Kitchen adjacent corridor Rope to pipe work within wood boxed riser	Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type Rope	Quantity 5m	Sample No Survey Date Date of Report Surveyor(s)	As 06/B/8026/58 24.04 - 29.06.06 18.08.06

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Browning Blake Ward First Floor Grey Floor Tile & Bitumen		Asbestos Yes
Material Type Vinyl & Bitumen		Quantity 15m ²		Type Chrysotile (White)
				Sample No 06/B/8026/63
				Survey Date 24.04 - 29.06.06
				Date of Report 18.08.06
				Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Browning Blake Ward First Floor Kitchen Sink Pad		Asbestos Yes
Material Type Bitumen		Quantity <1m ²		Type Chrysotile (White)
				Sample No 06/B/8026/64
				Survey Date 24.04 - 29.06.06
				Date of Report 18.08.06
				Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulson, Surrey, CR5 3ES		Position of Sample/Photo Browning Blake Ward First floor WC adjacent corridor from stairs Flue pipe		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type Cement		Quantity 5m		Sample No	As 06/B/8026/154
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Browning Blake Ward External Store Corrugated Roof sheet & Side Panels		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type	Cement	Quantity	80m ²	Sample No	As 06/B/8026/126
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Browning/Blake Ward Undercroft debris	Asbestos Type	No Asbestos Detected N/A
Material Type	Debris	Quantity	1m ²	Sample No 06/B/8026/79 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Plant Room adjacent Reception Building

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Calorifier Room adjacent Reception Building Blue Pipe Lagging	Asbestos Yes Type Amosite (Brown)
Material Type Lagging	Quantity 140m	Sample No 06/B/8026/69 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey		Position of Sample/Photo	Asbestos	Yes, Strongly Presumed	
Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Calorifier Room adjacent Reception Building Large Tanks (X2)	Type	Amosite (Brown)	
Material Type	Lagging	Quantity	24m ²	Sample No	As 06/B/8026/69
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Calorifier Room adjacent Reception Building Floor Debris (presumed throughout)	Asbestos Yes
Material Type Lagging		Quantity <1m ²	Type Amosite (Brown)
			Sample No 06/B/8026/70
			Survey Date 24.04 - 29.06.06
			Date of Report 18.08.06
			Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulson, Surrey, CR5 3ES		Position of Sample/Photo Calorifier Room adjacent Reception Building Gaskets & Crane Valves (presumed throughout site)	Asbestos Yes
Material Type Gasket		Quantity 1m ²	Type Chrysotile (White)
			Sample No 06/B/8026/71
			Survey Date 24.04 - 29.06.06
			Date of Report 18.08.06
			Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Calorifier Room adjacent Reception Building Gaiter (X2)		Asbestos Yes
				Type Amosite (Brown) Chrysotile (White)
Material Type Rope	Quantity 1.5m ²	Sample No 06/B/8026/72		
		Survey Date 24.04 - 29.06.06		
		Date of Report 18.08.06		
		Surveyor(s) [REDACTED]		

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Calorifier Room adjacent Reception Building Red Pipe Lagging	Asbestos Yes
Material Type Lagging		Quantity 20m	Type Amosite (Brown) Chrysotile (White)
			Sample No 06/B/8026/73
			Survey Date 24.04 - 29.06.06
			Date of Report 18.08.06
			Surveyor(s) [REDACTED]


Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Calorifier Room adjacent Reception Building Small Blue Tank Lagging	<table style="width: 100%;"> <tr> <td style="width: 30%;">Asbestos</td> <td>Yes</td> </tr> <tr> <td>Type</td> <td>Amosite (Brown) Chrysotile (White)</td> </tr> </table>	Asbestos	Yes	Type	Amosite (Brown) Chrysotile (White)				
Asbestos	Yes									
Type	Amosite (Brown) Chrysotile (White)									
Material Type Lagging	Quantity 12m ²	<table style="width: 100%;"> <tr> <td style="width: 30%;">Sample No</td> <td>06/B/8026/74</td> </tr> <tr> <td>Survey Date</td> <td>24.04 - 29.06.06</td> </tr> <tr> <td>Date of Report</td> <td>18.08.06</td> </tr> <tr> <td>Surveyor(s)</td> <td style="background-color: black; color: black;">[REDACTED]</td> </tr> </table>	Sample No	06/B/8026/74	Survey Date	24.04 - 29.06.06	Date of Report	18.08.06	Surveyor(s)	[REDACTED]
Sample No	06/B/8026/74									
Survey Date	24.04 - 29.06.06									
Date of Report	18.08.06									
Surveyor(s)	[REDACTED]									

Photograph

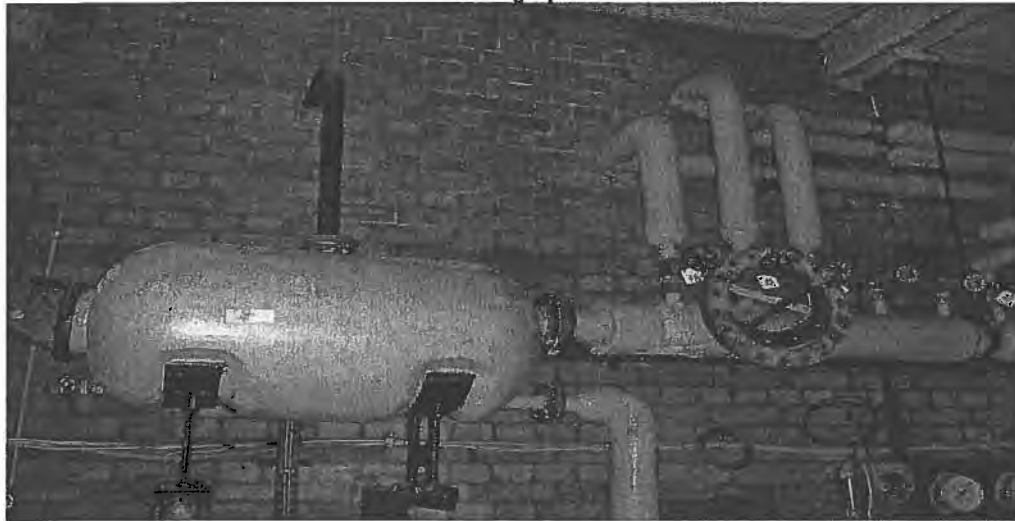

SURVEY INFORMATION SHEET

Corridors

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES	Position of Sample/Photo Corridor adjacent Olave Queens Ward running parallel to Chapel WC Cistern	Asbestos Yes, Strongly Presumed Type Amosite (Brown)
Material Type Plastic	Quantity 1m ²	Sample No As 06/B/8026/5 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Corridor adjacent Olave Queens Ward running parallel to Chapel Skylight Rope Seals	Asbestos Yes, Strongly Presumed	Type Chrysotile (White)
Material Type Rope	Quantity 10m	Sample No As 06/B/8026/31 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) 	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Hall/Chapel Corridor Door adjacent corridor to Olave Queens Ward Internal Panel	Asbestos Yes Type Chrysotile (White)
Material Type Cement	Quantity 2m ²	Sample No 06/B/8026/75 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Hall/Chapel Corridor Offices adjacent corridor to Olive Queens Ward	Asbestos Type	No Asbestos Detected N/A
Material Type Lagging	Quantity 10m	Sample No 06/B/8026/76 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulson, Surrey, CR5 3ES		Position of Sample/Photo Hall/Chapel Corridor Lobby to corridor to Olave Queens Ward Undercroft Pipe lagging	Asbestos Yes
Material Type Paper		Quantity 1m ²	Type Chrysotile (White)
			Sample No 06/B/8026/77
			Survey Date 24.04 - 29.06.06
			Date of Report 18.08.06
			Surveyor(s) [REDACTED]


Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Hall/Chapel Corridor End Office adj Pugin Paxton Office Riser Panel	Asbestos Yes / Type Amosite (Brown)
Material Board Type	Quantity 1m ²	Sample No 06/B/8026/78 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph

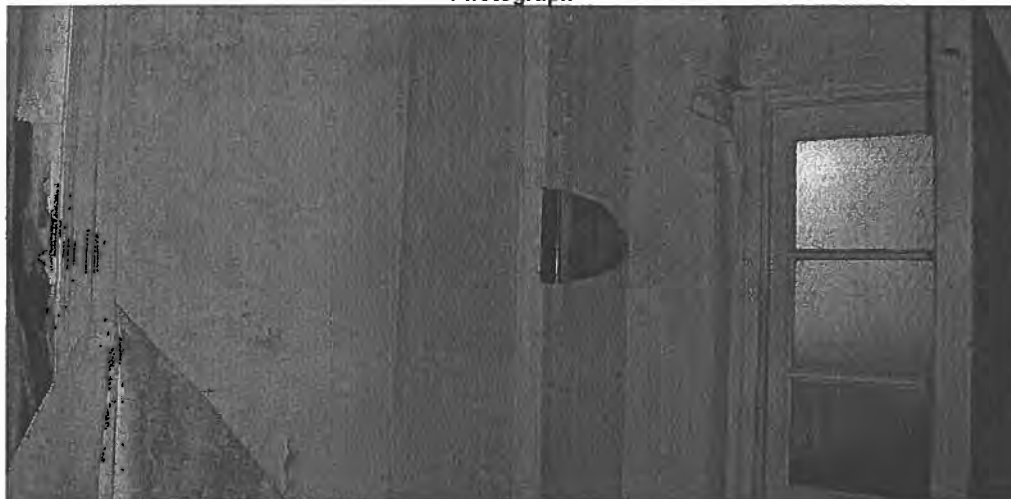

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Hall/Chapel Corridor End Office adj Pugin Paxton Electrics Rope Seal		Asbestos	Yes, Strongly Presumed
Material Type Rope		Quantity 1m		Type	Chrysotile (White)
				Sample No	As 06/B/8026/22
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	


Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Hall/Chapel Corridor Office Electrics Rope seal	Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type Rope	Quantity 1m	Sample No As 06/B/8026/22 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]	


Photograph

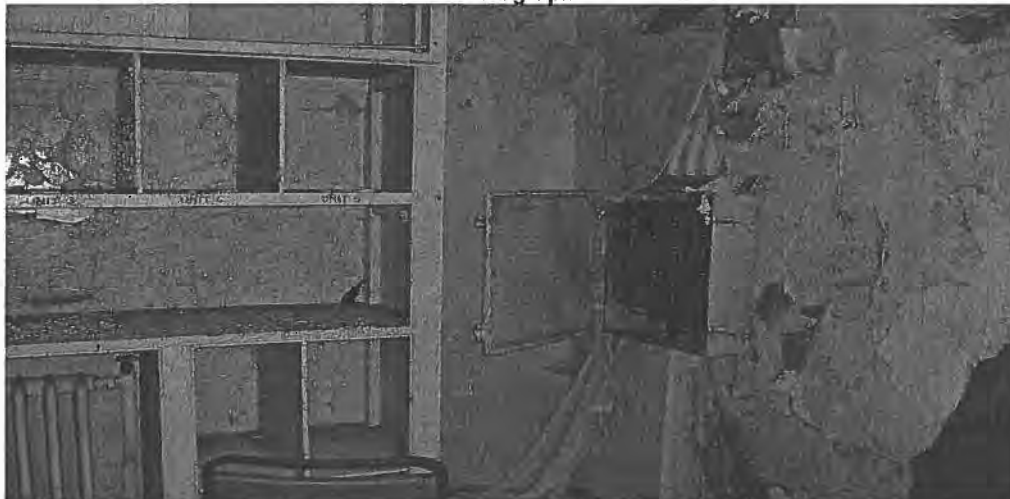

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Hall/Chapel Corridor Offices adjacent corridor to Olave Queens skylight	Asbestos Yes, Strongly Presumed Type Chrysotile (White)
Material Type Rope	Quantity 10m	Sample No As 06/B8026/31 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph

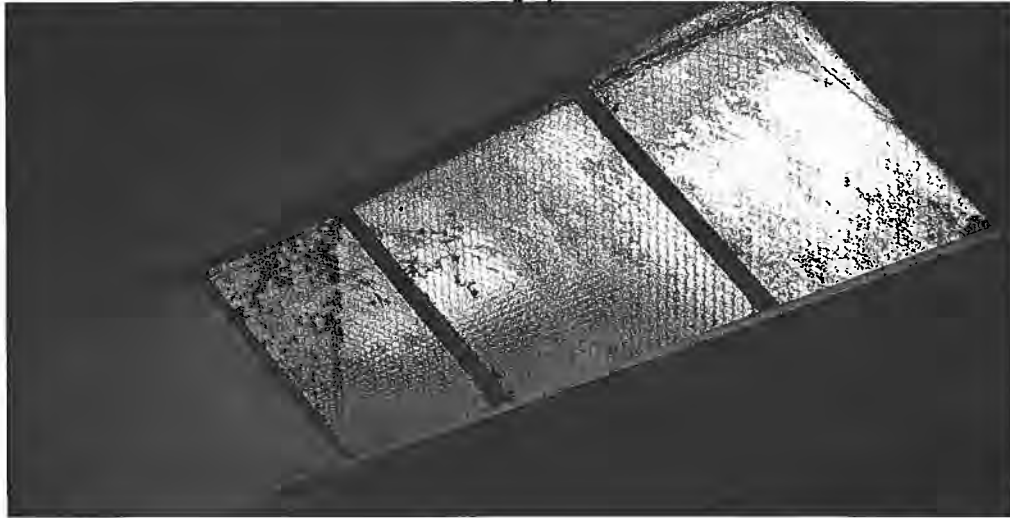

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Hall/Chapel Corridor Lobby Electrics to corridor to Browning Blake Ward Rope seal	Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type Rope	Quantity 1m	Sample No Survey Date Date of Report Surveyor(s)	As 06/B/8026/22 24.04 - 29.06.06 18.08.06

Photograph



SURVEY INFORMATION SHEET



Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES	Position of Sample/Photo Hall/Chapel Corridor Lobby Electrics to corridor to Browning Blake Ward Flashguards	Asbestos Yes, Strongly Presumed Type Chrysotile (White)
Material Type Rope	Quantity 1m	Sample No As 06/B/8026/9 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulson, Surrey, CR5 3ES		Position of Sample/Photo Hall/Chapel Corridor Kitchen adjacent Andrewes Alley Ward, Sink Paint		Asbestos	Strongly Presumed
Material Type Bitumen		Quantity 1m ²		Type	Chrysotile (White)
				Sample No	As 06/B/8026/157
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

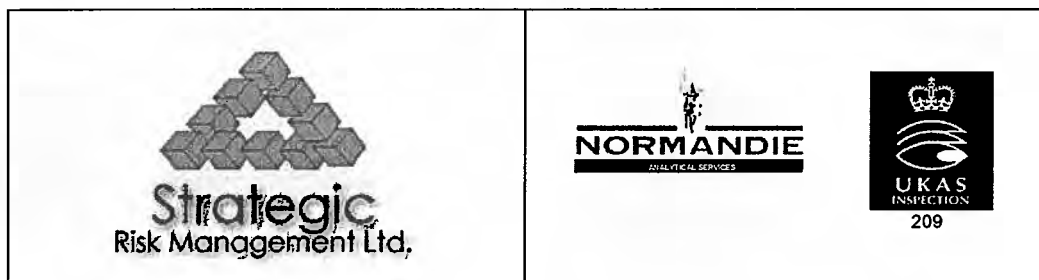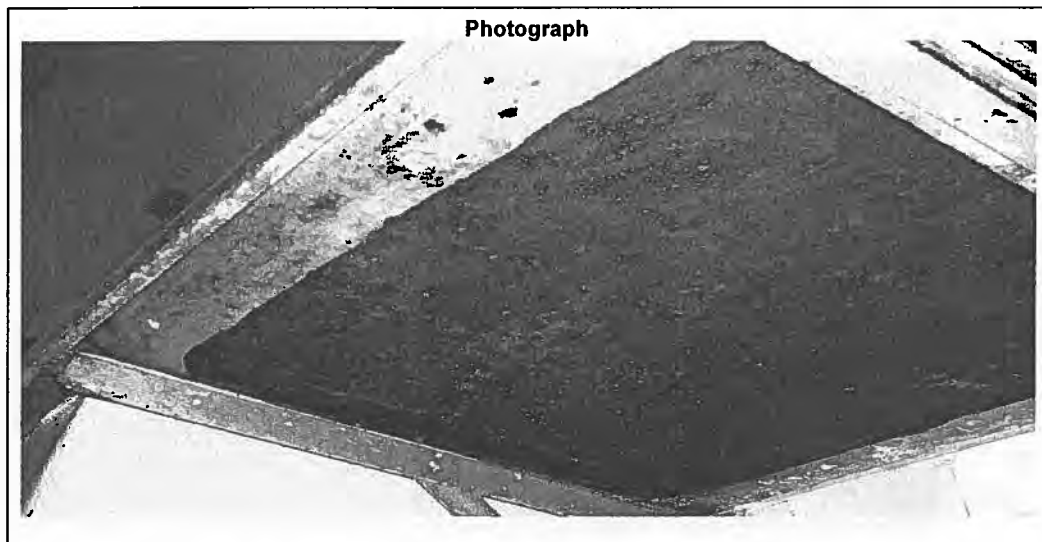

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Hall/Chapel Corridor Lobby adjacent Andrewes Alleyn Ward Wall electrics		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type	Rope	Quantity	1m	Sample No	As 06/B/8026/9
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Andrewes/Alleyn Ward

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES	Position of Sample/Photo Store room adjacent Andrewes Alleyn Ward Ironing Board Pad	Asbestos Yes, Strongly Presumed Type Chrysotile (White)
Material Cement Type	Quantity <1m ²	Sample No As 06/B/8026/20 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]


Photograph



SURVEY INFORMATION SHEET

Location of Survey		Position of Sample/Photo		Asbestos	No Asbestos Detected
Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Andrewes Alleyn Ward Undercroft debris		Type	N/A
Material Type	Debris	Quantity	1m ²	Sample No	06/B/8026/80
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	


Photograph

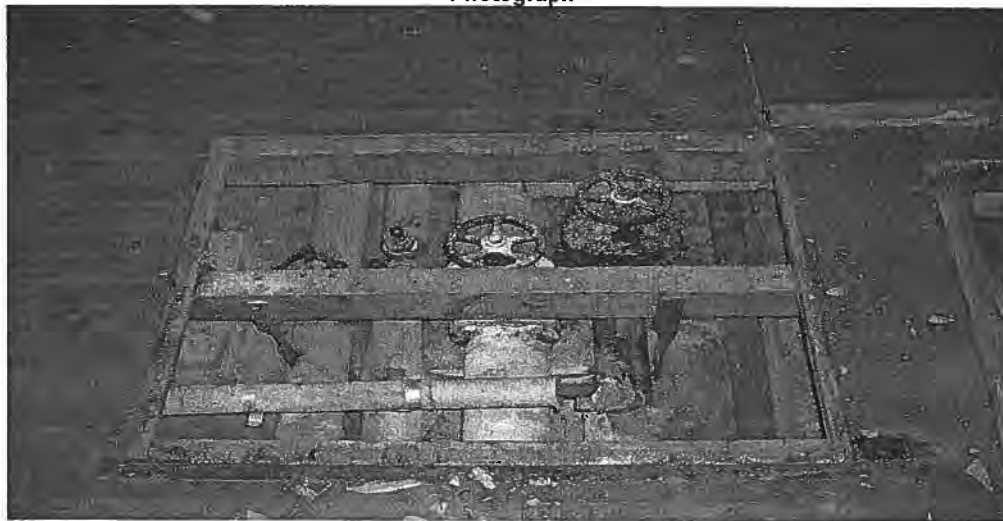

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulson, Surrey, CR5 3ES		Position of Sample/Photo Andrewes Alleyn Ward Medication room Sink Paint		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type	Bitumen	Quantity	1m ²	Sample No	As 06/B/8026/157
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	


Photograph

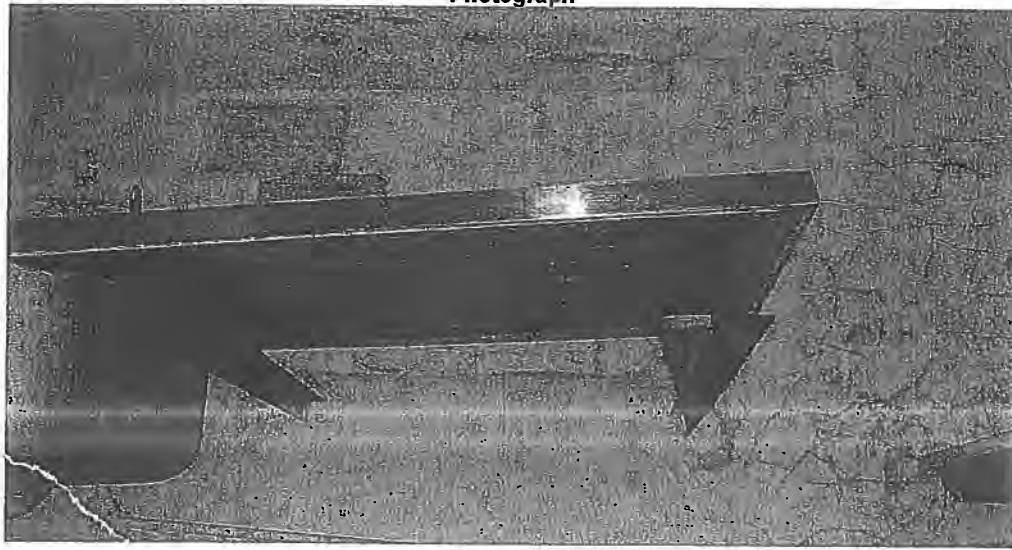

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Andrewes Alleyn Ward Sun Room Rope to skylight		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type	Rope	Quantity	200m	Sample No	As 06/B/8026/31
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph

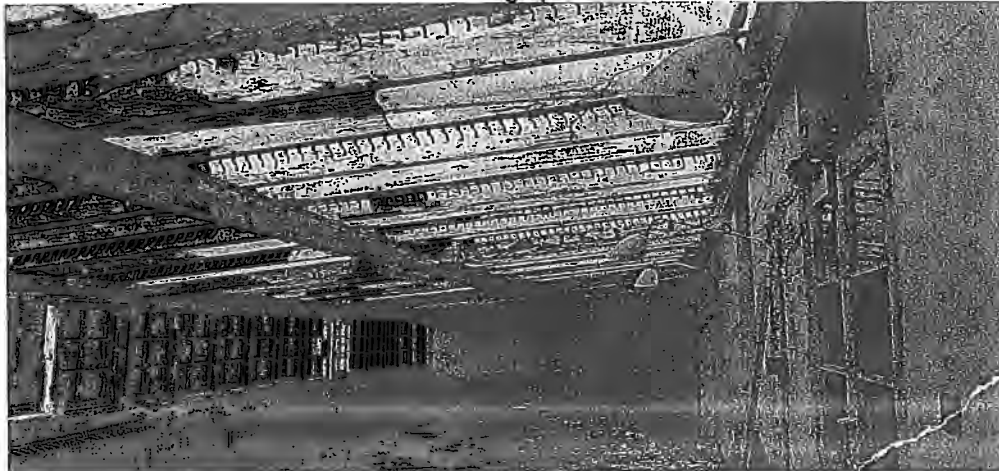

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Andrewes Alleyn Ward Ceiling		Asbestos	No Asbestos Detected
Material Type Plaster		Quantity 100m ²		Type	N/A
				Sample No	06/B/8026/81
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



209

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Andrewes Alleyn Ward Rawl plugs to metal protection to wall pipes (presumed throughout)		Asbestos Type	Yes, Strongly Presumed Amosite (Brown)
Material Type	Board	Quantity	<1m ²	Sample No	As 06/B/8026/65
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	


Photograph




SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Andrewes Alleyn Ward First Floor kitchen Sink Paint	Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type Bitumen	Quantity 1m ²	Sample No As 06/B/8026/157 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]	


Photograph

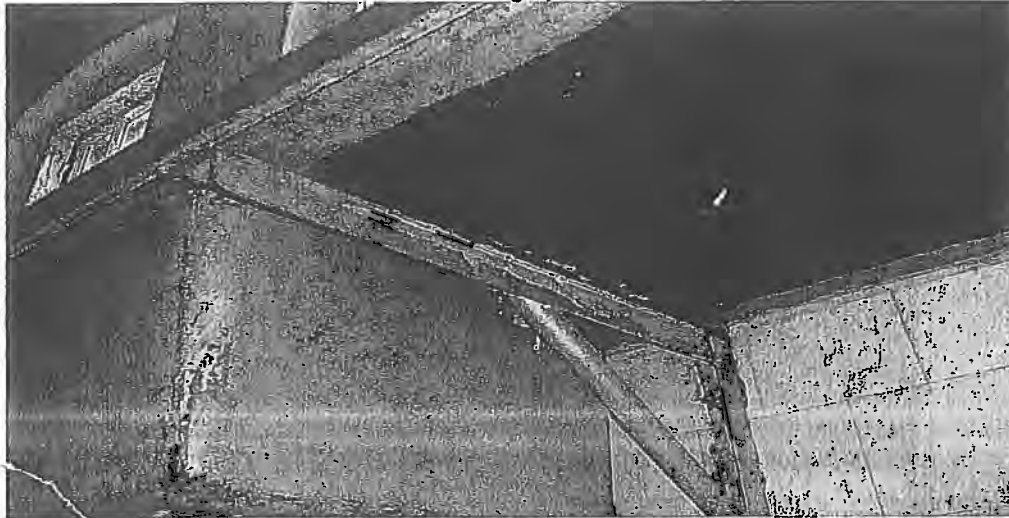


SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Andrewes Alleyn Ward WC floor vinyl		Asbestos Type	No Asbestos Detected N/A
Material Type	Vinyl	Quantity	10m ²	Sample No	06/B/8026/82
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	


Photograph

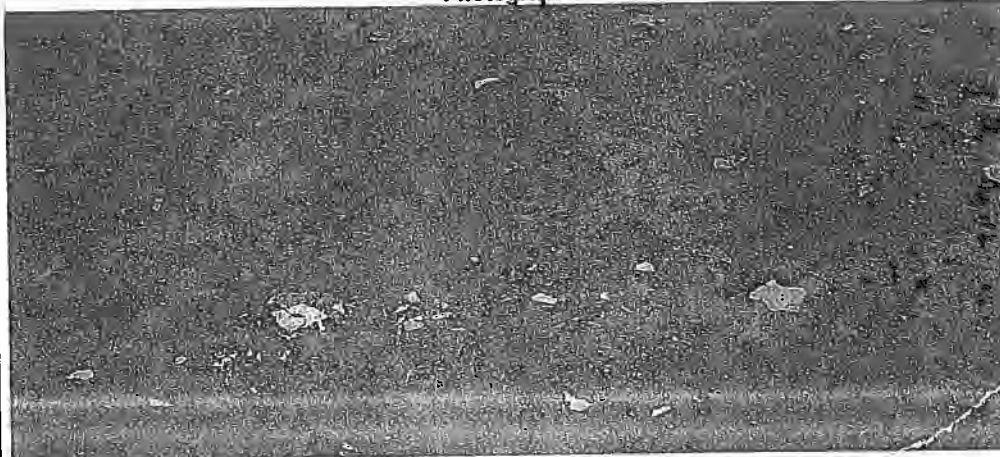

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Andrewes Alleyn Ward First Floor Vinyl		Asbestos Type	No Asbestos Detected N/A
Material Type	Vinyl	Quantity	1m ²	Sample No	06/B/8026/83
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	


Photograph

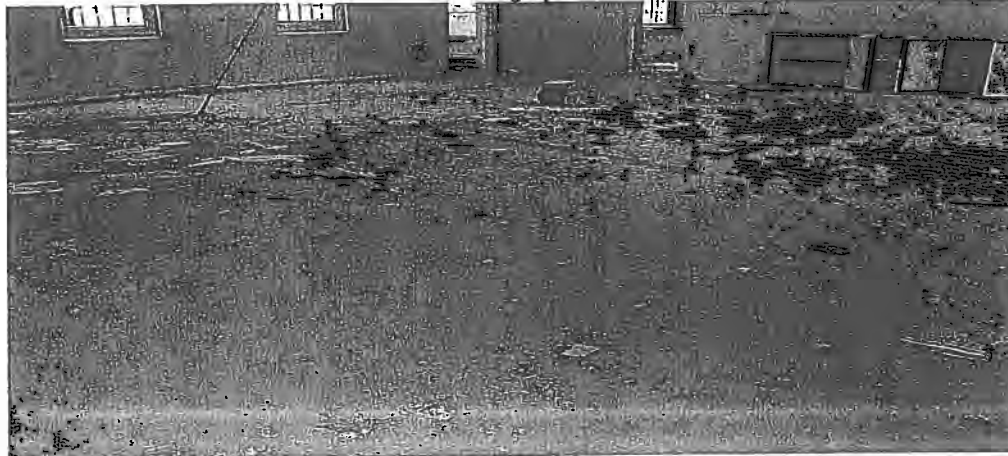

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Rear corridor adjacent Andrewes Alleyn Ward Room adjacent locker room Radiator shelf panel	Asbestos Type	Yes, Strongly Presumed Amosite (Brown)
Material Type	Board	Quantity	1m ²	Sample No As 06/B/8026/24 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph

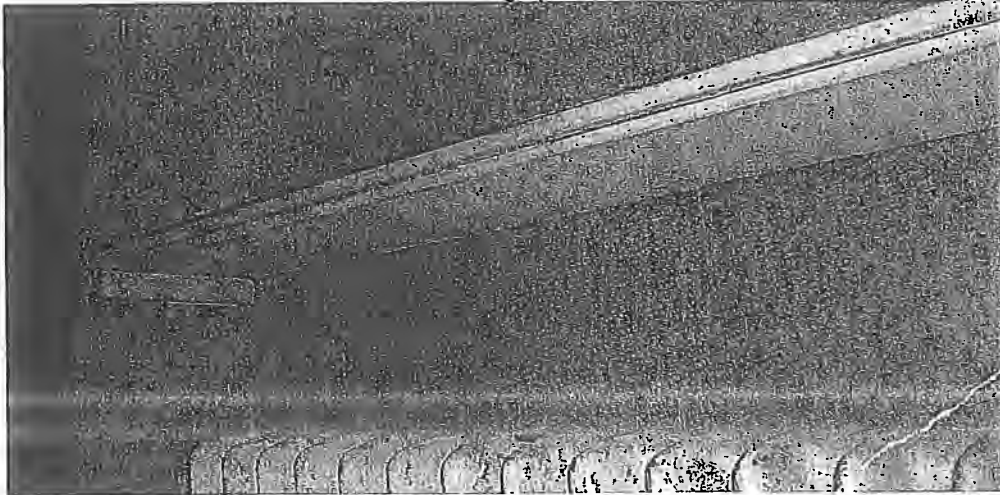


SURVEY INFORMATION SHEET

Pugin/Paxton Ward

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES	Position of Sample/Photo Corridor Room Adjacent Pugin/Paxton, Cupboard Adjacent Fireplace, Radiator Panel	Asbestos Yes Type Chrysotile (White)
Material Board Type	Quantity 0.5m ²	Sample No 06/B/8026/84 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph

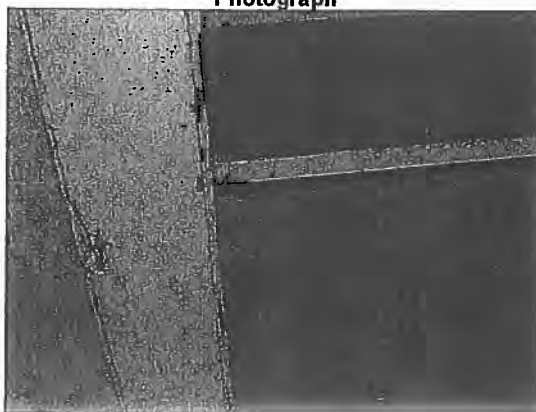

209

SURVEY INFORMATION SHEET

Location of Survey		Position of Sample/Photo		Asbestos	Yes Strongly presumed
Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Pugin/Paxton Ward, Ground floor Toilet off 1 st ward – Shires Lynx WC cistern (X1)		Type	Amosite (Brown)
Material	Plastic	Quantity	1m ²	Sample No	As 06/B/8026/5
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Pugin/Paxton Ward, Throughout ward and presumed throughout site – Rawl plugs to metal rising pipe sheaths and metal grid heater covers in segregation rooms	Asbestos Yes	Type Chrysotile (White)
Material Type Rope	Quantity 2cm ² Each Each sheath approx 8 plugs	Sample No 06/B/8026/85 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]	

Photograph




SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Pugin/Paxton Ward, Rope to switchboards		Asbestos Type	Yes Strongly presumed Chrysotile (White)
Material Type Rope		Quantity 1m ²		Sample No	As 06/B/8026/22
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	


Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Pugin/Paxton Ward, Ground W.C. Ceiling Tiles		Asbestos Type	No Asbestos Detected N/A
Material Type	Board	Quantity	12m ²	Sample No	06/B/8026/86
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph

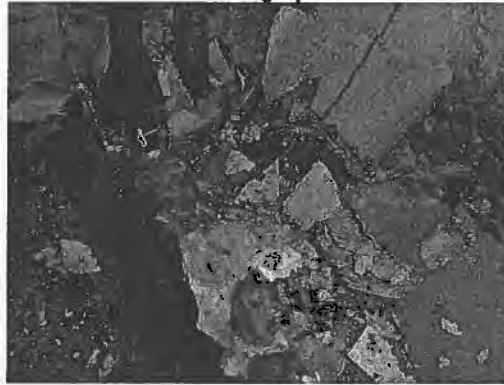

SURVEY INFORMATION SHEET

Location of Survey		Position of Sample/Photo		Asbestos	No Asbestos Detected
Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Pugin / Paxton Ward Ground Floor, Shires Toilet Cistern		Type	N/A
Material Type	Plastic	Quantity	1m ²	Sample No	06/B/8026/87
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	


Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Pugin/Paxton Ward, Shires Lynx WC's cisterns throughout		Asbestos	Yes Strongly presumed
				Type	Amosite (Brown)
Material Type	Plastic	Quantity	1m ² Each	Sample No	As 06/B/8026/5
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	[REDACTED]

Photograph

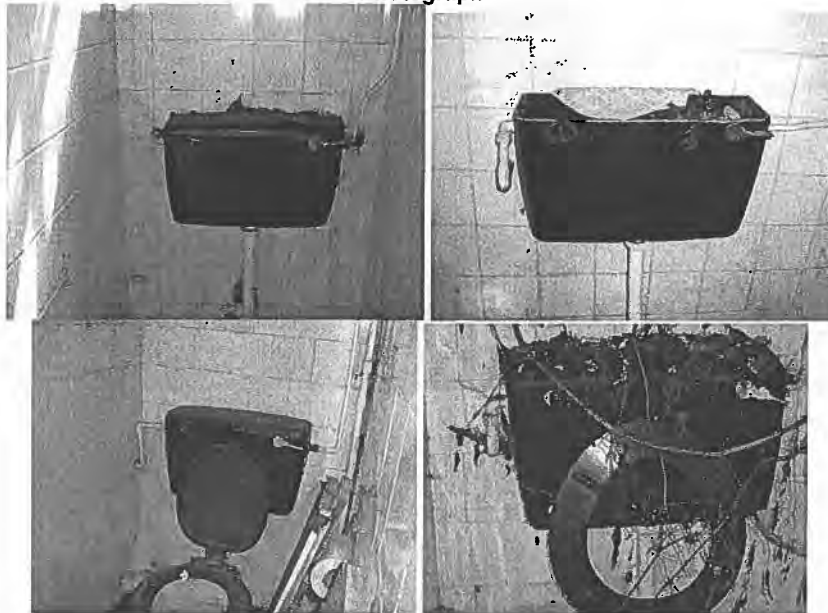

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Pugin/Paxton Ward, Redundant ironing board pad	Asbestos Type	Yes Strongly presumed Chrysotile (White)
Material Type	Cement	Quantity	0.25m ²	Sample No As 06/B/8026/20 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph




SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Pugin / Paxton Ward, 1 st & 2 nd floor kitchen sinks and drainers Sink paint		Asbestos Type	Strongly Presumed Chrysotile (White)
Material Type Bitumen		Quantity 1m ² each sink		Sample No	As 06/B/8026/157
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph




SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Pugin/Paxton Ward First Floor Kitchen, Pipe Cloth Wrap		Asbestos Type	Yes Chrysotile (White)
Material Type Cloth		Quantity 3m ²		Sample No Survey Date Date of Report Surveyor(s)	06/B/8026/88 24.04 - 29.06.06 18.08.06 

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Pugin/Paxton Ward, First Floor Kitchen, Pipe Cloth Wrap debris on floor		Asbestos Type	Yes Strongly presumed Chrysotile (White)
Material Type	Cloth	Quantity	1m ²	Sample No	As 06/B/8026/88
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Pugin/Paxton Ward, First Floor, Corner Office Floor Vinyl		Asbestos	No Asbestos Detected
Material Type Vinyl		Quantity 9m ²		Type	N/A
				Sample No	06/B/8026/89
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Pugin/Paxton Ward, 2nd Floor Kitchen, Pipe Cloth Wrap (strongly presumed within riser between floors to each kitchen and pipe work in each kitchen Under MMMF lagging)	Asbestos Type	Yes Strongly Presumed Chrysotile (White)
Material Type Cloth	Quantity 4m ²	Sample No Survey Date Date of Report Surveyor(s)	As 06/B/8026/88 24.04 - 29.06.06 18.08.06

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Corridor Adjacent Pugin/Paxton Ward, Wall		Asbestos	No Asbestos Detected
Material Type Textured Coating		Quantity 90m ²		Type	N/A
				Sample No	06/B/8026/90
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulson, Surrey, CR5 3ES		Position of Sample/Photo Corridor Adjacent /Rear Pugin/Paxton Ward Light grey Floor Tile		Asbestos	Yes
				Type	Chrysotile (White)
Material Type	Vinyl & Bitumen	Quantity	90m ²	Sample No	06/B/8026/91
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	[REDACTED]

Photograph




SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Corridor Adjacent /Rear Pugin/Paxton Ward Dark grey Floor Tile	Asbestos Yes
Material Type Vinyl & Bitumen		Quantity 10m ²	Type Chrysotile (White)
			Sample No 06/B/8026/92
			Survey Date 24.04 - 29.06.06
			Date of Report 18.08.06
			Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Corridor Adjacent / Rear Pugin/Paxton Ward, Red Floor Tile		Asbestos Type	Yes Chrysotile (White)
Material Type	Vinyl & Bitumen	Quantity	10m ²	Sample No	06/B/8026/93
				Survey Date	24.04 – 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Corridor Adjacent Pugin/Paxton Ceiling		Asbestos	No Asbestos Detected
Material Type Plaster		Quantity <1m ²		Type	N/A
				Sample No	06/B/8026/97
				Survey Date	24.04 – 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Ruskin/Rosseti Ward

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Ruskin/Rosseti Ward Lobby electrics Rope seal	Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type Rope	Quantity 1m	Sample No As 06/B/8026/22 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s)	


Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Ruskin/Rosseti Ward Kitchen Riser panel	Asbestos Yes
Material Board Type		Quantity 1m ²	Type Chrysotile (White)
			Sample No 06/B/8026/94
			Survey Date 24.04 - 29.06.06
			Date of Report 18.08.06
			Surveyor(s) [REDACTED]


Photograph

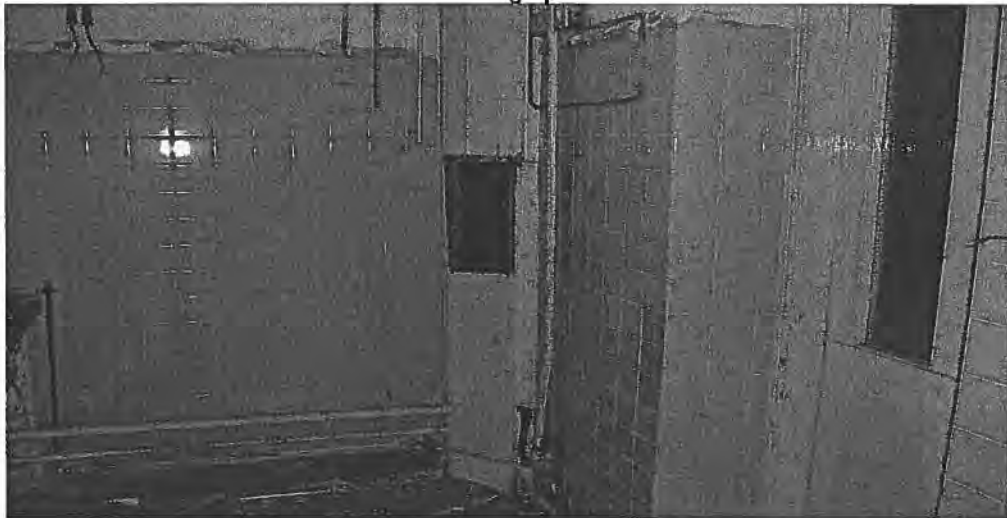

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Ruskin/Rossetti Ward Ground Floor Kitchen Sink Paint		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type	Bitumen	Quantity	1m ²	Sample No	As 06/B/8026/157
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph

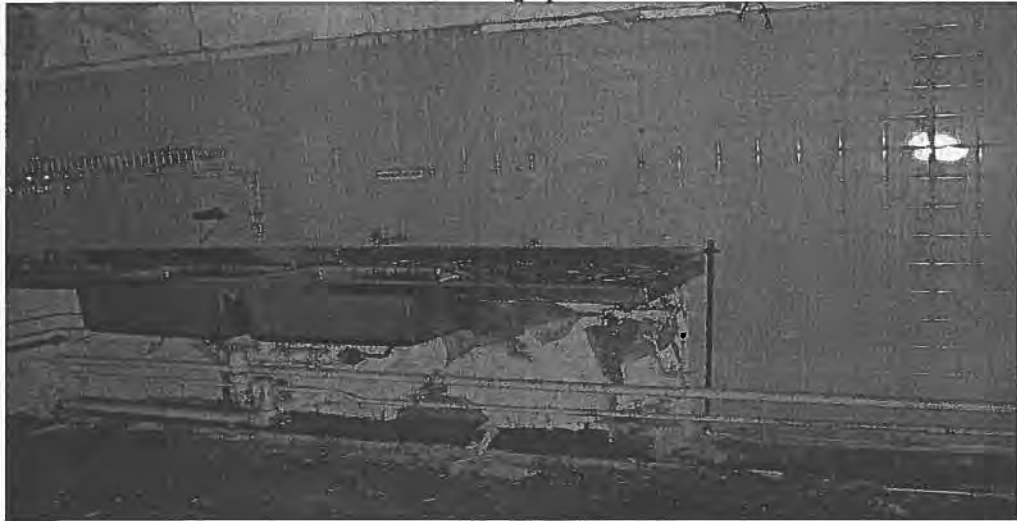

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Ruskin/Rosseti Ward WC, Cistern (X8)		Asbestos Type	Yes, Strongly Presumed Amosite (Brown)
Material Type Plastic		Quantity 1m ²		Sample No	As 06/B/8026/5
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Ruskin/Rossetti Ward First floor kitchen Sink Paint		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type	Bitumen	Quantity	1m ²	Sample No	As 06/B/8026/157
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Ruskin/Rosseti Ward First floor kitchen Rope to Pipe		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type Rope		Quantity <1m		Sample No	As 06/B/8026/58
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Ruskin/Rosseti Ward First floor corridor wall electrics (rope, fuse carrier & shelf)	Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type	Rope & Cement	Quantity	1m ²	Sample No As 06/B/8026/9 & 28 Survey Date 24.04 – 29.06.06 Date of Report 18.08.06 Surveyor(s)

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Ruskin/Rossetti Ward Corridor lobby		Asbestos	No Asbestos Detected
Material Type Bitumen		Quantity 100m ²		Type	N/A
				Sample No	06/B/8026/95
				Survey Date	24.04 – 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Ruskin/Rosseti Ward Undercroft Pipe residue		Asbestos	No Asbestos Detected
Material Type Debris		Quantity <1m ²		Type	N/A
				Sample No	06/B/8026/96
				Survey Date	24.04 – 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Ruskin/Rossetti Ward Loft, AIB debris	Asbestos Yes Type Amosite (Brown) Chrysotile (White)
Material Board Type	Quantity 2m	Sample No 06/B/8026/225 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Ruskin/Rossetti Ward Loft, AIB debris	Asbestos Yes, Strongly Presumed Type Amosite (Brown) Chrysotile (White)
Material Type Board	Quantity <1m	Sample No As 06/B/8026/225 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Ruskin/Rossetti Loft, AIB panel to eaves	Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type	Board	Quantity	1m	Sample No As 06/B/8026/225 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Shaftesbury/Salter Ward

Location of Survey Cane Hill Hospital, Cane Hill, Coulson, Surrey, CR5 3ES		Position of Sample/Photo Corridor Adjacent Shaftesbury/Salter Cream Floor Tile	Asbestos Yes
Material Type Vinyl & Bitumen		Quantity 100m ²	Type Chrysotile (white)
			Sample No 06/B/8026/98
			Survey Date 24.04 - 29.06.06
			Date of Report 18.08.06
			Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Corridor Adjacent Shaftesbury/Salter Light grey Floor Tile		Asbestos	Yes
Material Type Vinyl & Bitumen		Quantity 100m ²		Type	Chrysotile (white)
				Sample No	06/B/8026/99
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Corridor Adjacent Shaftesbury/Salter Black Floor Tile	Asbestos Yes
			Type Chrysotile (white)
Material Type Vinyl & Bitumen	Quantity 100m ²	Sample No 06/B/8026/100	
		Survey Date 24.04 - 29.06.06	
		Date of Report 18.08.06	
		Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Corridor Adjacent Shaftesbury/Salter Red Floor Tile		Asbestos	No Asbestos Detected
Material Type Debris		Quantity <1m ²		Type	N/A
				Sample No	06/B/8026/101
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Shaftesbury/Salter Ward, Undercroft Sectional lagging debris under Main Ward Room		Asbestos	Yes
				Type	Amosite (Brown) Chrysotile (White)
Material Type	Debris	Quantity	50m ² Area	Sample No	06/B/8026/102
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	[REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Shaftesbury/Salter Ward, Ground W.C Lobby Wall Panel	Asbestos Type	Yes Chrysotile (White)
Material Type Cement	Quantity 0.5m ²	Sample No 06/B/8026/103 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Shaftesbury/Salter Ward Throughout ward and presumed throughout site – Rawl plugs to metal rising pipe sheaths and metal grid heater covers in segregation rooms		Asbestos Type	Yes, Strongly presumed Chrysotile (White)
Material Type	Rope	Quantity	2cm ² Each Each sheath approx 8 plugs	Sample No Survey Date Date of Report Surveyor(s)	As 06/B/8026/85 24.04 - 29.06.06 18.08.06 [REDACTED]


Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Shaftesbury/Salter Ward Rope to switchboards (all floors)		Asbestos Type	Strongly Presumed Chrysotile (White)
Material Type Rope		Quantity 1m		Sample No	As 06/B/8026/22
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph

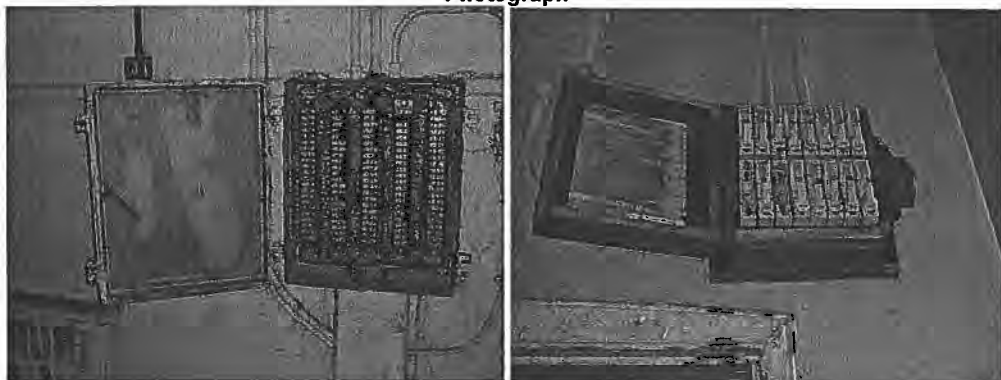

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Shaftesbury/Salter Ward, Sink paint (All kitchen sinks and dariners on each floor.)		Asbestos Type	Strongly Presumed Chrysotile (White)
Material Type	Bitumen	Quantity 1m ² each sink	Sample No	As 06/B/8026/157	
				Survey Date 24.04 - 29.06.06	
				Date of Report 18.08.06	
				Surveyor(s) [REDACTED]	


Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulson, Surrey, CR5 3ES		Position of Sample/Photo Shaftesbury/Salter Ward, Ground Floor Kitchen, Pipe Cloth Wrap debris on floor (also to 2 nd and 3 rd floors)		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type	Rope	Quantity	12m ²	Sample No	As 06/B/8026/88
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph

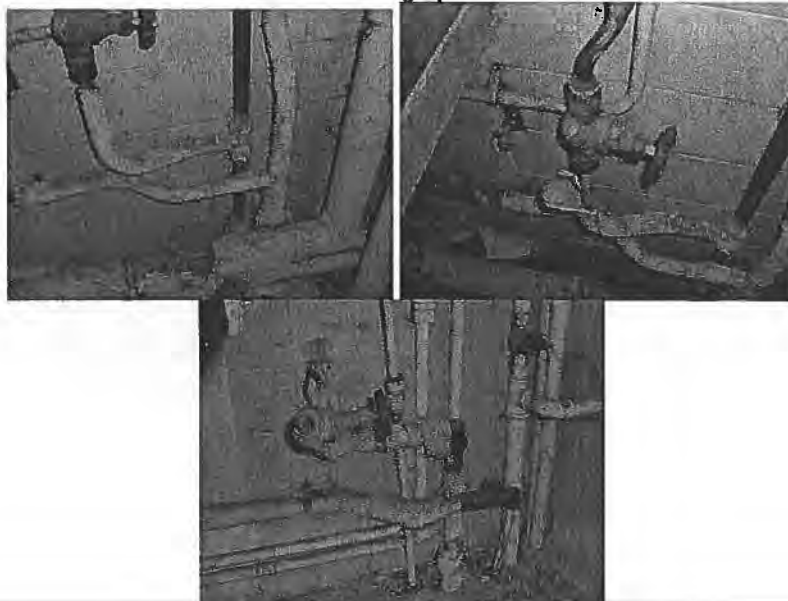

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Shaftesbury/Salter Ward, Shires lynx WC cisterns (approx 4 on all floors)		Asbestos Type	Yes Strongly presumed Amosite (Brown)
Material Type	Plastic	Quantity 1m ² Each		Sample No	As 06/B/8026/5
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph




SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Shaftesbury/Salter Ward, Ground Floor Office Wall Panel behind wood		Asbestos Yes
Material Type Board		Quantity 8m ²		Type Amosite (Brown)
				Sample No 06/B/8026/104
				Survey Date 24.04 - 29.06.06
				Date of Report 18.08.06
				Surveyor(s) [REDACTED]


Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Shaftesbury/Salter Ward Undercroft, Debris Floor void end room		Asbestos	No Asbestos Detected
Material Type Lagging		Quantity 40m ²		Type	N/A
				Sample No	06/B/8026/105
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph

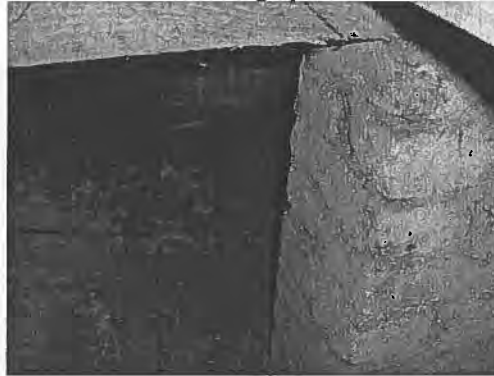

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Shaftesbury/Salter Ward, Fuse Box Shelf On 2 nd and 3 rd floors		Asbestos Yes
Material Type Cement		Quantity 0.25m ²		Type Chrysotile (White)
		Sample No 06/B/8026/106		
		Survey Date 24.04 - 29.06.06		
		Date of Report 18.08.06		
		Surveyor(s) [REDACTED]		

Photograph



SURVEY INFORMATION SHEET

Turner Ward

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Turner Ward First Floor Flue Pipe		Asbestos Type	 Yes, Strongly Presumed Chrysotile (White)
Material Type Cement		Quantity 1m ²		Sample No	As 06/B/8026/154
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulson, Surrey, CR5 3ES		Position of Sample/Photo Turner Ward W.C. Cistern (X1)		Asbestos	Yes, Strongly Presumed
				Type	Amosite (Brown)
Material Type	Plastic	Quantity	1m ²	Sample No	As 06/B/8026/5
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES	Position of Sample/Photo Turner Ward First Floor Bunny Boiler Internal Panel (presumed within all bunny boilers)	Asbestos Type	Yes Chrysotile (White)
Material Type Cement	Quantity 1m ²	Sample No Survey Date Date of Report Surveyor(s)	06/B/8026/109 24.04 - 29.06.06 18.08.06

Photograph




SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Turner Ward Rawl Plugs (presumed throughout)	Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type	Board	Quantity	1m ²	Sample No As 06/B/8026/65 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Turner Ward Kitchen Rope to pipe		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type	Rope	Quantity	1m ²	Sample No	As 06/B/8026/58
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET


Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Turner Ward Kitchen Sink Paint		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type Bitumen		Quantity 1m ²		Sample No	As 06/B/8026/157
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET


Vanburgh/Vincent Ward

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Vanburgh/Vincent Ward Undercroft Debris	Asbestos Type	No Asbestos Detected N/A
Material Type Debris	Quantity 40m ²	Sample No 06/B/8026/107 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Vanburgh/Vincent Ward Corridor Wall		Asbestos	No Asbestos Detected
Material Type Textured Coating		Quantity 900m ²		Type	N/A
				Sample No	06/B/8026/108
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Vanburgh/Vincent Link Corridor Ceiling Lath Plaster		Asbestos	No Asbestos Detected
Material Type Plaster		Quantity 1500 m ²		Type	N/A
				Sample No	06/B/8026/117
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET



Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Vanburgh/Vincent Ward Kitchen Door Surround		Asbestos	No Asbestos Detected
Material Type Plaster		Quantity 50m ²		Type	N/A
				Sample No	06/B/8026/108
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET


Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Vanburgh/ Vincent Ward Ground W.C Link Wall Panel	<table style="width: 100%;"> <tr> <td style="width: 30%;">Asbestos</td> <td>Yes</td> </tr> <tr> <td>Type</td> <td>Amosite (Brown) Chrysotile (White)</td> </tr> </table>	Asbestos	Yes	Type	Amosite (Brown) Chrysotile (White)								
Asbestos	Yes													
Type	Amosite (Brown) Chrysotile (White)													
<table style="width: 100%;"> <tr> <td style="width: 30%;">Material Type</td> <td>Board</td> </tr> </table>	Material Type	Board	<table style="width: 100%;"> <tr> <td style="width: 30%;">Quantity</td> <td>Approx 0.5m²</td> </tr> </table>	Quantity	Approx 0.5m ²	<table style="width: 100%;"> <tr> <td style="width: 30%;">Sample No</td> <td>06/B/8026/119</td> </tr> <tr> <td>Survey Date</td> <td>24.04 - 29.06.06</td> </tr> <tr> <td>Date of Report</td> <td>18.08.06</td> </tr> <tr> <td>Surveyor(s)</td> <td style="background-color: black; color: black;">[REDACTED]</td> </tr> </table>	Sample No	06/B/8026/119	Survey Date	24.04 - 29.06.06	Date of Report	18.08.06	Surveyor(s)	[REDACTED]
Material Type	Board													
Quantity	Approx 0.5m ²													
Sample No	06/B/8026/119													
Survey Date	24.04 - 29.06.06													
Date of Report	18.08.06													
Surveyor(s)	[REDACTED]													

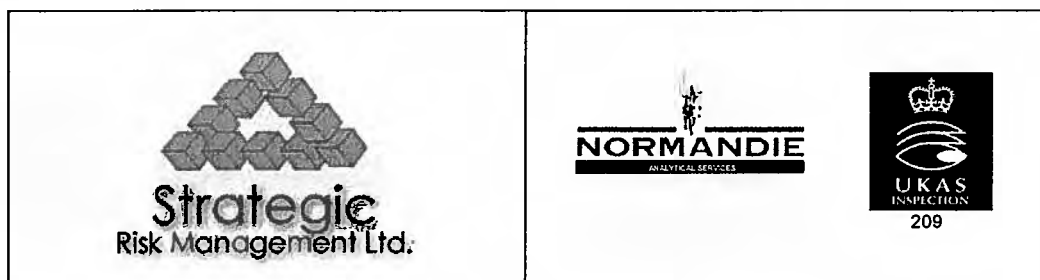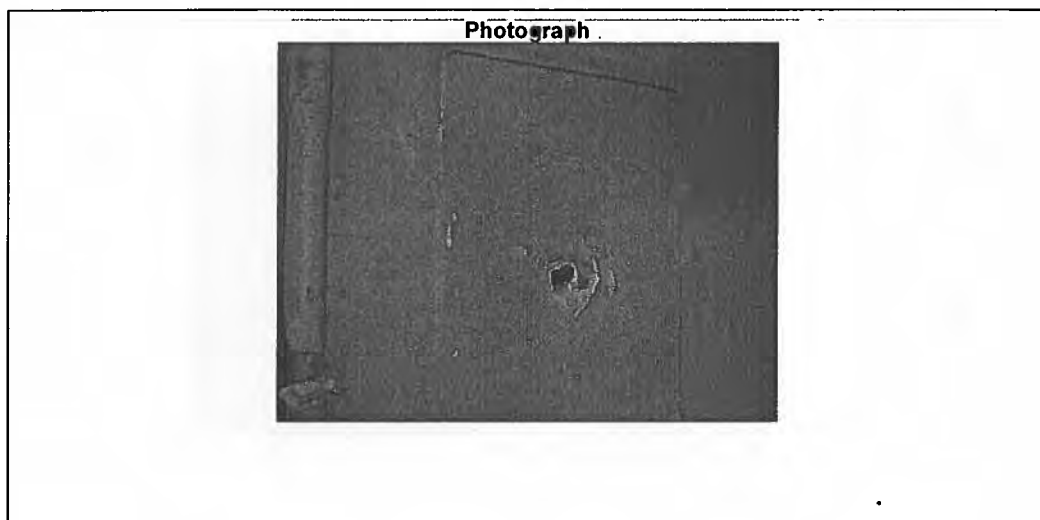

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES	Position of Sample/Photo Vanburgh/Vincent Ward Ground Floor Tile	Asbestos Type	No Asbestos Detected N/A
Material Type	Quantity	Sample No 06/B/8026/120 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s)	
Vinyl	900m ²		

Photograph

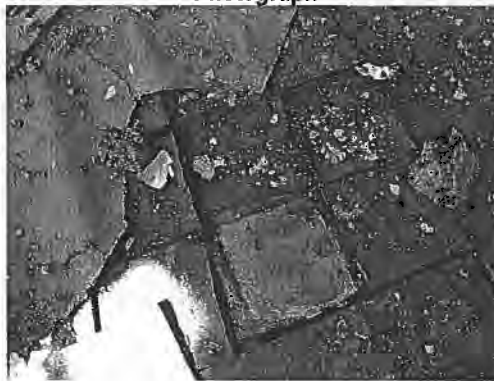

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Vanburgh/Vincent Ward Undercroft		Asbestos	No Asbestos Detected
Material Type Rope		Quantity 10m ²		Type	N/A
				Sample No	06/B/8026/121
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Vanburgh/Vincent Undercroft Debris		Asbestos	No Asbestos Detected
				Type	N/A
Material Type	Lagging	Quantity	900m ²	Sample No	06/B/8026/122
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Vanbrugh / Vincent Ward, Rawl plugs to metal rising pipe sheaths and metal grid heater covers in segregation rooms Throughout ward and presumed throughout site –		Asbestos Type	Yes Strongly presumed Chrysotile (White)
Material Type	Rope	Quantity	2cm ² Each Each sheath approx 8 plugs	Sample No Survey Date Date of Report Surveyor(s)	As 06/B/8026/85 24.04 - 29.06.06 18.08.06


Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Vanbrugh / Vincent Ward Lobby electrics (on each floor) Rope seal		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Rope Type		Quantity 1m		Sample No Survey Date Date of Report Surveyor(s)	As 06/B/8026/22 24.04 - 29.06.06 18.08.06 

Photograph presumed similar (No Access due to fire damage and unsafe floors)

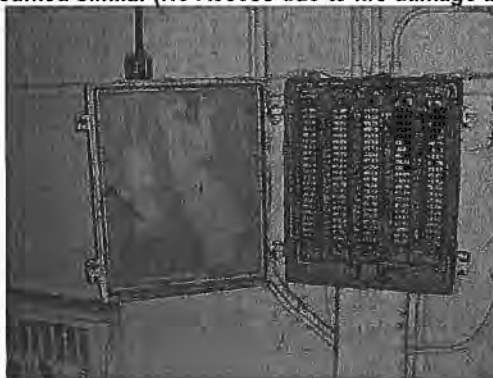

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Vanbrugh / Vincent Ward Kitchens all floors Undersink and drainer paint		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type Bitumen		Quantity 1m ² each sink		Sample No	As 06/B/8026/157
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Vanbrugh / Vincent Ward, Ground Floor Kitchen, Pipe Cloth Wrap debris on floor (presume to 1 st , 2 nd and 3 rd floors)		Asbestos	Yes, Strongly Presumed
Material Rope		Quantity 8m ²		Type	Chrysotile (White)
Material Type		Sample No		As 06/B/8026/88	
		Survey Date		24.04 - 29.06.06	
		Date of Report		18.08.06	
		Surveyor(s)		[REDACTED]	

Photograph




SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Vanbrugh / Vincent Ward Shires lynx WC cisterns (Ground X5 and presume on all floors)		Asbestos Type	Yes Strongly presumed Amosite (Brown)
Material Type	Plastic	Quantity	1m ² Each	Sample No	As 06/B/8026/5
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	


Photograph



SURVEY INFORMATION SHEET

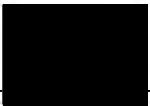
Location of Survey Cane Hill Hospital, Cane Hill, Coulson, Surrey, CR5 3ES		Position of Sample/Photo Vanburgh/Vincent Ward, Lift shaft lining Wall Panels (all floors / whole shaft and ceiling) (no access to lift room unsafe)	Asbestos Type Yes Strongly presumed Amosite (Brown) Chrysotile (White)
Material Type	Board	Quantity 200m ²	Sample No As 06/B/8026/119 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) 

Photograph

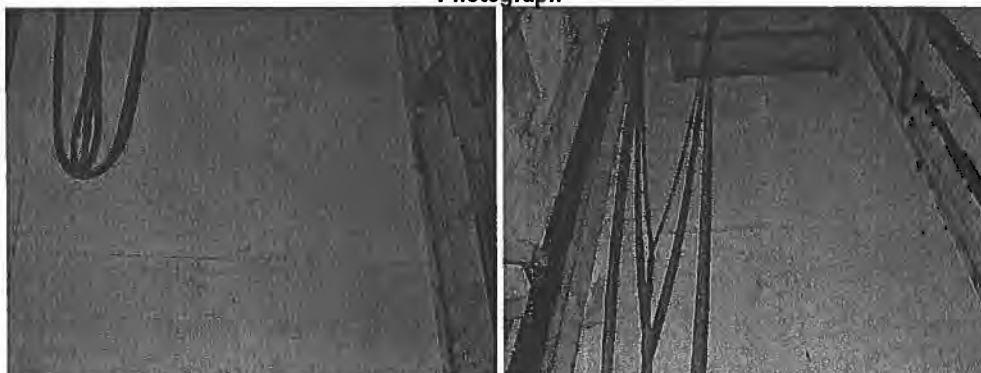

SURVEY INFORMATION SHEET

WWII Underground Bunker

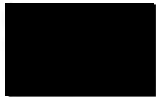Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo WWII Underground Bunker Center Longitudinal Tunnel Wall Water Pipe		Asbestos Type	No Asbestos Detected N/A
Material Type	Bitumen lagging	Quantity	20l/m	Sample No Survey Date Date of Report Surveyor(s)	06/B/8026/110 24.04 - 29.06.06 18.08.06 


Photograph



SURVEY INFORMATION SHEET


Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo WWII Underground Bunker Center Longitudinal Tunnel Fuse Box Flashguard	Asbestos Yes Type Chrysotile (White)
Material Rope Type	Quantity <1m ²	Sample No 06/B/8026/111 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) 

Photograph

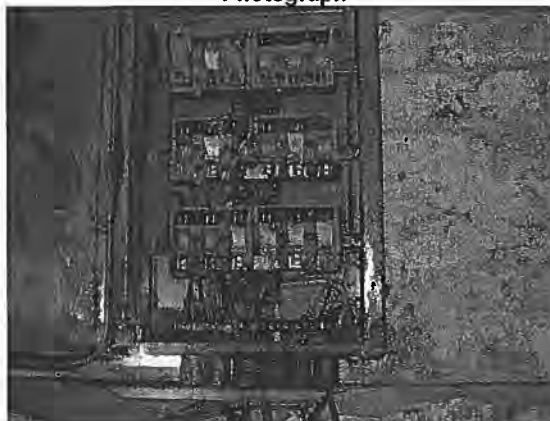

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulson, Surrey, CR5 3ES		Position of Sample/Photo WWII Underground Bunker First Lateral Tunnel Refrigeration Unit Seal		Asbestos	No Asbestos Detected
Material Type Sealant		Quantity 0.5m2	Type N/A Sample No 06/B/8026/112 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) 		

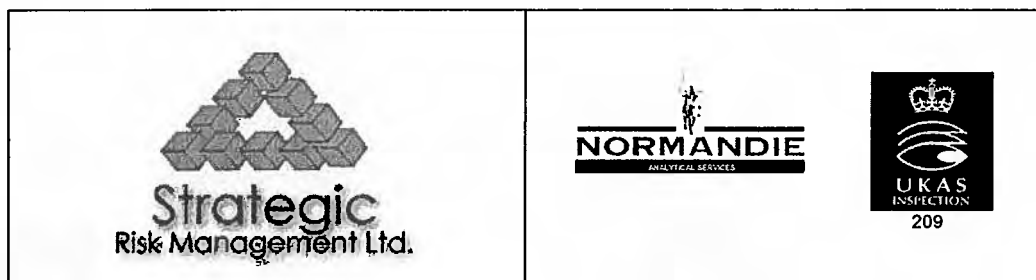

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo WWII Underground Bunker Redundant AIB Sheet in South Longitudinal Tunnel	Asbestos Yes Type Amosite (Brown)
Material Board Type	Quantity 3m ²	Sample No 06/B/8026/113 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo WWII Underground Bunker South Longitudinal Tunnel Redundant Sheets (millboard)	Asbestos Yes	Type Chrysotile (White)
Material Type Board	Quantity 2 l/m	Sample No 06/B/8026/114 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]	

Photograph



SURVEY INFORMATION SHEET



Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo WWII Underground Bunker South Longitudinal Tunnel Redundant Sheets	Asbestos Yes Type Chrysotile (White)
Material Type Cement	Quantity 4m ²	Sample No 06/B/8026/115 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph




SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo WWII Underground Bunker South Longitudinal Tunnel thin Sheets and floor debris (spread through out this area)	Asbestos Type	Yes Strongly presumed Chrysotile (White)
Material Type Cement	Quantity 10m ²	Sample No As 06/B/8026/116 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]	

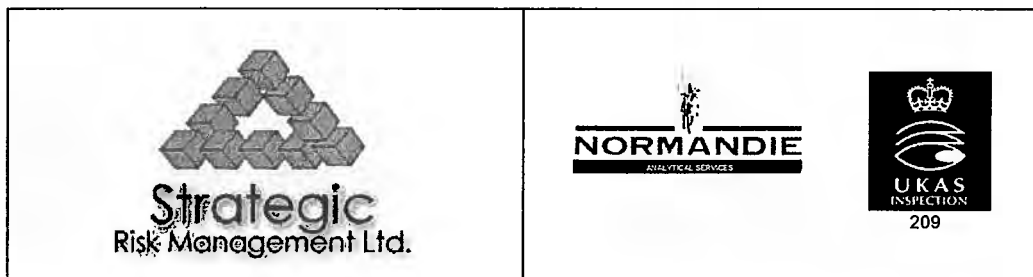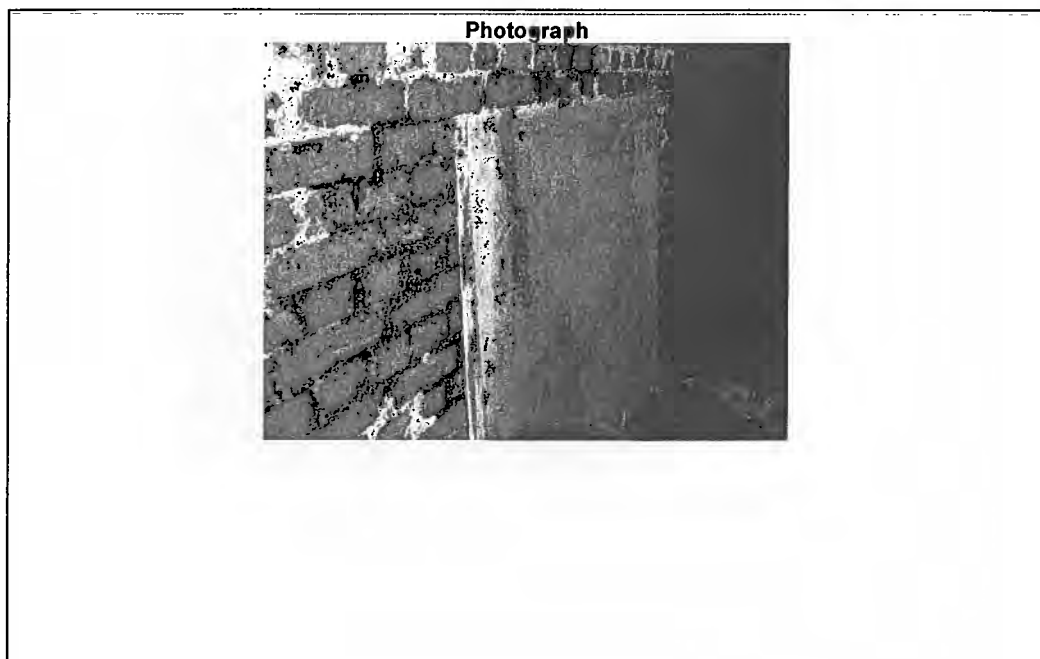

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo WWII Underground Bunker South Longitudinal Tunnel Redundant Sheets leant against wall and floor debris		Asbestos Yes
Material Type Cement		Quantity 8m ²		Type Chrysotile (White)
				Sample No 06/B/8026/116
				Survey Date 24.04 - 29.06.06
				Date of Report 18.08.06
				Surveyor(s) 

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo WWII Underground Bunker Center Longitudinal Tunnel Fuse Box rope seal on floor	Asbestos Type	Yes Strongly Presumed Chrysotile (White)
Material Type Rope	Quantity 1m ²	Sample No As 06/B/8026/111 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]	

Photograph




SURVEY INFORMATION SHEET

Wren/Wesley Ward

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Wren/Wesley Ward Lift Panels		Asbestos Type	Yes, Strongly Presumed Amosite (Brown)
Material Type Board		Quantity 200m ²		Sample No	As 06/B/8026/119
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph

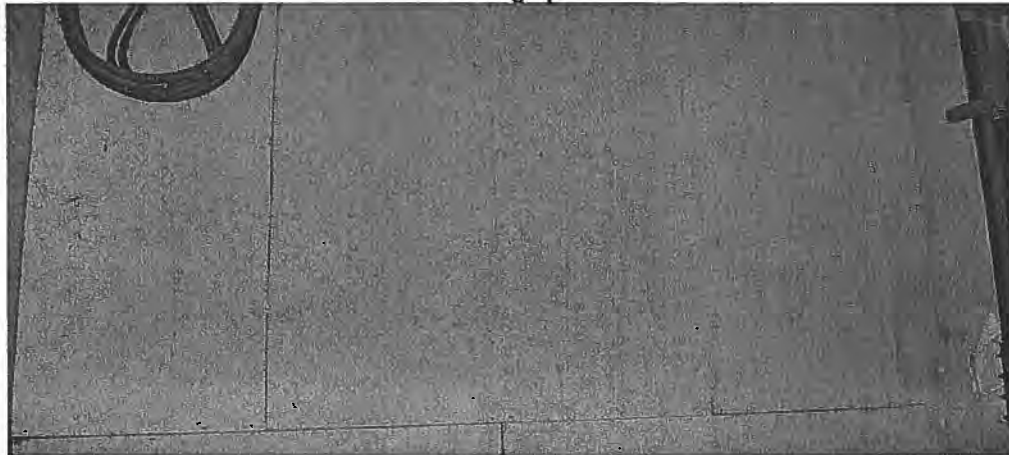


SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Wren/Wesley Ward Sink paint	Asbestos Yes, Strongly Presumed Type Chrysotile (White)
Material Type Bitumen	Quantity 1m ²	Sample No 06/B/8026/157 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

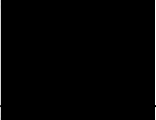Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Wren/Wesley Ward Kitchen rope to pipe		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type	Rope	Quantity	1m ²	Sample No	As 06/B/8026/58
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Wren/Wesley Ward Rope debris in door to bathroom adjacent cells	Asbestos Yes, Strongly Presumed	Type Chrysotile (White)
Material Type Rope	Quantity 1m ²	Sample No As 06/B/8026/58 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) 	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Wren/Wesley Ward Rope debris adjacent door to middle ward	Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type	Rope	Quantity	1m ²	Sample No As 06/B/8026/58 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES	Position of Sample/Photo Wren/Wesley Ward Undercroft Debris (presumed throughout)	Asbestos Yes Type Crocidolite (Blue) Amosite (Brown) Chrysotile (White)	
Material Type Lagging	Quantity <1m ²	Sample No 06/B/8026/123 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Wren/Wesley Ward W.C Cistern (X12)	Asbestos Type	Yes, Strongly Presumed Amosite (Brown)
Material Type	Plastic	Quantity	1m ²	Sample No As 06/B/8026/5 Survey Date 24.04 – 29.06.06 Date of Report 18.08.06 Surveyor(s)

Photograph




SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Wren/Wesley Ward Ward Door Beading		Asbestos	No Asbestos Detected
				Type	N/A
Material Type	Board	Quantity	4m ²	Sample No	06/B/8026/124
				Survey Date	24.04 – 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	[REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Zachary Unwin Ward Electrics Rope seal		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type	Rope	Quantity	1m ²	Sample No	As 06/B/8026/22
				Survey Date	24.04 – 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Zachary/York Ward and Workhouse

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Zachary York Ward W.C. Cistern (X2)		Asbestos	Yes, Strongly Presumed
Material Type Plastic		Quantity 1m ²		Type	Amosite (Brown)
				Sample No	As 06/B/8026/5
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey		Position of Sample/Photo	Asbestos Yes
Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Zachary York Ward Ground floor bathroom Floor Tile & Bitumen	Type Chrysotile (White)
Material Type	Vinyl & Bitumen	Quantity 10m ²	Sample No 06/B/8026/125
			Survey Date 24.04 - 29.06.06
			Date of Report 18.08.06
			Surveyor(s) [REDACTED]


Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Zachary York Ward Corridor electrics (X2) Rope seal	Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type Rope	Quantity 1m	Sample No Survey Date Date of Report Surveyor(s)	As 06/B/8026/22 24.04 - 29.06.06 18.08.06

Photograph

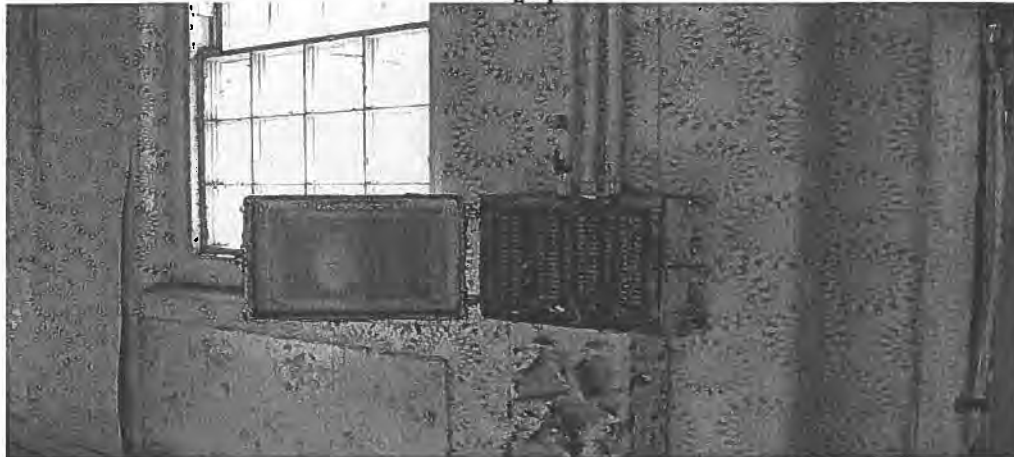

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Workhouse Rope to skylights	Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type	Rope	Quantity	260m	Sample No As 06/B/8026/31 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Workhouse Ground Floor Pipe lagging	Asbestos Yes, Strongly Presumed Type Chrysotile (White)	
Material Type Paper	Quantity 4m	Sample No As 06/B/8026/77 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) 	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Workhouse First Floor Workshop Pipe Lagging		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type	Paper	Quantity	2m	Sample No	As 06/B/8026/77
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Workhouse First Floor Bench Cement Pads to brackets (X3)		Asbestos Type	 Yes, Strongly Presumed Chrysotile (White)
Material Type	Cement	Quantity	<1m ²	Sample No	As 06/B/8026/20
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Workhouse First Floor Workshop Panel to stairs		Asbestos	Yes, Strongly Presumed
Material Type Cement		Quantity 2m ²		Type	Chrysotile (White)
				Sample No	As 06/B/8026/20
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Workhouse First Floor Roof sheet		Asbestos Type	Yes Chrysotile (White)
Material Type	Cement	Quantity	10m ²	Sample No	06/B/8026/126
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulson, Surrey, CR5 3ES		Position of Sample/Photo Workhouse First Floor Rope to skylight		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type	Rope	Quantity	100m	Sample No	As 06/B/8026/31
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph




SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Workhouse First Floor Roof Upstand panels		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type Cement		Quantity 2m ²		Sample No	As 06/B/8026/147
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES		Position of Sample/Photo Workhouse Accommodation Electrics rope seal		Asbestos Type	Yes, Strongly Presumed Chrysotile (White)
Material Type	Rope	Quantity	1m	Sample No	As 06/B/8026/22
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	


Photograph



SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulston, Surrey, CR5 3ES		Position of Sample/Photo Work House Accommodation Roof Felt		Asbestos Type	No Asbestos Detected N/A
Material Type	Felt	Quantity	100m ²	Sample No	06/B/8026/127
				Survey Date	24.04 - 29.06.06
				Date of Report	18.08.06
				Surveyor(s)	

Photograph

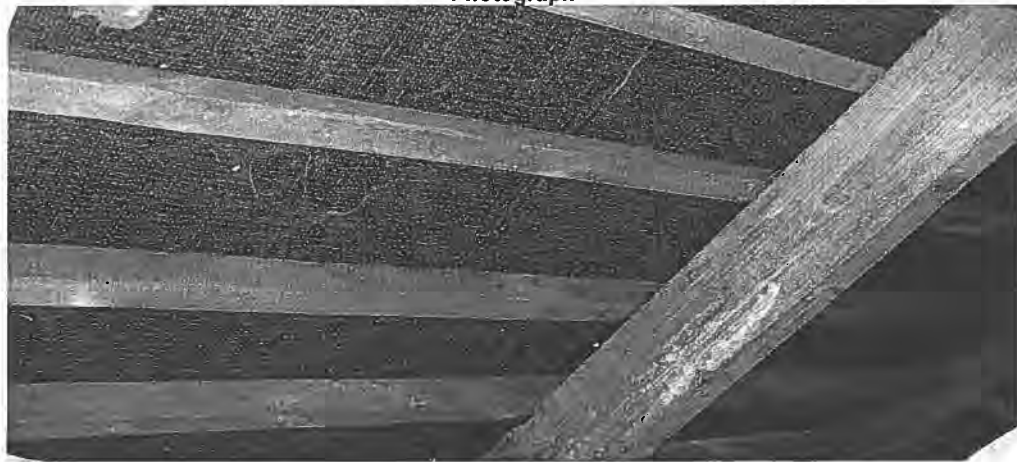

SURVEY INFORMATION SHEET

Location of Survey Cane Hill Hospital, Cane Hill, Coulsdon, Surrey, CR5 3ES	Position of Sample/Photo Workshop Accommodation Dauntless Dolphin W.C. Cistern	Asbestos Yes Type Amosite (Brown)
Material Type Plastic	Quantity 1m ²	Sample No 06/B/8026/128 Survey Date 24.04 - 29.06.06 Date of Report 18.08.06 Surveyor(s) [REDACTED]

Photograph

