

Arboricultural Survey Report and Impact Assessment Eaton Close, Harrow

May 2020

For: London Borough of Harrow



ecologylink

61 Middlewatch
Swavesey
Cambridge
CB24 4RW

Tel: 01954 231375
www.ecologylink.com

Table of Contents

| | |
|--|----------|
| 1. Introduction | 3 |
| Site Description | 3 |
| Survey Summary | 3 |
| Status of Trees..... | 3 |
| 2. Tree Descriptions and Recommendations..... | 4 |
| 3. Arboricultural Impact Assessment..... | 4 |
| Trees to be Removed | 4 |
| RPA and Tree Limb Protection | 4 |
| 4. Evaluation and Recommendations | 4 |
| 5. Appendices..... | 5 |
| Appendix 1 – Tree Survey Data Sheets | 5 |
| Appendix 2 – Tree Constraints Map..... | 5 |
| Appendix 3 – Photographic Record..... | 5 |
| Appendix 4 – Methodology | 5 |
| Appendix 5 – Cascade Chart for Tree Quality Assessment | 5 |

By their very nature, ecological surveys can only assess a site or particular species at a set point in time, providing a snapshot of the environment and not a definitive evaluation. Every effort has been taken to provide an accurate assessment of the habitats or species surveyed. However, presence and population sizes of species can change over time and therefore the accuracy of this report will be affected by time and seasonality.

This document has been prepared by Ecology Link Ltd for the sole use of the client.



1. Introduction

- 1.1 Ecology Link Ltd. was commissioned by the London Borough of Harrow to undertake a tree assessment of an area of land at Eaton Close, Harrow, London HA7 3BT. This report details the results of the survey highlighting any arboricultural constraints to the proposed development works.
- 1.2 The intend to put the site into the GLA Small Sites programme for the construction of residential units.
- 1.3 The survey was undertaken on the 4th May 2020 by Jonathan Panter, an experienced tree surveyor. All inspections were made at ground level. Any further specific investigations required (climbing or decay detection surveys) have been recommended where appropriate.

Site Description

- 1.4 The site was located within a cul-de-sac off Eaton Close (Grid Ref: TQ16809271). It consisted of a largely redundant terrace of garages and associated hard standing. A short section of road led from Eaton Close to the site. Trees were recorded within the site and in adjacent gardens.

Survey Summary

- 1.5 This report was compiled in accordance with BS 5837:2012 Trees in Relation to Design, Demolition and Construction – Recommendations. Preliminary recommendations have been given based on the quality of individuals or groups of trees, from the field survey data (Appendix 1). The Root Protection Area (RPA), for trees and groups have been calculated and presented within the Constraints Map (Appendix 2). The survey data has been supported by a Photographic Record (Appendix 3). However, any specific design proposals have not generally been taken into account at this stage.
- 1.6 The tree survey took the form of a standard ground level site survey, assessing trees and groups using BS Survey Methodology (Appendix 4 & 5). The objective was to produce:
 - A schedule of all trees, or groups of trees, located within or immediately adjacent to the proposed site.
 - An assessment of all trees based on BS 5837:2012 Trees in Relation to Design, Demolition and Construction – Recommendations.
 - Advice on the removal, retention and management of trees.
 - An assessment of the requirement for the protection of trees during construction, with a tree constraints plan identifying Root Protection Areas (RPAs) for all categorised trees.
- 1.7 The client provided topographic maps for the site, detailing the trees to be surveyed.

Status of Trees

- 1.8 A Tree Preservation Order were located close to the site. However, it seems that trees covered by TPO 373 no longer remain. The trees identified in this report do not seem to be covered by this TPO.

2. Tree Descriptions and Recommendations

- 2.1 The only trees specifically recorded on the site were T1 and T2. The remaining trees were within adjacent gardens.
- 2.2 Trees were recorded under a range of Categories (Table 2.1), reflecting their arboricultural value, with T2 and T4 both providing good townscape value. G1 was behind the northern garage line, being only visually assessed from the hard standing area.

Table 2.1: Root Protection Area (RPA) and Tree Categories.

| Ref. | Species | Stem Dia. (mm) | Tree Qual. Ass. | Radius of RPA Guide Circle (m) |
|------|--|----------------|-----------------|--------------------------------|
| T1 | Ash (<i>Fraxinus excelsior</i>) | 210 | C | 2.5 |
| T2 | Hornbeam (<i>Carpinus betulus</i>) | 540 | A | 6.5 |
| T3 | Black locust (<i>Robinia pseudoacacia</i>) | 200 | C | 2.4 |
| T4 | Cherry # (<i>Prunus avium</i>) | 550 | B | 6.6 |
| | | | | |
| G1 | Leyland cypress # (<i>Cupressus × leylandii</i>) | 300 | C | 3.6 |

3. Arboricultural Impact Assessment

- 3.1 A final development design has not yet been provided, as such no specific impacts can be evaluated. Protection must be considered for any tree adjacent to the site if they are subsequently considered to be indirectly impacted by the development.

Trees to be Removed

- 3.2 It is likely that T1 will be removed to allow any future development. This was self-set in the corner of the site, growing through the hard standing and is unlikely to provide any long-term value to the wider environment.

RPA and Tree Limb Protection

- 3.3 T2 and G1 are adjacent to the garage area and are likely to be impacted from any development. It is unlikely that the RPA's follow the spread highlighted on the Constraints Plan (Appendix 2), due to the hard standing. This should be considered in the design, due to its position. A root investigation survey may be required to identify the exact spread and direction of growth beneath the hard standing.

4. Evaluation and Recommendations

- 4.1 All trees on site should be removed. Mitigation for this loss of trees should be in line with Council planting policy. This should include replacement tree planting within and where possible adjacent to the site, being identified in the landscape plan. Tree protection measures should be implemented for trees beyond the site boundary, should the final design risk potential impact (direct or indirect).

- 4.2 These recommendations are based on observations made at the time of the site visit. Trees are dynamic organisms that constantly change and are influenced by their surrounding environment. The information in this report should be considered as a 'snap shot' in time and not as a definitive record of the condition of trees on this site.

5. Appendices

Appendix 1 – Tree Survey Data Sheets

Appendix 2 – Tree Constraints Map

Appendix 3 – Photographic Record


Appendix 4 – Methodology

Appendix 5 – Cascade Chart for Tree Quality Assessment

Appendix 1: Tree survey data sheet.

| Ref. | Species | Height (m) | Stem dia. (mm) | stem No. | Branch spread (m) | | | | Crown height (m) | Age | Condition | Comments | BS5873 Tree Qual. Ass. | Ret. Cat. | Life Expect. (yrs) |
|------|---|------------|----------------|----------|-------------------|-----|-----|-----|------------------|------|-----------|---|------------------------|-----------|--------------------|
| | | | | | N | E | S | W | | | | | | | |
| T1 | Ash (<i>Fraxinus excelsior</i>) | 12.0 | 210 | 1 | 4.0 | 5.0 | 4.0 | 4.0 | 2.0 | Semi | Fair | Developing tree in corner of site, growing through the hard standing. | C | 1 | >10 |
| T2 | Hornbeam (<i>Carpinus betulus</i>) | 14.0 | 540 | 1 | 6.0 | 6.0 | 6.0 | 6.0 | 2.0 | Mat | Good | Maturing tree in good condition having previous management. | A | 3 | +40 |
| T3 | Black locust (<i>Robinia pseudoacacia</i>) | 4.0 | 200 | 1 | 3.0 | 3.0 | 3.0 | 3.0 | 0.2 | Semi | Good | Developing tree within residential front garden. | C | 1 | +20 |
| T4 | Cherry # (<i>Prunus avium</i>) | 10.0 | 550 | 1 | 8.0 | 8.0 | 8.0 | 8.0 | 2.0 | Mat | Good | Maturing tree within residential garden opposite cul-de-sac. | B | 1 | +30 |
| | | | | | | | | | | | | | | | |
| G1 | Leyland cypress # (<i>Cupressus × leylandii</i>) | 10.0 | 300 | 1 | 3.0 | 3.0 | 3.0 | 3.0 | 0 | Semi | Fair | Third party trees behind northern garages | C | 1 | +20 |


= denotes measurements which have been estimated, due to trees outside site boundary with no access.

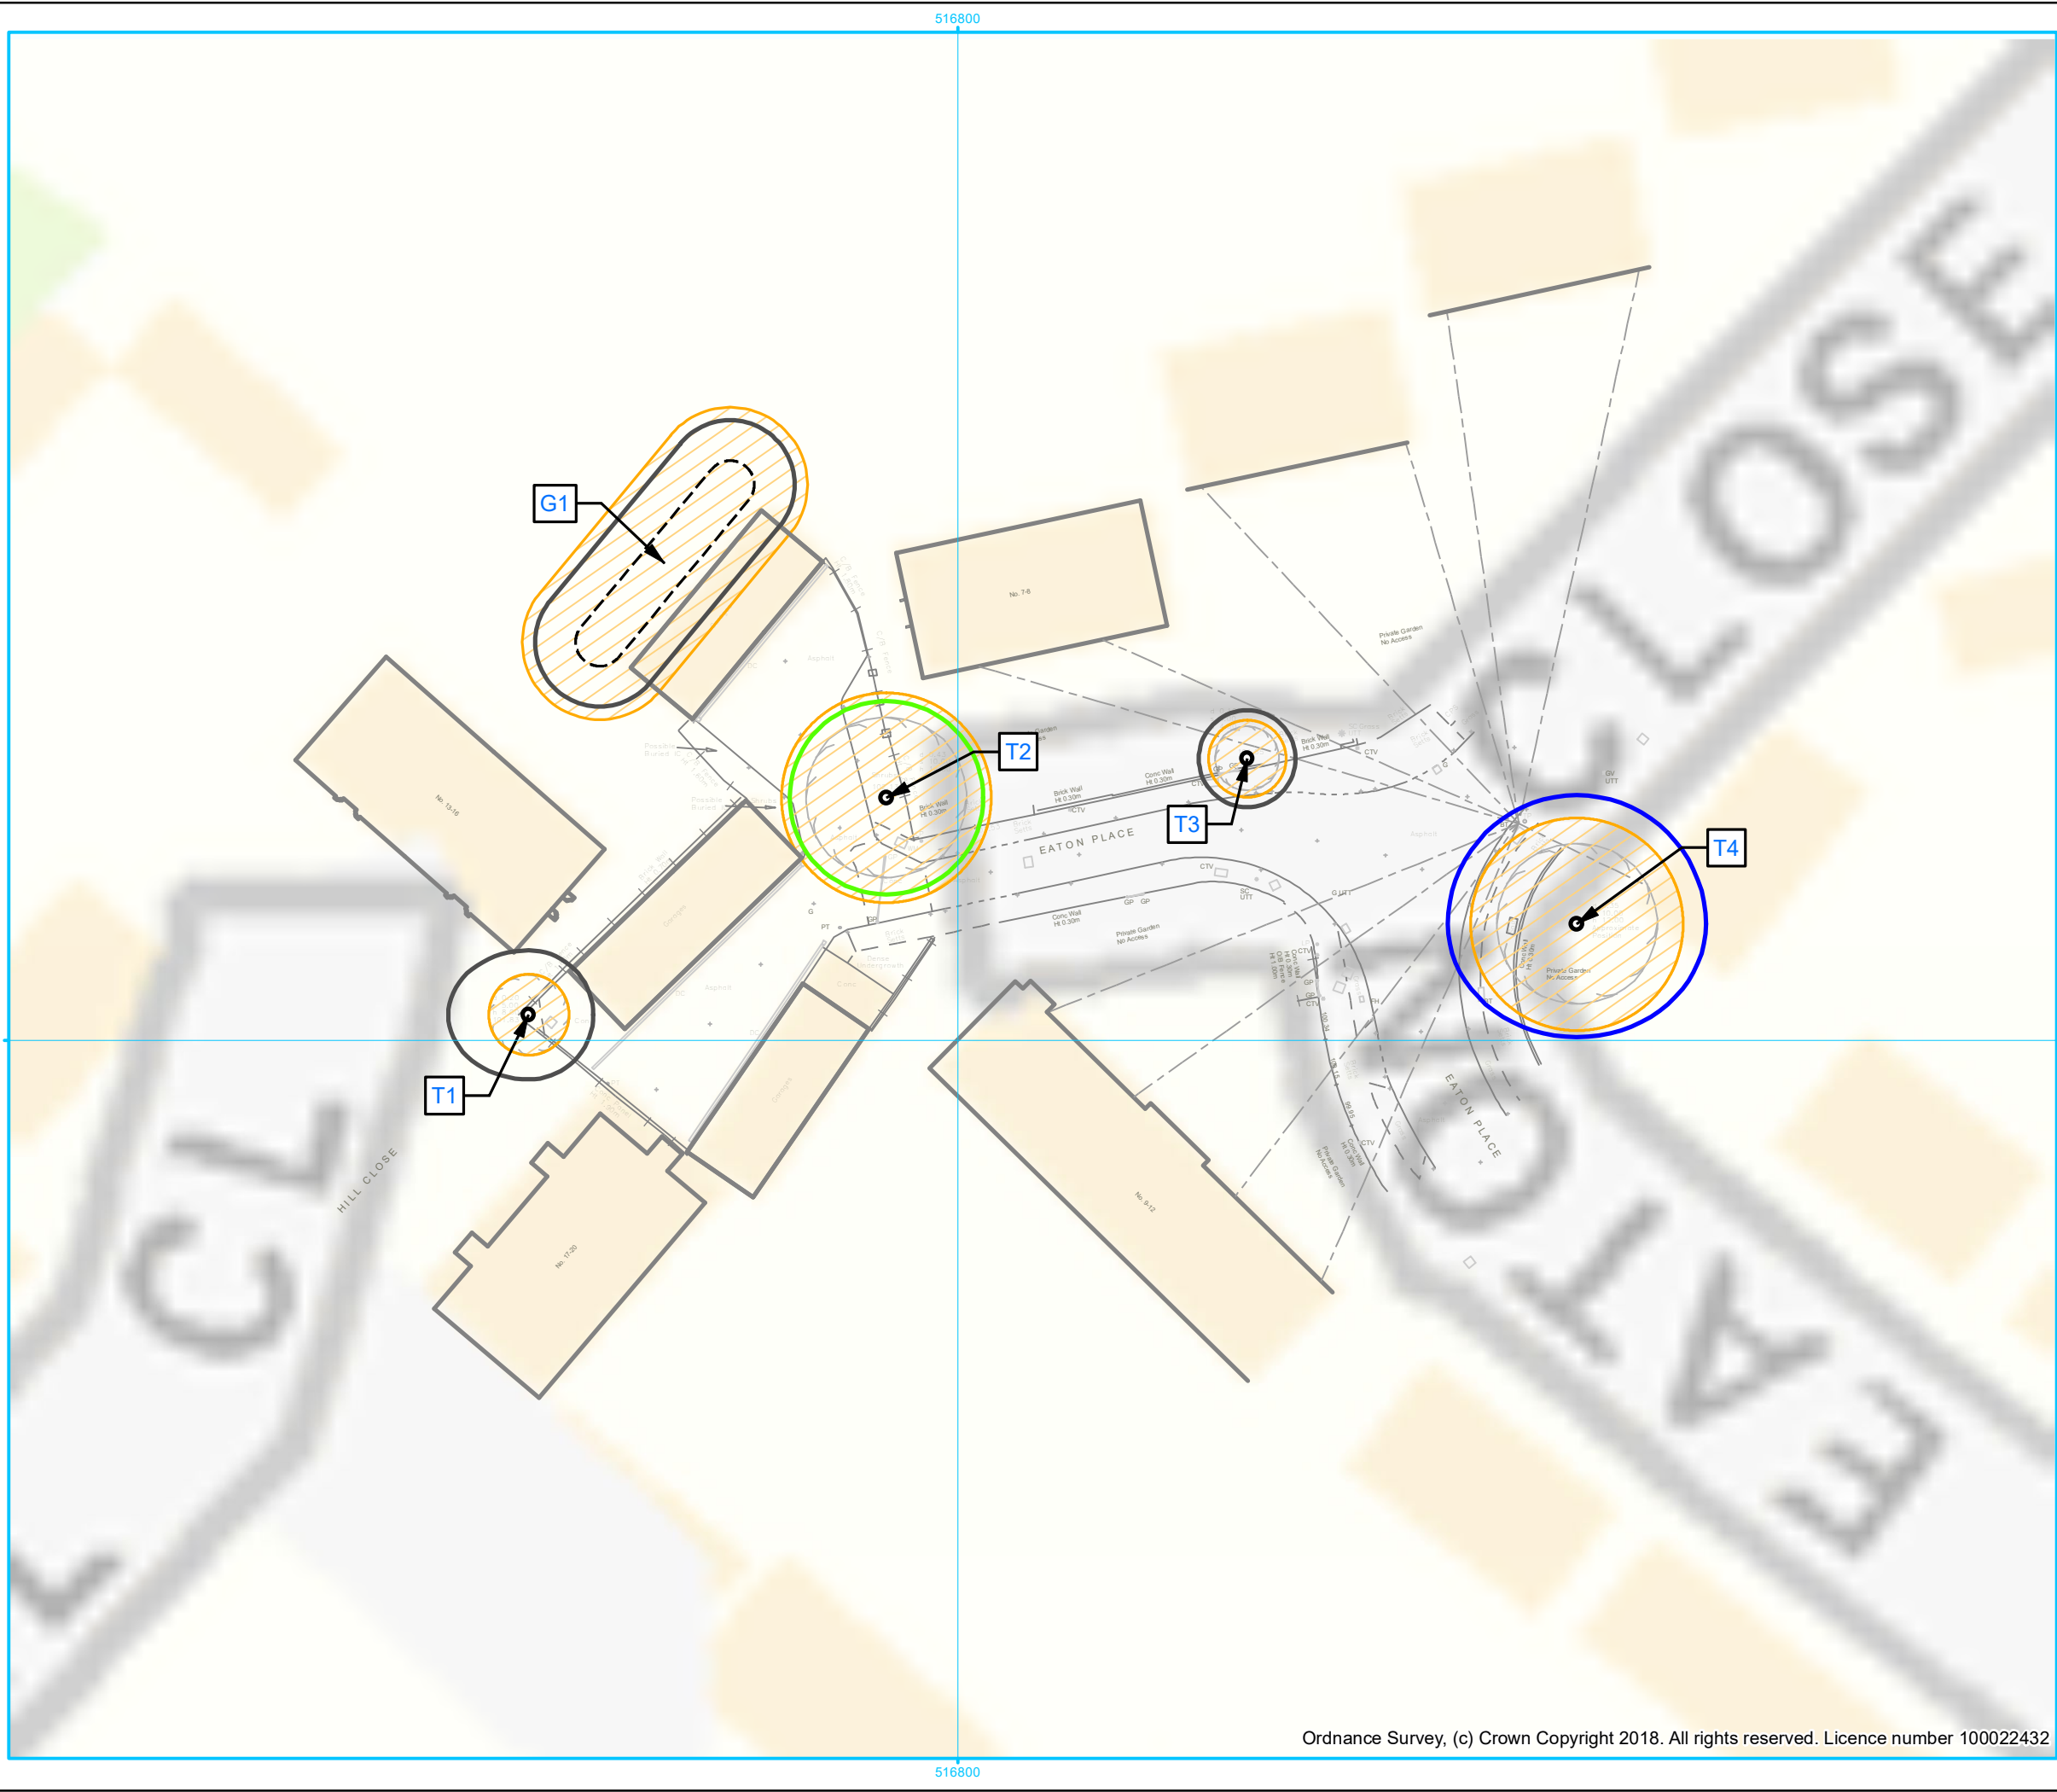

Legend

- Individual tree
- Tree group
- RPA
- Tree Category
 - Category A
 - Category B
 - Category C

Scale: 1:400



Title: **Appendix 2 – Tree Constraints**

Client: MEPK Architects

Project: Land Adj. to 10 Eaton Close

Date: May 2020



Appendix 3: Photographic Record



Photo 1: T1 self-set ash in corner of site.



Photo 2: T1 showing position to the garages and wider site.



Photo 3: T4 within the garden of property opposite access road.

Appendix 4 – Tree Survey Methodology

This document summaries the survey requirements for an arboricultural survey, set out in British Standard 5837 (2012) Trees in Relation to Design, Demolition and Construction.

Methodology

All trees, or groups of trees, within the defined work area, were surveyed from ground height, for their quality and value, in accordance with the BS5837: 2012. Any trees situated outside the area of the work, but may be affected by proposed works, were also included in the survey.

Tree locations to be mapped, GPS readings were taken in the field, for all recorded trees. This allowed the plotting of trees on a topographic survey base map (supplied by the client) and Root Protection Areas to be calculated.

Trees were recorded and assessed individually or, when appropriate, as groups. All data was recorded on Arboricultural Survey Sheets using BS 5837 criteria (Table 2.1). Each tree was given an individual reference.

Any other important observations were also noted. This included evidence of present or past maintenance (including coppicing), damage to the trees, potential hazards, and health and safety issues.

Tree Categories and Implications for Development

Category A trees or groups are considered to be of high quality and value. Where possible, Category A trees should be retained and incorporated into the development design.

Category B trees or groups are considered to be of moderate quality and value. Such trees may be downgraded from Category A due to slight damage or lack of previous management. Category B trees should be considered for retention and incorporated into development design where possible.

Category C trees or groups are considered to have little value and are of poor quality. Such trees may be retained or removed, dependent on development priorities.

Category U trees or groups are considered likely to lose the little value they have within ten years and should be removed.

Retention and removal recommendations provided are not definitive and some trees recommended for retention may be considered for removal to facilitate particular construction activities. It may be justifiable to remove those trees within the site considered to be at an early growth stage, or individuals in close proximity to each other. Tree removal under these circumstances can be justified on the basis of sound design rationale and appropriate levels of mitigation, such as the planting of native species and local provenance stock. However, mature trees should be considered for retention if they are in sound health and are of significant arboricultural or landscape value.

Root Protection Areas

The Root Protection Area (RPA) is the minimum area (m²) surrounding a tree that should be protected during construction, to avoid root damage. This ensures long term survival and resource availability.

The RPA for each tree or group of trees surveyed was calculated using the standard formulae given in BS 5837. For single stem trees, each circular RPA has a radius 12 times the stem diameter. For those trees with multiple stems the calculation is based on the combined stem diameter (two to five stems), or the mean stem diameter (more than five stems).

The calculated RPAs should be used to define Construction Exclusion Zones (CEZ). These CEZs must be fenced-off prior to any construction phase commencing to help ensure adequate tree protection.

Table 2.1: Standard data recorded during the arboricultural survey.

| Category | Specific Information Collected |
|--|---|
| Reference | Trees are referenced T1, T2, etc. Groups are referenced G1, G2, etc. |
| Species | The common English and scientific names are given. |
| Height | Estimated from ground level and given in metres (recorded to nearest 0.5m, or to 1.0m for dimensions over 10m). |
| Stem Diameter | <p>Measured in millimetres, 1.5 metres above ground level. For multi-stemmed trees (coppiced) combined (2-5 stems), or mean (>5 stems), are calculated.</p> <p>Trees with a diameter of less than 75mm are not included in the survey as their value can be considered negligible (particularly as a replacement value).</p> |
| Number of Stems | Number of stems on an individual tree. |
| Branch Spread | The north, south, east and west branch spread is estimated in metres (recorded to nearest 0.5m, or to 1.0m for dimensions over 10m). |
| Crown Height | <p>The point at which the first branches start, estimated in metres. Trees which are coppiced (naturally or through management), are expressed with a 'C'.</p> <p>First significant branch (if different from above) and direction of growth (e.g. 3.0-N)</p> |
| Life Stage | <p>In accordance with BS 5837, trees are classified as:</p> <p>Young – 1/3 life expectancy Semi-mature – tree 1/3 - 2/3 life expectancy Early mature – later stages of growth Mature – mature tree Over-mature – over-mature tree Vet – Veteran tree</p> |
| Condition | <p>In accordance with BS 5837, trees are classified as:</p> <p>Good Moderate Poor Very poor</p> |
| Tree Quality Assessment & Retention Category | <p>Based on BS 5837 Table 1: Cascade chart for tree quality assessment (Appendix 3)</p> <p>A - Trees of high quality and value (sub categories 1, 2, 3) B - Trees of moderate quality and value (sub categories 1, 2, 3) C - Trees of low quality and value (sub categories 1, 2, 3) U - Trees in such a condition they should be removed</p> <p>Category U trees do not need to be considered in the development plan process.</p> |
| Life Expectancy | Estimated in years (in terms of natural growth rates) such as <10, 10+, 20+, 40+. |

Appendix 5 - Cascade Chart for Tree Quality Assessment

| TREES FOR REMOVAL | | | | |
|---|--|---|---|---|
| Category and Definition | Criteria | | | Identification on plan |
| Category U Those in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years | <ul style="list-style-type: none">■ Trees that have a serious, irremediable, structural defect, such that their early loss is expected due to collapse, including those that will become unviable after removal of other U category trees (e.g. where, for whatever reason, the loss of companion shelter cannot be mitigated by pruning).■ Trees that are dead or are showing sign of significant, immediate and irreversible overall decline.■ Trees infected with pathogens of significance to the health and / or safety of other trees nearby, or very low quality trees suppressing adjacent trees of better quality. <p>NOTE: Category U trees can have existing or potential conservation value which it might be desirable to preserve.</p> | | | DARK RED RGB code: 127-000-000 AutoCAD 246 |
| TREES TO BE CONSIDERED FOR RETENTION | | | | |
| Category and Definition | 1. Mainly arboricultural qualities | 2. Mainly landscape qualities | 3. Mainly cultural values, including conservation | Identification on plan |
| Category A Those of high quality with an estimated remaining life expectancy of a least 40 years | Trees that are particularly good examples of their species, especially if rare or unusual; or those that area essential components of groups or formal or semi-formal arboricultural features (e.g. the dominant and/or principal trees within an avenue) | Trees, groups or woodlands of particular visual importance as arboricultural and / or landscape features | Trees, groups or woodlands of significant conservation, historical, commemorative or other value (e.g. veteran trees or wood-pasture) | LIGHT GREEN RGB code: 000-255-000 AutoCAD 90 |
| Category B Trees of moderate quality with an estimated remaining life expectancy of a least 20 years | Trees that might be included in category A, but are downgraded because of impaired condition (e.g. presence of significant though remediable defects including unsympathetic past management and minor storm damage), such that they are unlikely to be suitable for retention for beyond 40 years; or trees lacking the special quality necessary to merit the category A designation | Trees present in numbers, usually growing as groups or woodlands, such that they attracting a higher collective rating than they might as individuals; or trees occurring as collective but situated so as to make little visual contribution to the wider locality | Trees with material conservation or other cultural value | MID BLUE RGB code: 000-000-255 AutoCAD 170 |
| Category C Those trees of low quality with an estimated remaining life expectancy of a least 10 years, or young trees with a stem diameter below 150mm | Unremarkable trees of very limited merit or such impaired condition that they do not qualifying in higher categories | Trees present in groups or woodlands, but without this conferring on them significantly greater collective landscape value; and/or trees offering low or only temporary/transient landscape benefit | Trees with no conservation or other cultural value | GREY RGB code: 091-091-091 AutoCAD 252 |

Text extracted from BS 5837:2012 'Trees in relation to design, demolition and construction – Recommendations'

Company Directors

Jonathan Panter

Mobile: 07506 703540

j.panter@ecologylink.com

Helen Parish

Mobile: 07917 208040

h.parish@ecologylink.com

Ecology Link Ltd. | Registered Office: 61 Middlewatch, Swavesey, Cambridge CB24 4RW
Tel: 01954 231375 | Registered in England No. 07015978 | VAT registration No. 982 3666 82
www.ecologylink.com

